GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001

F-6/DFS/MS/EH/SZ/2021/475

Dated:- 01/11/2021

Yours faithfully

0/cPh: 011-23414000

Director

Sh. Raj Kumar Ohri (Owner), M/s. Real Food Restaurant, Plot No. B- 225, Naraina Industrial Area, Phase- 1, New Delhi- 110028.

Sub: - Regarding issuance of fire safety certificate in r/o M/s. Real Foods Restaurant, Plot No. B-255, Naraina Industrial Area, Phase - 1, New Delhi- 110028.

Sir,

NO.

To.

Please refer to online application ID 2021091821821 dated 02.10.2021 on the subject cited above. Above said eating house running at ground and first floor of a building comprised of ground plus three upper floors. In this connection it is to inform you that the above said assembly building (Restaurant) was inspected by the officer concerned of this department from safety point of view on 07.10.2021 in presence of Mr. Vikas Tomer, (Area Manager).

During the course of inspection it has been observed that fire safety arrangements such as fire extinguishers, First aid hose reels found provided, However the following shortcomings have been observed:-

- 1 Two staircases with width 2.0 & 1.50 mts. are required.
- 2 Two exits with 1.50 mts. each are required.
- 3 Fire Check Doors are not provided in kitchen.
- 4 Smoke ventilation not provided.
- 5 MOEFA found not provided.
- 6 P.A system found not provided.
- 7 Internal hydrant system found not provided.
- Required electrical fire pump capacity of 2280 LPM and standby diesel pump of 2280
 LPM capacity along with jockey pump of 180 LPM
- 9 Terrace pump capacity 450 LPM is provided but not functional.
- 10 Underground water tank requirement of 1,00000 lts capacity found not provided.
- 11 Overhead water Tank capacity 4,000 lts provided against requirement of 5,000 lts for firefighting is required.
- 12 Serving counter not segregated from kitchen area to dining hall which is not permitted.

Keeping in view of above, fire safety certificate cannot be considered at this stage. You are requested to rectify the above said shortcomings for taking further necessary action in this matter.

Copy to:-

1. The Executive Engineer (Building), North MCD, Karol Bagh, Anand Parbat, New Delhi.

C- 9