

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI <u>HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI–110001</u>

Io. F.6/DFS/MS/School/2022/SZ/ 🍋 🌫

Dated: 27/04/2022

The Principal, Baba Banda Singh Bahadur Memorial Sr. School, Mehrauli New Delhi 110030

Sub: Regarding issuance of Fire Safety Certificate (FSC) in r/o Baba Banda Singh Bahadur Memorial Sr. School, Mehrauli New Delhi 110030.

Sir,

This has reference with letter no BBS/1091/March/2022 dated 30/03/2022 on the subject cited above. In this connection, it is to inform you that the above mentioned premise was visited by the officer concerned of this department on 19/04/2022 and observed that the shortcoming intimated vide letter of even no. 503 dated 13/05/2020 has not been complied yet. (Copy Enclosed for ready reference).

In view of above Shortcomings, the application for issuance Fire Safety Certificate is rejected. The occupancy of the building/premises in absence of requisite fire safety arrangements shall be at the risk and liability of the owner/occupier. The Licensing authority/ Statutory Authority may take suitable necessary action as deemed fit.

Yours faithfully,

(SUNIL CHAWDHARY) DY. CHIEF FIRE OFFICER (SZ)

Copy to:

1. The Directorate of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi 110054.

GOVERNMENT OF NATIONAL CAPITAL TERRITOTY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI- 110001

No. F6/DFS/MS/School/2020/SZ/ 50 3

Dated: 13/5/2020

~~<u>1</u>]

To

The Principal, Baba Banda Singh Bahadur Memorial Secondary School. Mehrauli. New Delhi-110030

Sub.:- Issuance of Fire Safety Certificate in r/o Baba Banda Singh Bahadur Memorial Secondary School, Mehrauli, New Delhi-110030 Sir.

This has reference to your letter No. Nil dated: Nil received through outdoor dairy No. 3162 dated 17/02/2020 on the subject cited above. In this connection, the school premises have been visited by officer concerned of this department in the presence of Mrs. B Dutta (Principal) and observed that school building is comprised of two blocks A block- basement, ground plus two upper floors and B block- ground plus two upper floors. During the inspection it was observed that the department issued shortcoming vide letter no F6/DFS/MS/SZ/School/2016/469 dated 19/02/2016 have not been rectified so far.

- 1. Additional staircase required in both block with clear width of not less than 0.75m.
- 2. Fire/Smoke check door is not provided at basement floor.
- 3. Smoke management system is not provided at basement floor.
- 4. 03nos of fire extinguisher are provided against the required 16 nos. of fire extinguishers.
- 5. First -Aid hose reel are not provided at each floor.
- 6. Boosting arrangement (A pump having discharge capacity of 450 LPM and 40m head) for hose reel is not provided.
- 7. Overhead water tank capacity of 10,000 liters for firefighting is not provided at terrace.
- 8. Exit signage not provided at conspicuous places at every floor.

In view of the above shortcoming, Fire Safety Certificate cannot be considered at this stage. You are requested to rectify the shortcoming under intimation to this department for further action in the matter.

Yours Mithfully.

(S. S. Tuli) Dy. Chief Fire Officer (SZ) Delhi fire service

821

Copy to: -

1. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi.