## GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE NEW DELHI- 110001

No. F6/DFS/MS/School/2022/SZ/ 320

Dated: 16/06/2022

To,

The Manager, Convent of St. Garjiya, R 1/43, Vani Vihar Uttam Nagar, New Delhi-110059.

Sub: - Regarding issue of "Fire Safety Certificate" from fire safety point of view in r/o Convent of St. Garjiya, R 1/43, Vani Vihar Uttam Nagar, New Delhi-110059.

Sir,

This has reference to your letter No. COSG/MISC dated 19/05/2022 on the subject captioned above. In this connection, it is to inform you that the above mentioned school premises was inspected by the officer concerned of this department on 02/06/2022 in the presence of Manager to verify the compliance of shortcoming already communicated by this department vide letter no. F6/DFS/MS/School/2019/SZ/3157 dated 24/05/2019 and observed that shortcomings are still not rectified. The management will be held responsible for any untoward incident for the period if compliance is not made.

Yours faithfully

(Sunil Chawdhary)

Dy. Chief Fire Officer

9015

Copy to:-

The Director of Education,
Govt. of NCT of Delhi,
Old Secretariat, New Delhi-110054.
(With a request to take further action as school does not have fire NOC)

## GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001

No: F.6/DFS/MS/School/2019/SZ

3157

Dated:

24/05/19

To,

The Manager, Convent of St. Garjiya, Vani Vihar, Uttam Nagar, New Delhi-110059

Sub: - Regarding issuance of Fire Safety Certificate in r/o Convent of St. Garjiya, Vani Vihar, Uttam Nagar, New Delhi-110059.

Sir,

This has reference to your Letter No. COSG/Misc/f86/2019 dated 27.03.2019 on the subject cited above. In this connection, it is to inform you that the inspection of above said school building has been carried out by officer concerned of this department on 26.04.2019 to see the requisite fire safety measures. Smt. Ritu (Coordinator) was present at the time of inspection.

During the course of inspection it was observed that school building comprised of ground plus two upper floors. The upper floors are served by two staircases having width 106 & 94 cms. The electrical wiring was seen concealed and the electric supply was passing through MCB's. The following shortcoming was observed:-

- 1. The building is not approachable through 06 meters wide road.
- 2. The upper floors are served by two staircases having width 106 & 94 cms against required two staircases having width not less than 150 & 100 cms each.
- Door width is 87 cms against required 120 cms.
- 4. Hose reel system is not provided.
- 5. Fire pump having capacity 450 LPM not provided for hose reel system.
- 6. Overhead water storage tank of 10,000 ltrs capacity not provided for hose reel system.
- 7. Exit signs are not provided.
  - If student capacity is more than 45 in any class room then double door having width 120 cms is required.

You are advised to rectify the above-mentioned shortcomings for taking further action as necessary for grant of Fire Safety Certificate.

Yours Faithfull

(ATUL GARG) CHIEF FIRE OFFICER

Copy to:-

Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi – 110054