



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI- 110001



No.F6/DFS/MS/2023/EH/530

Dated 18/09/2023

To

The Addl. Commissioner of Police( Lic.)  
1<sup>st</sup> floor, Police Station, Defence Colony  
New Delhi.

**Sub:-** Regarding issuance of fire safety certificate in r/o M/s Karigari (A Unit of Karigari Restaurant Pvt. Ltd.) Located at Plot No- M 21/31, Ground Floor & First Floor, Mall Road, Timarpur, Civil Line, Delhi-110054.

Sir,

This has reference to your online I.D. No. 2023090415592 Dated: 07.09.2023 on the subject cited above. In this connection this is to inform you that the above mentioned premise was visited by the officer concerned of this department on 14.09.2023 in the presence of Mr. Rakesh Nandwani (Partner) to verify the fire safety arrangements as stipulated in NBC Part-IV and as well installed in the building. During the course of inspection it has been observed that the building/ premise is comprised of basement, ground & 03 upper floors but (Restaurant is running at ground floor & first floor only). Your request for FSC is rejected under Rule 35 (3) due to following shortcomings.

- 1 There are only one exit door provided at ground floor width of 02m against the requirements of 02m & 1.50m and also second floor exit doors width of 02m & 1.20m provided against the requirements of 02m & 1.50m.
- 2 There are 02 no's of staircases provided at first floor width of 02m & 1.50m. The second exit door is also not qualifying the requirement of safe means of escape as this escape route is through the kitchen area of the restaurant.
- 3 Smoke ventilation system found closed by fix glass needs to be removed.
- 4 Fire extinguisher not provided at site.
- 5 Hose reel hose provided but not functional.
- 6 MOEFA system provided but not functional,
- 7 Internal hydrant not provided in the restaurant.
- 8 Terrace level fire pump provided but not an auto mode.
- 9 Terrace level fire water tank capacity of 10,000ltr provided against the requirement of 20,000ltr.
- 10 Exit signage's and floor signage not provided at strategic location in the restaurant.
- 11 Standby power supply not provided.

Keeping in view of above, grant of Fire Safety Certificate cannot be considered at this stage & rejected. You are requested to rectify the above mentioned shortcomings under intimation to this department; till such time running of restaurant is at your own risk & responsibility.

Yours faithfully

(Atul Garg)  
Director

Ph: 011-23414000