



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI- 110001

75  
आजादी का  
अमृत महोत्सव

No. F6/DFS/MS/WZ/2024/25

Dated: 19/01/24

462

To,

The Manager,  
Indraprastha World School,  
A-2, Block, Paschim Vihar,  
New Delhi-110063.

**Subj:- Regarding renewal of Fire Safety Certificate in respect of Indraprastha World School, located at A-2, Block, Paschim Vihar, New Delhi-110063.**

Sir,

This has reference to your email dated 26/12/2023 received vide e-mail ID [indraprasthaschool@gmail.com](mailto:indraprasthaschool@gmail.com), on the subject cited above. In this connection, it is to inform you that the the said school building have been re-inspected by the officer concerned of this department on 06/01/2024 in the presence of Sh. M S Sangwan (Manager) & Sh. Bhagwant Singh (Account Head) to check compliance of shortcomings issued by this department vide letter no. F6/DFS/MS/WZ/2023/School/322 dated 09/08/2023.

During the course of inspection, it has been observed that the school management has rectified some of the shortcomings, the status is under as:-

S. N.	Shortcomings	Status
1.	The management has installed the lift in the school building without intimation to this department	Rectified, fireman Switch provided
2.	Wooden boards used for wall paneling and partitions in the library shall be painted with fire retardant paint	Not rectified
3.	Domestic connection in overhead water storage tank shall be removed. It is exclusively for firefighting purpose	Not rectified
4.	Rooms constructed on terrace shall be removed	Not rectified
5.	One fire pump capacity 450 lpm for sprinkler system of M.P. Hall found removed	Provided
6.	Hose reel in M.P. Hall found removed	Provided
7.	Smoke management system in M.P. Hall found removed	Not rectified
8.	Openable window shall be provided in each air conditioned room	Not rectified
9.	Terrace exit/door found locked	Not rectified
10.	Hose reel hose nozzles at some places found missing	Rectified
11.	Exit singages are non adequate	Not rectified
12.	Curtains in M.P. hall shall be treated with fire retardant material	Rectified (as curtains found removed)
13.	Atrium covered with PVC coated fabric shall be replaced with metro sheets	Not rectified
14.	Access to overhead tank/inspection ladder found removed	Not rectified

In view of the above shortcoming, the application for renewal of Fire Safety Certificate cannot be considered at this stage & rejected. The occupancy of the building/premises in absence of requisite fire safety arrangements shall be at the risk and liability of the owner/occupier.

Yours faithfully,

(Atul Garg)  
Director

Copy to:-

1. The Director, Directorate of Education, GNCT of Delhi, Old Secretariat Delhi - 110054.