

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001



No. F-6/DFS/MS/2024/Residential/ 457

Dated: 6 108/2024

To,

Sh. C.A. Murthy, Parsvnath Metro Tower, Near Shadhra Metro Station, Shadhra, Delhi-110092.

Sub:- Regarding issuance of Fire Safety Certificate in r/o Parsvnath Group Housing Complex "A Block" Tower No. 1,2,3,4,5, 21,23 & One Community Hall at Magazine Road, Khyber Pass, Civil Line, Delhi-110007.

Sir,

Please refer to your letter No. nil dated 06.05.2024 received in this department vide outdoor dairy no- 2640 dated 06.07.2024 on the subject cited above. In this connection this is to inform you the aforesaid building was inspected by the officers concerned of this department on 09.08.2024 in the presence of Sh. Nitin (Maintenance Head) to verify the status of the shortcomings already issued by this department vide letter No.F6/DFS/MS/2023/Residential/4264 dated 15.11.2023 and status is as under:

S No.	Shortcomings	
1.	Unity one staircase continues from ground to	Status
72	site both staircase required from ground to terrace level provided at the	Not Complied
2.	The check doors are not provided in lift lobby each a	
3.	Terrace level fire pump 450lpm & torrace land 5	Not Complied
	20,000ltr not provided for community hall.	Not Complied
4.	The internal road for fire tender movement:	
_	providing paved road.	Provided
5.	Pressurization system not provided in staircase & lift lobbies.	
6.	Smoke ventilation system and it is	Provided
7.	Smoke ventilation system provided in basement but found not functional. Floor level marking and exits signage's not are in the signage's not are in the signage.	Provided
_	signage's not provided at some places	Provided
8.	lower No. 1, 2, 5, 21 & 23 two villes	Tiovided
-	ventilation & detector system not provided in basement but found	Provided
9.	Electrical Shall are not properly social	
10	but not integrated with detector/sprinkler system.	Provided
10.	The state of the s	
		Provided
12.	Internal hydrant provided but not functional and nozzle are not provided. Staircase serving to basement is not sagreed to hydrant also.	Provided
13.	Staircase serving to basement is not segregated at ground floor. Facades are not properly sealed at seal of the sealed at ground floor.	Provided
14.	Facades are not properly sealed at each floor for compartmentation. Fire control room is not provided as per secret.	Provided
15.	Fire control room is not provided as per sanctioned plan.	Provided
	provided as per sanctioned plan.	Provided

Keeping in view of above observations, the said building is not safe from fire safety point of view. Hence, you are hereby advised to comply the observations at the earliest under intimation to this measures in the event of fire and other emergency the management is solely responsible.

Yours faithfull

Director

n:-011-23414000