

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001**

Fax: 23412593, E-mail: cfohq.dlfire@nic.in, Tel:- 011-23414333

NO.F6/DFS/MS/EH/2013/ 52/1266

Dated: 29/11/13

FIRE SAFETY CERTIFICATE

Certified that Adaab Restaurant (A unit of Adaab Hotels Ltd.) T-307, 3rd Floor, Ambience Mall, Plot No. 2, Nelson Mandela Marg, Vasant Kunj, New Delhi at third floor of Ambience Mall was inspected by the officer concerned of this department on 22-11-2013 in the presence of Mr. Mahender Rana, manager of the restaurant and found that the said restaurant have complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules 2010 and that the premises / building is fit for occupancy class **residential (restaurant)** with effect from 29/11/13 for a period of **3(three)** years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi fire service Rules,2010.

Issued on 29/11/13 at New Delhi by.



(Dr. G.C. Misra)
CHIEF FIRE OFFICER
DELHI FIRE SERVICE

Copy to: -

1. The Addl.C.P (Lic.), Police Station, Defence Colony, 1st floor, New Delhi.
2. Deputy Health Officer, South Zone, MCD, Health Department, Green Park, New Delhi.
3. The Manager, Adaab Restaurant (A unit of Adaab Hotels Ltd.), T-307, 3rd Floor, Ambience Mall, Plot No. 2, Nelson Mandela Marg, Vasant Kunj, New Delhi.

Conditions for the validity of fire safety certificate


- a. All the fire safety and means of escape facilities shall be maintained in good working conditions at all time. Any lapse rendering fire safety or means of evacuation facilities rendering non-functional shall be the responsibility of the management.
- b. Building Sanctioning authority may verify any deviation with regard to the construction / occupancy in the building. In case of any deviation, the fire safety certificate stands null and void.
- c. The staffs shall be trained for operating fire fighting system and mock evacuation drills be conducted at regular intervals and record be maintained.
- d. The owner/occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on website www.dfs.delhigovt.nic.in

INSPECTION REPORT

1. Name & address of the building : Adaab Restaurant(Unit of Adaab Hotels Ltd.), T-307, 3rd floor, Ambience Mall, Plot no.2, Nelson Mandela Marg, Vasant Kunj, New Delhi.
2. Type of Occupancy : Restaurant
3. Type of Case : New Case
4. Details of previous NOC : N/A
5. Fire Safety directives letter No : Delhi Fire Service Act 2007 & Rules 2010
6. Date of inspection : 22-11-2013
7. Name of the Inspecting Officers : M.K.Chattopadhyay, ADO(M.Rd)
8. Name and designation of officers from the building side : Mr. Mahender Rana, Manager
9. Year of Construction : 2006-07, Renovated on 2013
10. Applicant's letter No. : Nil dated 05.11.2013.

Restaurant is located at third floor of Ambience Mall.

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	NBC/BBL Requirement	Provided at site	Remarks MR/NMR
1	Access to building			
	• Road width	09 mts	Provided	MR
	• Gate width	4.5 mts	Provided	MR
	• Width of internal road	06 mts	Provided	MR
2	Number, Width, Type & Arrangement of Exits			
	a. Number of staircases	-	-	-
	• Upper Floors	02 (for restaurant)	Provided	MR
	• Basements	N/A	N/A	N/A
	b. Width of staircases	-	-	-
	• Upper Floors	1.5 mts each	Provided	MR
	• Basements	N/A	N/A	N/A
	c. Protection of exits	---	---	---
	• Fire check door	Required	Provided	MR
	• Pressurization	N/A	N/A	N/A
	e. No. of continuous staircases to terrace	01	01	MR
	g. Width of Corridor	N/A	N/A	N/A
	h. Door Size	2.0 mts	2.0 mts, 1.67 mts	MR
3	Compartmentation.			



M/L

	<ul style="list-style-type: none"> • Fire check door • Sealing of electrical shafts • Fire Rating of shaft door • Water Curtain • Fire Dampers 	Required	Provided	MR
		N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
4	Smoke Management System.			
	<ul style="list-style-type: none"> • Basements • Upper floors 	30 a/c per hour	Provided	MR
		12 a/c per hour	Provided	MR
5	Fire Extinguishers			
	<ul style="list-style-type: none"> • Total numbers • Types • IS marking 	06 ABC, CO ₂ ISI marked	Provided	MR
			Provided	MR
			Provided	MR
6	First-Aid Hose Reels.			
	<ul style="list-style-type: none"> • Total numbers on each floor • Length of hose reel hose • Nozzle diameter 	01 30 m 5 mm	Provided in restaurant	MR
			Provided	MR
			Provided	MR
7	Automatic fire detection and alarming system.			
	<ul style="list-style-type: none"> • Type of detectors • Location of Main Panel • Location of Repeater Panel • Alternate source of power • Hooters' Location 	Required (smoke/heat)	Provided	MR
		Staircase	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided in entire building	MR
8	MOEFA	Required	Provided	MR
9	Public Address System.	Required	Provided (in Bldg)	MR
10	Automatic Sprinkler System.			
	<ul style="list-style-type: none"> • Basement • Upper Floor • Sprinkler above false ceiling 	Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
11	Internal Hydrants			
	<ul style="list-style-type: none"> • Size of riser/down-comer • Number of hydrants per floor 	150 mm	Provided in Restaurant	MR
		01	Provided	MR

13

12	Yard Hydrants.	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Total number of hydrants 	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Hose Box 	N/A	N/A	N/A
13	Pumping Arrangements.			
	<ul style="list-style-type: none"> • Ground Level 	-	-	-
	<ul style="list-style-type: none"> ➤ Discharge of main Pump 	4500 LPM	Provided in Mall	MR
	<ul style="list-style-type: none"> ➤ Head of Main pump 	70 mts	Provided	MR
	<ul style="list-style-type: none"> ➤ Number of main pumps 	02	Provided	MR
	<ul style="list-style-type: none"> ➤ Jockey Pump out put 	450 LPM	Provided in Mall	MR
	<ul style="list-style-type: none"> ➤ Jockey pump head 	70 mts	Provided	MR
	<ul style="list-style-type: none"> ➤ Standby Pump out put 	4500 LPM	Provided in Mall	MR
	<ul style="list-style-type: none"> ➤ Standby Pump Head 	70 mts	Provided	MR
	<ul style="list-style-type: none"> ➤ Auto Starting/ Manual stopping 	Required	provided	MR
	<ul style="list-style-type: none"> ➤ Pump House Access 	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Terrace level 	N/A	N/A	N/A
	<ul style="list-style-type: none"> ➤ Discharge of pump 	N/A	N/A	N/A
	<ul style="list-style-type: none"> ➤ Head of the pump 	N/A	N/A	N/A
	<ul style="list-style-type: none"> ➤ Power Supply 	Required	Provided	MR
	<ul style="list-style-type: none"> ➤ Auto Starting of pump 	Required	provided	MR
14	Captive Water Storage for fire fighting.			
	<ul style="list-style-type: none"> • Underground tank capacity 	5,00,000 liters	Provided in Mall	MR
	<ul style="list-style-type: none"> ➤ Draw-off connection 	Required	Provided	MR
	<ul style="list-style-type: none"> ➤ Fire service inlet 	Required	Provided	MR
	<ul style="list-style-type: none"> ➤ Access to tank 	Required	Provided	MR
	<ul style="list-style-type: none"> • Overhead Tank capacity 	20,000 liters	Provided in Mall	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of Lifts.			
	<ul style="list-style-type: none"> • Pressurization of Lift Shaft 	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Pressurization of Lift lobby 	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Communication In lift Car 	N/A	N/A	N/A
	<ul style="list-style-type: none"> • Fireman's Grounding Switch 	N/A	N/A	N/A

74

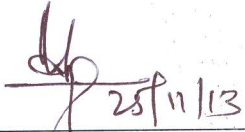
	• Lift Signage	N/A	N/A	N/A
17	Standby power supply	Required	Provided	MR
18	Refuge Area.			
	➤ Total Area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A
19	Fire Control Room			
	• Detector System Panel	N/A	N/A	N/A
	• Flow Switch Panel	N/A	N/A	N/A
	• PA System Panel	N/A	N/A	N/A
	• Batter backup	N/A	N/A	N/A
	• Building Floor Plans	N/A	N/A	N/A
20	Special Fire Protection Systems for Protection of special Risks, if any:	Required	01 CO ₂ type fire extinguishers found provided near elect. panel	MR

The fire protection systems provided in the building were test checked and found functional at the time of inspection.

Keeping in view the substantial compliance of the minimum standards on fire prevention and fire safety required under the rules it is recommended to grant Fire Safety Certificate under rule 35 of the Delhi Fire Service Rules 2010.

DFA is put up for approval & signature please.

Do(SZ)
 Defo(SZ)
 not available.
 M.K. Chatto
 26/11/13


 25/11/13
 Signature of the Inspecting Officer
 Name M.K.CHATTOPADHYAY
 Designation: - Asstt. Div. Officer (M.Rd)