



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001

No.F.6/DFS/MS/EH/2023/NDZ/ 254

Dated: 11 / 08 /2023

FIRE SAFETY CERTIFICATE

Certified that the Haldiram Restaurant located at G-42 to G-48 on Ground Floor in a building comprised of two basements, ground plus three upper floors, Cross River Mall, Plot No. 9B & 9C, CBD Near Karkardooma, Shahdara, Delhi 110032 owned / occupied by M/s Haldiram Safety Certificate Fire issued was F6/DFS/MS/EH/2020/NDZ/108 dated 21/07/2020. The premises was re-inspected by the officers Ltd. Pvt. concerned of this department on dated 03.08.2023 in the presence of Mr. Surender (Manager) and observed that all the fire prevention and fire safety arrangements provided in the premises found in good working condition. The premises have therefore deemed complied with rule 33 of the Delhi Fire Service Rules, 2010 and that the building / premises is fit for occupancy Group-D with Rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010 & also conditions printed below.

Issued on 11/08/2023 at New Delhi by.

DELHI FIRE SERVICE

· CAN 1. The Manager, M/s Haldiram Ethnic Foods Pvt. Ltd. (Restaurant cum Show room) at G-42 to G-48, Gross River Mall, Plot No. 9B & 9C, CBD Near Karkardooma, Shahdara, Delhi-32.

2. The Joint Commissioner of Police (Lic.), 1st Floor, Police Station Defence Colony, New Delhi MHA ID No. 2023072613367.

Conditions for the validity of Fire Safety Certificate:

- 1. All the fire safety arrangement provided their in shall be maintained in good working conditions at all times.
- 2. Loss of life or property due to non functional fire safety measure shall be at the responsibility of the
- 3. The trained fire fighting staff should be available round the clock. 4. Any deviation with regard to the construction etc shall be verified by the concerned building sanctioning
- 5. The basement shall be used strictly as per the provision of building bye laws.
- 6. This certificate cannot be treated in any case for regularizations of unauthorized construction. Director in Form
- 7. "The owner / Occupier shall apply for renewal of this Fire Safety Certificate to the 'J' [sub rule (1) of rule37] along with a copy of this Certificate, six months prior to its expiry".
- The owner / occupier shall submit a declaration every year in form "K" provided in the first schedule of Delhi Fire Service Rules 2010. The from is available on WWW.dfs.Delhigovt.nic.in

N/22,

1. Name & address of the building

: Haldiram Ethnic Foods PVT. Ltd.(Restaurant cum Show room) at G-42 to G-48, Cross River Mall, Plot 9B & 9C , CBD Near Karkardooma, Shahdara

New Delhi - 110032.

2. Building is comprised of

: Two basement ground plus three upper floors (Restaurant is running on ground floor only)

3. Type of Occupancy

: Assembly (Restaurant cum Show room)

4. Type of Case

5. Details of Previous NOC letter

: F.6/DFS/MS/EH/2020/NDZ/108 dated 21/07/2020

6. Fire Safety directive letter No

: Delhi Fire Service Act 2007 & Rules 2010

7. Date of Inspection

: 03/08/2023

8. Name of the Inspecting officers

: DO A.K. Jaiswal & ADO Deepak Kumar

9. Name and designation of Officer from the building side

:Mr. surrender, Manger

10. Year of Construction


: 2008

11. Applicant's letter No

:2023072613367, Dated- 28/07/2023

| Sr. | Minimum Standards on Fire | NBC/ Requirement | Provided at Site | Remarks MR/NMR | | |
|-----|--|----------------------|-------------------------------------|-------------------|--|--|
| No. | Prevention and Fire Safety U/R33 | | | | | |
|)1 | Access to Building | 6.00 mtr. | 24.00 mtr. | MR | | |
| | Road width | N/A | N/A | N/A | | |
| | Gate width | 6.00 mtr. | 6.00 mtr. | MR | | |
| | Width of internal road | | | | | |
| 02 | Number, Width, Type and Arrangen | | NUA | N/A | | |
| | a. Number of Staircases | N/A | N/A | N/A | | |
| | Upper floor | N/A | N/A | N/A | | |
| | Basement | N/A | N/A | IVA | | |
| | B. Width of Staircases | | | N/A | | |
| | Upper floor | , N/A | N/A | N/A | | |
| | | N/A | N/A | IVA | | |
| | c. Protection of Exits | | | N/A | | |
| | Fire check door | N/A | N/A | N/A | | |
| | | N/A | N/A | | | |
| | d. No. of Continuous Staircases | N/A | N/A | N/A | | |
| | to Terrace | N/A | N/A | N/A | | |
| | e. Width of Corridor | 2.00 mtr. | 2.00 mtr x 2 & 1.00 mtr) | MR | | |
| | f. Door Size i. No. of doors | 2.00 mtr | 3 nos. (2.00 mtr x 2 & 1.00 mtr) | MR | | |
| | | | | | | |
| 03 | Compartmentation. | N/A | I N/A | N/A | | |
| | Fire check door | | N/A | N/A | | |
| 11. | Sealing of electrical shafts Fire rating of shaft door Water curtain | N/A | N/A | N/A | | |
| | | N/A | N/A | N/A | | |
| | | N/A | N/A | N/A | | |
| | Fire dampers | | | | | |
| 04 | Smoke Management System. Basement Upper floor | Required | Provide in main building | MR | | |
| | | N/A | N/A | N/A | | |
| | | INIA | 1 ,,,, | | | |
| 05 | 5. Fire Extinguishers | | | | | |
| - | Total numbers | 05 nos. | 05 nos. | MR A | | |
| 1 | Total numbers Types | ABC /CO ₂ | ABC /CO₂ | MR MR | | |
| | IS marking | ISI marked | ISI marked | MIK | | |

| 6 | First-Aid-Hose Reels. Common with Mall | | | | | | | |
|-----|--|---------------------------------|------------------------------|----------|--|--|--|--|
| | Total numbers on each floor | 01 nos (near the restaurant) | 01 nos (P) | MR | | | | |
| | Length of hose reel hose | 30 mtr | 30.00 mtr | MR | | | | |
| | Nozzle diameter | 5.00 mm | 5.00 mm | MR | | | | |
| 07 | Automatic Fire Detection and Alam | 0.00 11111 | | | | | | |
| - | Tong of delegation | I N/A I | Drawidad in | MR | | | | |
| 4 | Type of detectors | N/A | Provided in main building | Atomore. | | | | |
| | Location of main panel | N/A | Provided in main building | MR | | | | |
| | Location of repeater panel Alternate source of power | N/A | N/A | N/A | | | | |
| | | N/A | Provided | MR | | | | |
| | Hooter | N/A | N/A | N/A | | | | |
| 80 | MOEFA | Required | Provided | MR | | | | |
| 09 | Public Address System. | N/A | N/A | N/A | | | | |
| 10 | Automatic Sprinkler System. | | | | | | | |
| | Basement | N/A | Provided | MR | | | | |
| | upper floor | N/A | N/A | N/A | | | | |
| | sprinkler above false ceiling | | N/A | N/A | | | | |
| 11 | Internal Hydrants Common with Mall | | | | | | | |
| | size of riser/down-comer | 100 mm | 100 mm | MR | | | | |
| | Number of hydrants per flo | | 06 nos. | MR | | | | |
| | Hose box | 01 nos. | 06 nos. | MR | | | | |
| 12 | Yard Hydrants. | | | | | | | |
| | Total number of hydrants | N/A | 03 nos. | MR | | | | |
| | Hose box | N/A | 03 nos. | MR | | | | |
| 13 | Pumping Arrangements. | | | 8.0 | | | | |
| | ➤ Ground Level Common with Mall | | | | | | | |
| | Discharge of main pump | N/A | 2280 lpm | MR | | | | |
| 1. | Head of main pump | N/A | 60 mtrs | MR | | | | |
| | Number of main pumps | N/A | 02 nos | MR | | | | |
| | Jockey pump out put | N/A | 180 lpm | MR | | | | |
| | Jockey pump head | N/A | 60 mtr | MR | | | | |
| | Standby pump out put | N/A | 2850 lpm | MR | | | | |
| | Standby pump head | N/A | 60 mtrs | MR | | | | |
| | Auto starting /manual | N/A | Provided | MR | | | | |
| | stopping | N/A | Provided | MR | | | | |
| | Pump house access | | | | | | | |
| | > Terrace Level | | | | | | | |
| | Discharge of pump | 450 lpm | 450 lpm | MR | | | | |
| | Head of the pump | 40 mtr | 40 mtr | MR | | | | |
| | Power supply | Required | Provided | MR | | | | |
| | Auto starting of pump | Required | Provided | MR | | | | |
| 14 | Captive Water Storage for Fire Fighting | Common | with Mall | | | | | |
| | Underground tank capacit | ty N/A | 2,00,000 ltrs | MR | | | | |
| | Draw-off connection | N/A | Provided | MR | | | | |
| | Fire service inlet | N/A | Provided | MR | | | | |
| 111 | Access to tank | N/A | Provided | MR | | | | |
| | | | | | | | | |
| 15 | Overhead tank capacity | 10,000 ltrs | 50,000 ltrs | MR | | | | |

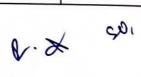

| 6 | Provision of Lifts. | | | | | |
|-----|---|-----|-----------------------------|-----|--|--|
| | Pressurization of lift shaft | N/A | N/A | N/A | | |
| | Pressurization of lift lobby | N/A | N/A | N/A | | |
| - 1 | Communication in lift car | N/A | N/A | N/A | | |
| | Firemen's grounding switch | N/A | N/A | N/A | | |
| | Lift signage | N/A | N/A | N/A | | |
| 17 | Standby Power Supply | N/A | Provide in main building | MR | | |
| 18 | Refuge Area. | | | | | |
| | Total area | N/A | N/A | N/A | | |
| | Location | N/A | N/A | N/A | | |
| 19 | Fire Control Room Provided for main building | | | | | |
| | Detector system panel | N/A | N/A | N/A | | |
| | Flow switch panel | N/A | N/A | N/A | | |
| | PA system panel | N/A | N/A | N/A | | |
| | Battery backup | N/A | N/A | N/A | | |
| | Building floor plans | N/A | N/A | N/A | | |
| 20 | Special Fire Protection Systems for Protection of Special Risks, if Any: | N/A | N/A | N/A | | |

The fire protection systems provided in the building were tested/checked and found functional at the time of inspection.

Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules the FSC issued vide letter no. F6/DFS/MS/EH/2020/NDZ/108 dated 21/07/2020 renewal under rule 35 of the Delhi Fire Service Rule, 2010 is recommended.

Signature of the Inspecting Officer Name

: Deepak Kumar Designation : ADO (Shd)

Signature of the Inspecting Officer

Name

: A.K. Jaiswal Designation : DO (ED)

Directo