

c/11

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE
NEW DELHI- 110001

No. F6/DFS/MS/School/2022/SZ/ 444

Dated: 1/8/22

To,


The Principal,
MCD Primary School,
Asalatpur-II, A-2, Janakpuri, New Delhi-110058

Sub: - Regarding issue of "Fire Safety Certificate" from fire safety point of view in r/o MCD Primary School, Asalatpur-II, A-2, Janakpuri, New Delhi-110058

Sir,

This has reference to your letter No. Nil dated 17/05/2022 the subject captioned above. In this connection, it is to inform you that the above mentioned school premises was inspected by the officer concerned of this department on 20/07/2022 in the presence of Smt. Renuka (Principal) to verify the compliance of shortcoming already communicated by this department vide letter no.F6/DFS/MS/School/2020/SZ/429 dated 30/04/2020 and observed that shortcomings are still not rectified. The management will be held responsible for any untoward incident for the period if compliance is not made.

Yours faithfully

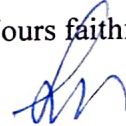

(Sunil Chawdhary)
Dy.Chief Fire Officer
Delhi Fire Service



Copy to:-

1. The Director of Education,
MCD, Civic Centre,
Minto Road, New Delhi-110001.
(With a request to take further action as school does not have fire NOC)

914

2020

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001**

No: F.6/DFS/MS/School/2020/SZ/429

Dated: 30/4/2020

To,

The Principal,
S.D.M.C Primary School,
Asalatpur-II, A-2, Janakpuri, New Delhi-110058

Sub: - Regarding issuance/renewal of Fire Safety Certificate in r/o S.D.M.C Primary School,
Asalatpur-II, A-2, Janakpuri, New Delhi-110058.

Sir/Madam,

This has reference to your Letter No. API/WZ/69 dated 30.01.2020 on the subject cited above. In this connection, it is to inform you that the inspection of above said school building has been carried out by officer concerned of this department on 04.03.2020 to see the compliance of the requisite fire safety measures. Smt. Rosy Sethi (In-charge) was present at the time of inspection.

During the course of inspection it was observed that school building comprised of two blocks namely school block & MP Hall block. School block comprised of ground plus two upper floors and MP Hall block is having ground floor only. The building is approachable to the fire fighting vehicles. The electrical wiring was seen concealed and the electric supply was passing through MCB's. The following shortcomings were observed:-

1. The building is not approachable through 4.5 meter wide gate.
2. MP hall Door width is 175 & 110 cms against required 200 cms.
3. Required fire extinguishers are not provided. Nine fire extinguishers of DCP type/CO₂ type 2.5 Kg Capacity each are require to be provided.
4. Hose Reel System not provided in MP Hall & school block.
5. Fire Pump of 450 LPM capacity in MP Hall Block and 450 LPM capacity in school block are not provided.
6. Overhead water storage tank of 5,000 ltrs in MP Hall Block and 10,000 ltrs. in school block are not provided.
7. Illuminated exit signs not provided in MP Hall Block.

You are advised to rectify the above-mentioned shortcomings for taking further action as necessary for issuance of Fire Safety Certificate. It is further advice that email of school may also be intimated to this department for record purpose.

Yours Faithfully,

(ATUL GARG)
DIRECTOR
DELHI FIRE SERVICE

Copy to:-

Director of Education,
S.D.M.C, Civic Centre,
Minto Road, New Delhi-110001
(with a request to take further action as school does not have fire NOC)