

C25

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001**

No. F.6/DFS/MS/2021/SZ/438

Dated: 27/08/2021

To

The Manger,  
Nalanda Convent School, D-5, School Road,  
Om Nagar, Badarpur, New Delhi 110044.

**Sub:** Regarding issue of Fire Safety Certificate (FSC) in r/o Nalanda Convent School, D-5, School Road, Om Nagar, Badarpur, New Delhi 110044.


Sir,

This is in reference to Gmail dated 27/07/2021 on the subject cited above. In this connection, it is to inform you that the above mentioned premise was visited by the officer concerned of this department on 11/08/2021 and observed that the shortcoming intimated vide letters of even nos 5028 dated 14/12/2018, 220 dated 19/04/2021 & 333 dated 06/07/2021 has yet not been complied. (Copy Enclosed for ready reference).

In view of above Shortcomings, the application for issuance Fire Safety Certificate is rejected. The occupancy of the building/premises in absence of requisite fire safety arrangements shall be at the risk and liability of the owner/occupier. The Licensing authority/ Statutory Authority may take suitable necessary action as deemed fit.

Encl: As above

Yours faithfully

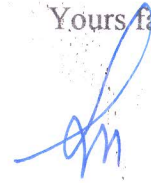

(SUNIL CHAUDHARY)  
DY. CHIEF FIRE OFFICER (SZ)

Copy to:-

① The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi-54.

C-6

14/12/18

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE**  
**NEW DELHI- 110001**

No. F.6/DFS/MS/School/2018/SZ/ 5028

Dated: 14/12/18

To

The Manager,  
Nalanda Convent School,  
D/5, School Road, Om Nagar,  
Badarpur, New Delhi-110044

Sub: Reg. Issuance of NOC in r/o Nalanda Convent School, D-5, School Road, Om Nagar,  
Badarpur, New Delhi-110044.

Sir,

This is in reference with your letter No. NCS/2018/15 dated 15.03.2018- received in outdoor dairy vide No. 4091 dated 16.03.2018 on the subject cited above. In this connection, it is to inform you that premises visited by the officer concerned of this department on 18/07/2018 in the presence of Mr. Sanjay (Admin) to verify the compliance of shortcomings communicated by this department vide letter No.F.6/DFS/MS/School/2015/174 dated 23/01/2015 and observed that there have been addition of 2<sup>nd</sup> floor in the building. The building now comprises of basement, ground plus two upper floors. The shortcomings observed are as below;

1. Year of construction of second floor with supporting documents.
2. Width of staircases in basement found less than 1.5m; one of the staircases shall be 1.5m wide.
3. Terrace level pump having cap. 360 LPM with 30m head found provided against required 900 LPM with 40m head.
4. Over head water storage capacity 7,000 liters found provided against 15,000 liters.
5. Exit signage not provided at each floor.
6. You are requested to inform the use of basement & area in the school.

In view of above, renewal of FSC cannot be considered at this stage. You are requested to rectify the shortcoming under intimation to this department for further action in the matter.

Yours faithfully,

  
(Vipin Kental)  
Chief Fire Officer  
Ph: 011-23412225

Copy to: -

1. Directorate of Education, South MCD, Civic Centre, Minto Road, New Delhi-110002