

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEADQUARTERS, DELHI FIRE SERVICE, NEW DELHI-110001  
Fax: 23412593, Email: cfohq.dlfire@nic.in, Tel: - 011-23414000


No.F6/MS/DFS/ FM/2013/S2/1966

Dated: 25/9/13

**FIRE SAFETY CERTIFICATE**

Certified that the Ram Farms (M/s Glamour Impex Pvt. Ltd.), Khasra No. 683, 685,686/1 & 711, Bund Road, Village- Gadaipur, New Delhi-110074 comprised of One Pucca Buildings having Ground + First Floor (Four Rooms) and One Temporary Pandal (120 ft. x 30 ft.) using for functions and another Pucca building having Ground Floor for Office use only was issued Fire Safety Certificate vide letter No.F6/DFS/MS/FH/10/421 Dated 11.02.2010. The premises was inspected by the officer concerned of this department on 31/08/13 in the presence of Mr.Gupta and observed that the said premises have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the premises fit for occupancy class Assembly (Farm House) with effect from 25/9/13-----for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules 2010.

Issued 25/09/13 at New Delhi by.

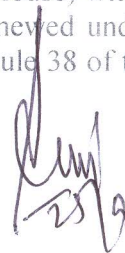

(Dr. G.C Misra)  
CHIEF FIRE OFFICER  
DELHI FIRE SERVICE

o/c  
24/9/2013  
ADD (BEP)

Copy to:-

Authorised Signatory  
M/s Glamour Impex Pvt. Ltd.  
Ram Farm House,  
Khasra No. 683,685,686/1 & 711, Bund Road,  
Village Gdaipur, New Delhi-110074

Following fire safety directives must be adhered to:-

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times.
2. Any loss of life or property due to non functional fire safety measures shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. Any deviation w.r.t. construction etc. shall be verified by the concerned building sanctioning authority.
5. The basement shall be used as per the provisions of BBL.
6. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in)

old case

**INSPECTION REPORT**

1. Name & address of the building:- Ram Farms (M/s Glamour Impex Pvt. Ltd.), Khasra No. 683,685, 686/1 & 711, Bund Road, Village - Gadaipur, New Delhi-110074
2. Type of occupancy:- Ass<sup>e</sup>m<sup>bly</sup> (Farm House)
3. Type of case: - Renewal.
4. Details of previous NOC:-. letter No.F6/DFS/MS/FH/10/421 Dated 11.02.2010
5. Fire safety directives No.- Nil
6. Date of inspection:-31 /07/2013
7. Name of the inspecting officer:- Dharampal Bhardwaj,D.O,(South) & D.B.Mukherjee, A.D.O.(BCP)
8. Name & designation of officer From the building side: - Mr.Gupta
9. Year of construction:- Nil
10. Applicant's letter No:- Nil, dated 07.08.2013,  
Two Pucca Buildings, One is comprised of Ground Floor another is Ground + First Floor(Four rooms) and One Temp. Pandal (120 ft x 30 ft)

Old Case

S.No	Minimum Standards on fire Prevention and fire safety U/R 33	BBL/NBC Requirement	Provided at site	Remarks MR/NMR
<b>1.</b>	<b>Access to Building</b>			
	1) Road width	Required	Provided 30m	MR
	2) Gate width	Required	Provided	MR
	3)Width of internal road	06 mtrs	Provided	MR
<b>2.</b>	<b>Number, Width Type &amp; Arrangement of Exits</b>			
	A. Number of staircases			
	1. Upper floors	One	One	MR
	2. Basements	N/A	N/A	N/A
	B. Width of staircase			
	1. Upper floors	Required	0.95m	MR
	2. Basements	N/A	N/A	N/A
	C. Protection of exits			
	1. Fire check door	N/A	N/A	N/A
	2. Pressurization	N/A	N/A	N/A
	D. No. of continuous staircase to terrace	One	One	MR
	E. Width of corridor	N/A	N/A	N/A
	F. Door size	N/A	N/A	N/A
<b>3.</b>	<b>Compartmentation</b>			
	1) Fire check door	N/A	N/A	N/A
	2) Sealing of electrical shafts	N/A	N/A	N/A
	3) Fire rating of shaft door	N/A	N/A	N/A
	4) Water curtain	N/A	N/A	N/A
	5) Fire Dampers	N/A	N/A	N/A
<b>4.</b>	<b>Smoke Management System</b>			
	1) Basements	30 a/c per hour	N/A	N/A
	2) Upper floors	12 a/c per hour	Natural Ventilation	MR
<b>5.</b>	<b>Fire Extinguishers</b>			
	1) Total numbers	ISI Marked	28 Nos.	MR
	2) Types		ABC, CO <sub>2</sub> & W.CO <sub>2</sub>	MR
	3) ISI marking		Yes	MR
<b>6.</b>	<b>First-Aid Hose Reel</b>			
	1) Total number of each floor	Required	Provided	MR
	2) Length of hose reel hose	Required	30 Mtr	MR
	3) Nozzle diameter	Required	5mm	MR

12



<b>7.</b>	<b>Automatic Fire Detection &amp; Alarming System</b>			
	1) Type of detectors	N/A	N/A	N/A
	2) Location of main panel	N/A	N/A	N/A
	3) Location of repeater panel	N/A	N/A	N/A
	4) Alternate source of power	N/A	N/A	N/A
	5) Hooter's Location	N/A	N/A	N/A
<b>8.</b>	<b>MOEFA</b>	Required	Provided	MR
<b>9.</b>	<b>Public Address System</b>	N/A	N/A	N/A
<b>10.</b>	<b>Automatic Sprinkler System</b>			
	1) Basement	N/A	N/A	N/A
	2) Upper floors	N/A	N/A	N/A
	3) Sprinkler above false ceiling	N/A	N/A	N/A
<b>11.</b>	<b>Internal Hydrants</b>			
	1) Size of riser/down-comer	100 mm	Provided	MR
	2) Number of hydrants per floor	One	Provided	MR
	3) Hose box	One	Provided	MR
<b>12.</b>	<b>Yard Hydrants</b>			
	1) Total number of hydrants	Required	Provided	MR
	2) Hose box	Required	Provided	MR
<b>13.</b>	<b>Pumping Arrangement</b>			
	1) Ground level	N/A	N/A	N/A
	a) Discharge of main pump	N/A	N/A	N/A
	b) Head of main pump	N/A	N/A	N/A
	c) Number of main pump	N/A	N/A	N/A
	d) Jockey pump out put	N/A	N/A	N/A
	e) Jockey pump head	N/A	N/A	N/A
	f) Stand by pump output	N/A	N/A	N/A
	g) Stand by pump head	N/A	N/A	N/A
	h) Auto starting/Manual stopping	N/A	N/A	N/A
	2) Terrace level			
	a) Discharge of pump	450 LPM	450 LPM & 180 LPM	MR
	b) Head of pump	40 m	46 m & 30 m	MR
	c) Power supply	Required	Electric Supply & also by D.G. Set	MR
	d) Auto starting of pump	Required	yes	MR
<b>14.</b>	<b>Captive Water Storage for Fire Fighting</b>			
	1) Under ground tank capacity	N/A	N/A	N/A
	a) Draw-off connection	N/A	N/A	N/A
	b) Fire service inlet	Required	Provided	MR
	c) Access to tank	N/A	N/A	N/A
	d) Over head tank capacity	Required	5000 & 2500 Ltrs	MR
<b>15.</b>	<b>Exit Signage.</b>	Required	Provided	MR
<b>16.</b>	<b>Provision of Lifts.</b>			
	a) Pressurization of lift shaft	N/A	N/A	N/A
	b) Pressurization of lift lobby	N/A	N/A	N/A
	c) Communication in lift car	N/A	N/A	N/A
	d) Fireman's switch	N/A	N/A	N/A
	e) Lift signage	N/A	N/A	N/A
<b>17.</b>	<b>Stand by Power Supply</b>	Yes	Provided DG Set	MR
<b>18.</b>	<b>Refuge Area</b>	N/A	N/A	N/A
	Total area location	N/A	N/A	N/A

alel

m

<b>19.</b>	<b>Fire Control Room</b>	N/A	N/A	N/A
	a) Detector system panel	N/A	N/A	N/A
	b) Flow switch panel	N/A	N/A	N/A
	c) PA system panel	N/A	N/A	N/A
	d) Battery backup	N/A	N/A	N/A
	e) Building floor plan	N/A	N/A	N/A
<b>20.</b>	<b>Special Fire Protection System for Protection of special Risk, if any:</b>			N/A

The fire protection system provided in the building and Temporary Pandal were checked and found functional at the time of inspection. Keeping in view of the substantial compliance of the minimum standards on fire prevention and fire safety required under the rules it is recommended to renew Fire Safety Certificate under rules 35 of the Delhi Fire Service Rules 2010. Accordingly DFA is put up for perusal and signature if approved. Submitted please.

Signature of the inspecting officer

Name: - Dharampal Bhardwaj  
Designation:- Divisional Officer (South)

Signature of the inspecting officer

Name: - D.B. Mukherjee.  
Designation: Asstt. Div. Officer (BCP)