

NO. F6/DFS/MS/ Motel/2015/SZ/ 946

DATED: 08/06/15


FIRE SAFETY CERTIFICATE

Certified that the Radiance Motel (formerly known Daffodils Hotel) at Tania Farm Complex, Satbari, Chhatarpur Mandir Road, New Delhi comprised of-basement, ground plus one upper floor was granted NOC by this department vide letter no. F6/DFS/MS/Motel/2011/1270 Dated 20.06.2011. The premises was re-inspected by the officers concerned of Fire Service on 28.05.2015 in the presence of Sh. Jatin of the motel and observed that fire safety norms as required under rule 33 of Delhi Fire Service Rules 2010 are deemed complied and that the building is fit for occupancy class A "Residential (Motel)" with effect from.....for a period of 3 (three) years, accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rule 2010,subject to condition as mentioned below.

Issued on..... at New Delhi by



Dr. G.C. Misra
Chief Fire Officer

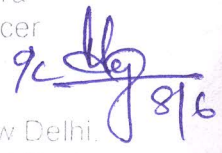

Copy To:-

1. The Addl. Commissioner of Police, Lic., First floor, PS Defence Colony, New Delhi.
2. The Authorized Signatory, Radiance Motel (formally know Daffodils Hotel) at Tania Farm Complex, Satbari, Chhatarpur mandir Road, New Delhi

Conditions for the validity of fire safety certificate

1. All the fire safety and means of escape facilities shall be maintained in good working conditions at all time. Any lapse rendering fire safety or means of evacuation facilities rendering non-functional shall be the responsibility of the management.
2. Building Sanctioning authority may verify any deviation with regard to the construction/occupancy in the building. In case of any deviation, the fire safety certificate stands null and void.
3. The staffs shall be trained for operating fire fighting system and mock evacuation drills be conducted at regular intervals and record be maintained.
4. The basement shall be used strictly as per the provisions of Building Bye laws.
5. The owner/occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules-2010. The form is available on www.dfs.delhigovt.nic.in
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form "J" [sub rule (1) of rule 37] along with a copy of this certificate, six months prior to its expiry. The form is available on

INSPECTION REPORT

1	Name & address of the building	Radiance Motel (formerly known Daffodils Hotel) at Tania Farm Complex, Satbari, Chhatarpur Mandir Road, New Delhi		
2	Type of Occupancy	Residential "A" (Motel)		
3	Building comprised of	Basement, ground plus one upper floor		
4	Type of case	Renewal		
5	Details of previous NOC	F6/DFS/MS/Motel/2011/1270 Dated 20.06.2011		
6	Fire safety directives letter No	F6/MS/DFS/GH/BP/2003/608 Dated 21.03.2003		
7	Date of inspection	28.05.2015		
8	Name of the inspecting Officers :	DO D.P. Bhardwaj & ADO D.B. Mukherjee		
9	Name and designation of officers	Sh. Jatin		
	from the building side			
10	Year of construction	2003		
11	Applicant's letter No.	Nil dated 08.05.2015	Old Case	
S. NO.	Minimum Standards on fire prevention and fire safety U/R 33	NBC Requirement	Provided at site	Remarks MR / NMR
1	Access to building			
	1) Road width	6 Mtr	Provided	MR
	2) Gate width	5mtrs	Provided	MR
	3) Width of internal road	N/A	N/A	N/A
2	Number, width Type & arrangement of exits			
	a. Number of staircases			
	1. Upper floors	3 Nos.	Provided	MR
	2. basements	3 Nos.	Provided	MR
	b. Width of staircase			
	1. Upper floors	1.25 Mtr	2 Nos. 1.3 Mtr each & 1.44 Mtr Provided	MR
	2. basements	1.25 Mtr	1.25 Mtr, 1.24 Mtr & 6.8 Mtr Provided	MR
	c. Protection of exits			
	1. Fire check door	Required	Provided	MR
	2. Pressurization	N/A	N/A	N/A
	d. No. of continuous staircase to terrace	Required	2 Nos. Provided	MR
	e. Width of corridor	1.25 Mtr	Provided	MR
	f. Door size	1 Mtr	Provided	MR
3	Compartmentation.			
	1. Fire check door	Required	Provided	MR
	2. Sealing of electrical shafts	Required	Provided	MR
	3. Fire Rating of shaft door	N/A	N/A	N/A
	4. water curtain	N/A	N/A	N/A
	5. Fire dampers	N/A	N/A	N/A
4	Smoke Management system.			
	basement	30 a/c per hour	Exhaust Fans Provided	MR
		12 a/c per hour		
	upper floors		Natural Ventilation	MR
5	Fire Extinguishers			
	Total numbers		35 Nos.	MR

6	First-Aid Hose Reels.			
	total numbers on each floor	Two	Provided	MR
	Length of Hose reel hose	30 m	Provided	MR
	Nozzle Diameter	5 mm	Provided	MR
7	Automatic fire detection and alarming system			
	Type of detectors	Smoke & Heat	Provided	MR
	location of Main Panel	Required	Ground Floor	MR
	location of Repeater panel	N/A	N/A	N/A
	Alternate source of power	Required	Battery Backup	MR
	hooter's location	Required	Provided	MR
8	MOEFA	Required	Provided	MR
9	Public Address System.	Required	Provided	MR
10	Automatic Sprinkler System.			
	basement	Required	Provided	MR
	upper floors	Required	Provided	MR
	sprinkler above false ceiling	N/A	N/A	N/A
11	Internal Hydrants			
	Size of riser/down-corner	150 mm	Provided	MR
	Number of Hydrants per floor	Two	Provided	MR
	hose Box	Two	Provided	MR
12	Yard Hydrants.			
	total number of hydrants	4 Nos	Provided	MR
	hose box	4 Nos.	Provided	MR
13	Pumping arrangements			
	1. Ground level			
	a. Discharge of main Pump	2280 LPM	Provided	MR
	b. Head of main pump	60 Mtr	Provided	MR
	c. Number of main pumps	One	Provided	MR
	d. jockey pump out put	180 LPM	Provided	MR
	e. jockey pump head	60 Mtr	Provided	MR
	f. Standby Pump output	2280 LPM	Provided	MR
	g. Stanby Pump head	60 Mtr	Provided	MR
	h. Auto Starting/Manual stopping	Required	Provided (Both)	MR
	pump house access	Required	Provided	MR
	2. Terrace level			
	a. Discharge of pump	N/A	N/A	N/A
	b. head of the pump	N/A	N/A	N/A
	c. Power supply	N/A	N/A	N/A
	d. Auto starting of pump	N/A	N/A	N/A
14	Captive water storage for fire fighting			
	1. Underground tank capacity	50,000 Ltrs	Provided	MR
	a. Draw-off connection	Required	Provided	MR
	b. fire service inlet	Required	Provided	MR
	c. Access to tank	Required	Provided	MR
	Over head tank Capacity	12,500 ltr	Provided	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of lifts.			
	Provision of lift shaft	N/A	N/A	N/A

17	Standby power supply	Required	Provided	MR
18	Refuge Area.	Not Required		
	total area			
	location			
19	Fire control room			
	a. Detector system Panel	N/A	N/A	N/A
	b. Flow switch Panel	N/A	N/A	N/A
	c. PA system Panel	N/A	N/A	N/A
	d. Batter backup	N/A	N/A	N/A
	e. Building floor plans	N/A	N/A	N/A
20	Special Fire Protection systems for protection of special risks, if any:	Required	2 Nos. Co2 Fire Extinguishers provided	MR

The shortcoming vide letter no. F6/DFS/MS/Motel/2014/2888 dated 18.12.2014 has been rectified.

The fire protection systems provided in the building were checked and found functional at the time of inspection.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules of NOC issued vide letter no. **F6/DFS/MS/Motel/2011/1270 Dated 20.06.2011** renewal under rule 35 of the Delhi Fire Service rules 2010 is recommended.

Accordingly DFA is put up for your approval and signature please.

Signature of the inspecting officer

Name D.P. Bhardwaj
Designation : DO (South)

Signature of the inspecting officer

Name D.B. Mukherjee
Designation:- ADO (BCP)