

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001**

Fax: 23412593, E-mail: cfohq.dfire@nic.in, Tel:- 011-23414333


NO.F6/DFS/MS/Ind./2015/ 52/1341

Dated: 23/07/15


FIRE SAFETY CERTIFICATE

Certified that **M/s Supreme Metal Craft Medical Products (P) Ltd.** located at **Plot No. G-9, Block B-1, MCIE, Mathura Road, New Delhi** comprised of basement, ground plus two upper floors owned/occupied by M/s Supreme Metal Craft Medical Products (P) Ltd. was granted N.O.C. by this department vide letter No. F.6/DFS/MS/Indl/2011/2415 dated 04.10.2011. The building was re-inspected by the officers concerned of this department on 14-07-2015 in presence of Mr. Jatin, Admin. Executive and found that the said building have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Act-2007 & Rules- 2010 and that the premises / building is fit for occupancy class- 'Industrial' with effect from 23/7/15 for a period of **3 (three)** years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi fire service Rules-2010.

Issued on 23/7/15 at New Delhi by.

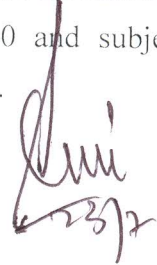

(Dr. G.C. MISRA)
CHIEF FIRE OFFICER

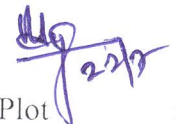9 

Copy to: -

1. The Authorised Signatory, M/s Supreme Metal Craft Medical Products (P) Ltd., Plot No. G-9, Block B-1, MCIE, Mathura Road, New Delhi.
2. The Executive Engineer (Bldg.)-I, SDMC, 8th floor, Civic Centre, Minto Road, New Delhi-110002.

Conditions for the validity of fire safety certificate

- a. All the fire safety and means of escape facilities shall be maintained in good working conditions at all time. Any lapse rendering fire safety or means of evacuation facilities rendering non-functional shall be the responsibility of the management.
- b. Building Sanctioning authority may verify any deviation with regard to the construction / occupancy in the building. In case of any deviation, the fire safety certificate stands null and void.
- c. The staffs shall be trained for operating fire fighting system and mock evacuation drills be conducted at regular intervals and record be maintained.
- d. The owner/occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on website www.dfs.delhigovt.nic.in

INSPECTION REPORT

1. Name & address of the building: M/s Supreme Metal Craft Medical Products (P) Ltd , Plot No. G-9, Block B-1, MCIE, Mathura Road, New Delhi
2. Type of Occupancy : Industrial
3. Type of Case : Renewal
4. Details of previous NOC : F.6/DFS/MS/Indl/2011/2415 dated 04.10.2011
5. Fire Safety directives letter No : F.6/DFS/MS/BP/2008/574 dated 28.02.2028
6. Date of inspection : 14.07.2015
7. Name of the Inspecting Officers : M.K.Chattopadhyay, ADO(M. Road)
8. Name and designation of officers from the building side : Mr. Jatin, Admin. Executive
9. Year of Construction : 2006-07
10. Applicant's letter No. : nil dated 11.05.2015

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	NBC/BBL Requirement	Provided at site	Remarks MR/NMR
1	Access to building			
	• Road width	09 mts	Provided	MR
	• Gate width	4.5 mts	Provided	MR
	• Width of internal road	06 mts	Provided	MR
2	Number, Width, Type & Arrangement of Exits			
	a. Number of staircases	-	-	-
	• Upper Floors	02	Provided	MR
	• Basements	02	Provided	MR
	b. Width of staircases	-	-	-
	• Upper Floors	1.5 mts each	Provided	MR
	• Basements	1.5 mts each	Provided	MR
	c. Protection of exits	-	-	-
	• Fire check door	Required	Provided	MR
	• Pressurization	N/A	N/A	N/A
	e. No. of continuous staircases to terrace	01	01	MR
	g. Width of Corridor	N/A	N/A	N/A
	h. Door Size	N/A	N/A	N/A
3	Compartmentation.			
	• Fire check door	Required	Provided	MR



	<ul style="list-style-type: none"> Sealing of electrical shafts Fire Rating of shaft door Water Curtain Fire Dampers 	N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
4	Smoke Management System.			
	<ul style="list-style-type: none"> Basements Upper floors 	30 a/c per hour	Provided	MR
		12 a/c per hour	Provided	MR
5	Fire Extinguishers			
	<ul style="list-style-type: none"> Total numbers Types IS marking 	16 ABC, CO ₂ ISI marked	Provided	MR
			Provided	MR
			Provided	MR
6	First-Aid Hose Reels.			
	<ul style="list-style-type: none"> Total numbers on each floor Length of hose reel hose Nozzle diameter 	01 30 m 5 mm	Provided	MR
			Provided	MR
			Provided	MR
7	Automatic fire detection and alarming system.			
	<ul style="list-style-type: none"> Type of detectors Location of Main Panel Location of Repeater Panel Alternate source of power Hooters' Location 	Smoke Ground floor N/A Required Required	Provided Provided N/A Provided Provided at each floor	MR MR N/A MR MR
8	MOEFA	Required	Provided	MR
9	Public Address System.	N/A	N/A	N/A
10	Automatic Sprinkler System.			
	<ul style="list-style-type: none"> Basement Upper Floor Sprinkler above false ceiling 	Required	Provided	MR
		Required	Provided	MR
		N/A	N/A	N/A
11	Internal Hydrants			
	<ul style="list-style-type: none"> Size of riser/down-comer Number of hydrants per floor Hose Box 	150 mm 01 01	Provided Provided Provided	MR MR MR
12	Yard Hydrants.			

	<ul style="list-style-type: none"> Total number of hydrants Hose Box 	01	Provided	MR
		01	Provided	MR
13	Pumping Arrangements.			
	<ul style="list-style-type: none"> Ground Level 	----	----	----
	➤ Discharge of main Pump	2280 LPM	Provided	MR
	➤ Head of Main pump	48 mts	Provided	MR
	➤ Number of main pumps	01	02	MR
	➤ Jockey Pump out put	180 LPM	Provided	MR
	➤ Jockey pump head	48 mts	Provided	MR
	➤ Standby Pump out put	2280 LPM	Provided	MR
	➤ Standby Pump Head	48 mts	Provided	MR
	➤ Auto Starting/ Manual stopping	Required	Provided	MR
	➤ Pump House Access	Required	Provided	MR
	<ul style="list-style-type: none"> Terrace level 	-----	-----	-----
	➤ Discharge of pump	900 LPM	Provided	MR
	➤ Head of the pump	35 mts	Provided	MR
	➤ Power Supply	Required	Provided (DG Set)	MR
	➤ Auto Starting of pump	Required	Provided	MR
14	Captive Water Storage for fire fighting.			
	<ul style="list-style-type: none"> Underground tank capacity 	1,00,000 lts	provided	MR
	➤ Draw-off connection	Required	Provided	MR
	➤ Fire service inlet	Required	Provided	MR
	➤ Access to tank	Required	Provided	MR
	<ul style="list-style-type: none"> Overhead Tank capacity 	20,000 lts	Provided	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of Lifts.			
	<ul style="list-style-type: none"> Pressurization of Lift Shaft 	N/A	N/A	N/A
	<ul style="list-style-type: none"> Pressurization of Lift lobby 	N/A	N/A	N/A
	<ul style="list-style-type: none"> Communication In lift Car 	Required	Provided	MR
	<ul style="list-style-type: none"> Fireman's Grounding Switch 	Required	Provided	MR
	<ul style="list-style-type: none"> Lift Signage 	Required	Provided	MR

17	Standby power supply	Required	Provided	MR
18	Refuge Area.			
	➤ Total Area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A
19	Fire Control Room			
	• Detector System Panel	Required	Provided	MR
	• Flow Switch Panel	N/A	N/A	N/A
	• PA System Panel	N/A	N/A	N/A
	• Batter backup	N/A	N/A	N/A
	• Building Floor Plans	N/A	N/A	N/A
20	Special Fire Protection Systems for Protection of special Risks, if any:	Required	02 ABC type fire extinguisher found provided near elect. panel	MR

The fire protection systems provided in the building were test checked and found functional at the time of inspection.

The shortcomings issued by this department vide letter No. F.6/DFS//MS/2015/598 dated 23.03.2015 has been compliance by the building management.

In view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the NOC issued vide letter No. F.6/DFS/MS/Indl/2011/2415 dated 04.10.2011, renewal under Delhi Fire Service Act- 2007 & Rules- 2010 is recommended.

DFA is put up for approval & signature please.

M.K. Chattopadhyay
17/2



Signature of the Inspecting Officer
Name M.K.CHATTOPADHYAY
Designation: - Asstt. Div. Officer (M.Rd)