

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001**

Fax No. 011-23412593, Ph. 011-23412225

No. F.6 DFS/MS/School/2017/SZ/ 1427

Dated: 27/9/17

**FIRE SAFETY CERTIFICATE**

Certified that **Olive Anthony Block at the Frank Anthony Public School** located at **Lajpat Nagar-IV, New Delhi-110024**, comprised of **Ground, first and second floor** was granted NOC by this department vide letter No. F.6/MS/MS/2006/890 dated 12.04.2006. The premises was re-inspected by officer concerned of this department on 04.09.2017 in the presence of Mr. Srikant Sati (Estate Manager) of the school and observed addition of three building blocks namely **Junior Block** (Ground + 2 upper floors), **Middle Block** (LG floor, UG floor + 2 upper floors), **Senior Block** (Ground + 2 upper floors), **Admin Block** (Ground + 2 upper floors) have complied with the fire prevention and fire safety requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the school building is fit for occupancy class "**Educational Building**" Group-B, as above with effect from the date of issue of this certificate for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 27/9/17 at New Delhi by

*2579*  
(Vipin Kental)  
Chief Fire Officer

Copy to: -

1. The Principal, the Frank Anthony Public School, Lajpat Nagar-IV, New Delhi-110024
2. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi

**Conditions for the validity of Fire Safety Certificate**

1. All the fire safety and means of escape facilities shall be maintained in good working condition at all time. Any lapse rendering the fire safety or means of evacuation facilities non-functional shall be the responsibility of the management.
2. Building Sanctioning authority may verify any deviation with regard to construction/occupancy in the building. In case of any deviation, the fire safety certificate stands null & void.
3. The staff shall be trained for operating fire fighting system and mock evacuation drill be conducted at regular interval and record be maintained.
4. This Certificate cannot be treated as regularization of unauthorized construction, if any.
5. The Owner/Occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules, 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).
6. The Owner/Occupier shall apply for renewal of this Fire Safety Certificate to the Director in the form 'J' [sub rule (1) of rule 37] along with copy of this certificate, six months prior to its expiry. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).

INSPECTION REPORT				
1	Name & Address of the Building	THE FRANK ANTHONY PUBLIC SCHOOL, LAJPAT NAGAR-IV, NEW DELHI-110024		
2	Type of Occupancy	Educational Building "Group-B" (School)		
3	Building Comprised of	Junior Block- Ground + 2 upper floors. Middle block- Lower Gd, Upper ground + 2 upper floors. Senior block- Ground + 2 upper floors Admin block- Ground + 2 upper floors.		
4	Type of Case	Addition & Renewal		
5	Details of Previous NOC	F6/DFS/MS/School/2006/890 dated 12-04-2006		
6	Fire Safety Directives Letter No	DOE circular No. 262-362 dated 17/01/2005		
7	Date of Inspection	04-09-2017		
8	Name of the Inspecting Officers	ADO R.N. Singh		
9	Name & Designation of Officers from the building side	Mr. Srikant Sati (Estate Manager)		
10	Year of construction	2006-07		
11	Applicant letter No.	Nil dated 03-08-2017		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	Old NOC requirement	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	• Road width	Required	6 mtr	MR
	• Gate width	Required	4.5 mtr	MR
	• Width of internal road	N/A	N/A	N/A
2	Number, width, type & arrangement of exits			
	a. Number of Staircase			
	➤ Upper floors	Required	Jr. Block- 3 , Mid. Block- 2, Sr. Block- 4, & Admn Block- 4 No's	MR
	➤ Basement floor	N/A	N/A	N/A
	b. Width of Staircase			
	➤ Upper floors	Required	Jr. Block- 1.10 (2) & 1.50m, Mid. block- 1.50m & 1.30m, Sr. block- 1.50m (4 No's) Admn block- 1.50m (4 No's)	MR
	➤ Basement floor	N/A	N/A	N/A
	c. Protection of exits			
	➤ Fire check door	N/A	N/A	N/A
	➤ Pressurization	N/A	N/A	N/A
	d. No. of continuous staircase to terrace	Required	Jr. bk-1, Mid bk-1, Sr. bk-1, Admin bk-2 No's	MR
	e. Width of corridor	Required	1.50 mtr	MR
	f. Door size	1 mtr	1 mtr	MR
3	Compartmentation.			
	• Fire check door.	N/A	N/A	N/A
	• Sealing of electrical shafts.	N/A	N/A	N/A
	• Fire rating of shaft door.	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire dampers.	N/A	N/A	N/A
4.	Smoke Management system.			
	• Basement	30 ACPH	N/A	N/A
	• Upper floors	12 ACPH	N/A	N/A
5.	Fire Extinguishers.			
	• Total numbers	20 No's	20 No's	MR
	• Types	ABC / Co2	ABC-12, DCP-08	MR
	• ISI Marking	ISI Marked	Provided	MR
6.	First aid Hose-reels.			
	• Total numbers on each floor.	1 & 2 No's	2 No's provided	MR
	• Length of hose-reel hose.	30 m	30 m	MR
	• Nozzle Diameter	5 mm	5 mm	MR

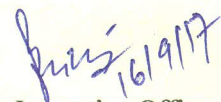
<b>7</b>	<b>Automatic fire detection &amp; alarming system.</b>			
	1. Type of detectors	N/A	N/A	N/A
	2. Location of Main Panel	N/A	N/A	N/A
	3. Location of Repeater Panel	N/A	N/A	N/A
	4. Alternate source of power	N/A	N/A	N/A
	5. Hooter's location	N/A	N/A	N/A
<b>8.</b>	<b>MOEFA</b>	<b>Required</b>	<b>Provided</b>	<b>MR</b>
<b>9.</b>	<b>Public Address System</b>	<b>N/A</b>	<b>N/A</b>	<b>N/A</b>
<b>10.</b>	<b>Automatic Sprinkler System</b>			
	• Basement.	N/A	N/A	N/A
	• Upper floors	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	N/A
<b>11.</b>	<b>Internal Hydrants.</b>			
	• Size of Riser/Down-comer	Required	100 mm	MR
	• Number of Hydrant per floor	Required	Two	MR
	• Hose box.	Required	Two	MR
<b>12.</b>	<b>Yard Hydrants.</b>			
	• Total number of hydrants.	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
<b>13.</b>	<b>Pumping arrangements.</b>			
	<b>a) Ground Level</b>			
	➤ Discharge of main pump.	N/A	900 LPM	N/A
	➤ Head of main pump.	N/A	50 mtr	N/A
	➤ Number of main pumps.	N/A	One	N/A
	➤ Jockey Pump output.	N/A	N/A	N/A
	➤ Jockey Pump head.	N/A	N/A	N/A
	➤ Standby Pump output.	N/A	N/A	N/A
	➤ Standby Pump head.	N/A	N/A	N/A
	➤ Auto Starting / Manual Stopping.	N/A	N/A	N/A
	➤ Pump house access.	N/A	N/A	N/A
	<b>b) Terrace Level</b>			
	➤ Discharge of pump.	450 LPM	450 LPM	MR
	➤ Head of pump.	40 m	40 m	MR
	➤ Power supply.	N/A	N/A	N/A
	➤ Auto starting of pump.	N/A	N/A	N/A
<b>14.</b>	<b>Captive water storage for Fire Fighting.</b>			
	• Underground tank capacity.	25,000 ltrs	25,000 ltrs	MR
	➤ Draw-off connection.	N/A	N/A	N/A
	➤ Fire Service Inlet.	N/A	N/A	N/A
	➤ Access to tank.	N/A	N/A	N/A
	• Overhead tank capacity.	10,000 ltrs	50,000 ltrs	MR
<b>15.</b>	<b>Exit Signage.</b>	<b>Required</b>	<b>Provided</b>	<b>MR</b>
<b>16.</b>	<b>Provision of Lifts.</b>			
	• Pressurization of lift shaft.	N/A	N/A	N/A
	• Pressurization of lift lobby.	N/A	N/A	N/A
	• Communication in lift car.	N/A	N/A	N/A
	• Fireman's switch.	N/A	N/A	N/A
	• Lift signage.	N/A	N/A	N/A
<b>17</b>	<b>Standby Power Supply</b>	<b>N/A</b>	<b>N/A</b>	<b>N/A</b>
<b>18.</b>	<b>Refuge Area</b>			
	• Total area	N/A	N/A	N/A
	• Location	N/A	N/A	N/A

19.	<b>Fire Control Room.</b>	<ul style="list-style-type: none"> <li>• Detector System Panel.</li> <li>• Flow Switch Panel.</li> <li>• PA system Panel.</li> <li>• Battery backup</li> <li>• Building floor plan</li> </ul>	N/A	N/A	N/A
			N/A	N/A	N/A
			N/A	N/A	N/A
			N/A	N/A	N/A
			N/A	N/A	N/A
20.	<b>Special Fire Protection System for the Protection of special Risk, if any.</b>	Required	ABC type fire extinguishers provided near elect panel	MR	

The Fire protection systems provided in the building were checked / operated and found functional at the time of inspection. The shortcomings communicated vide letter no. F.6/DFS/MS/School/2016/1016 dated 22/04/16 found complied.

Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under Directorate of Education circular, FSC issued vide letter No. F.6/DFS/MS/2006/890 dated 12/04/2006, renewal under rule 37 of the Delhi Fire Service rules, 2010 is recommended.

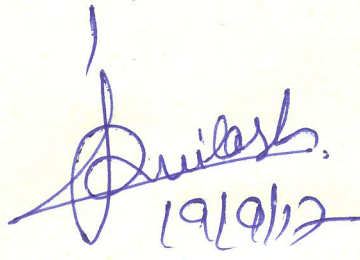
Accordingly, DFA is put up for approval and signature please.

  
 Signature of the Inspecting Officer  
 Name : R.N. Singh  
 Designation: ADO

The Frank Anthony Public School, Lajpat Nagar-IV, New Delhi

DO (SD)

Kindly inform whether the Admin building is a stand alone building or not.

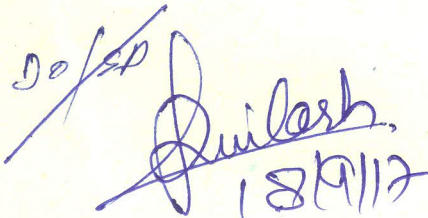
  
19/01/17

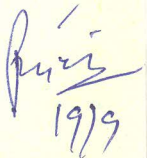
DO (SD)

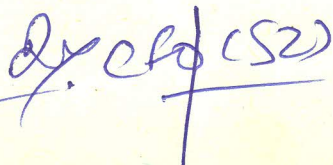


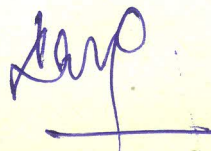
  
R.N.S

Sir. Admin block interconnected with one block and two others are separate blocks

  
18/01/17

  
19/1

  
Dy. Chief (SD)



1250 / 1020  
26/2

F.T.M. W