

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI- 110001**

No. F.6/DFS/MS/Club/2017/SZ/ 1540

Dated: 27/10/17

FIRE SAFETY CERTIFICATE

Certified that the **Vasant Vihar Club** located at **88, Paschimi Marg, New Delhi-110057**, comprised of basement, ground plus two upper floors Owned/Occupied by Govt. Servants Co-operative House Building Society Ltd., was granted Fire Safety Certificate by this department vide letter No. F.6/DFS/MS/Club/2014/SZ/1000 dated 08/08/2014. The premises was re-inspected by the officer concerned of this department on 20.09.2017 in the presence of Mr. Bhuvnesh Kashyap, General Manager of the club and found that the said club building have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the premises is fit for occupancy class Group-D "**Assembly Building**" (Club) as above with effect from the date of issuance of this certificate for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 27/10/17 at New Delhi by


Vipin Kental
Chief Fire Officer
Ph. 011-23412225

Copy to: -

1. The General Manager, Vasant Vihar Club, 88, Paschimi Marg, New Delhi-110057
2. The DEO, Office of the Commissioner of Excise, Govt. of NCTD,
L & N Block, I.P. Estate, Vikas Bhawan, New Delhi- 110002

Conditions for the validity of Fire Safety Certificate

1. All the fire safety and means of escape facilities shall be maintained in good working condition at all time. Any lapse rendering the fire safety or means of evacuation facilities non-functional shall be the responsibility of the management.
2. Building Sanctioning authority may verify any deviation with regard to construction/occupancy in the building. In case of any deviation, the fire safety certificate stands null & void.
3. The staff shall be trained for operating fire fighting system and mock evacuation drill be conducted at regular interval and record be maintained.
4. The basement shall be used strictly as per the provisions of Building Bye Laws.
5. The Owner/Occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules, 2010. The form is available on www.dfs.delhigovt.nic.in.
6. The Owner/Occupier shall apply for renewal of this Fire Safety Certificate to the Director in the form 'J' [sub rule (1) of rule 37] along with copy of this certificate, six months prior to its expiry. The form is available on www.dfs.delhigovt.nic.in.

| INSPECTION REPORT | | | | |
|-------------------|---|---|--|----------------|
| 1 | Name & Address of the Building | VASANT VIHAR CLUB, 88, PASCHIMI MARG, VASANT VIHAR, NEW DELHI-110057 | | |
| 2 | Type of Occupancy | Assembly Building "Group-D" | | |
| 3 | Building Comprised of | Basement, Ground plus two upper floors. | | |
| 4 | Type of Case | Renewal | | |
| 5 | Details of Previous NOC | F.6/DFS/MS/Club/2014/SZ/1000 Dated 08-08-2014 | | |
| 6 | Fire Safety Directives Letter No | F.6/DFS/MS/BP/90/258 Dated 27-02-1990 | | |
| 7 | Date of Inspection | 20.09.2017 | | |
| 8 | Name of the Inspecting Officers | ADO R.N. Singh | | |
| 9 | Name & Designation of Officers from the building side | Mr. Bhuvnesh Kashyap (GM) | | |
| 10 | Year of construction | 1991 | Restaurant running at first floor of the bldg. | |
| 11 | Applicant letter No. | Nil Dated 16/01/2017 | | |
| S. No | Minimum standards on Fire Prevention and Fire Safety U/R 33 | Old FSC requirement | Provided at Site | Remarks MR/NMR |
| 1 | Access to Building. | | | |
| | • Road width | Required | 9 mtr | MR |
| | • Gate width | Required | 5 mtr | MR |
| | • Width of internal road | NA | NA | NA |
| 2 | Number, width, type & arrangement of exits | | | |
| | a. Number of Staircase | | | |
| | • Upper floors | Required | 5 No's | MR |
| | • Basement floor | Required | 3 No's | MR |
| | b. Width of Staircase | | | |
| | • Upper floors | Required | 1.46m, 1.47m, 0.98m, 1.30m & 1.30m | MR (old case) |
| | • Basement floor | Required | 1.36m, 3.05m & 3.60m | MR (old case) |
| | c. Protection of exits | | | |
| | • Fire check door | Required | Provided (basement) | MR |
| | • Pressurization | -NA- | -NA- | -NA- |
| | d. No. of continuous staircase to terrace | Required | Two | MR |
| | e. Width of corridor | -NA- | -NA- | -NA- |
| | f. Door size | Required | 2 m, 1.77m, 1.90m | MR |
| 3 | Compartmentation. | | | |
| | • Fire check door. | Required | Provided | MR |
| | • Sealing of electrical shafts. | Required | Provided | MR |
| | • Fire rating of shaft door. | -NA- | -NA- | -NA- |
| | • Water curtain | -NA- | -NA- | -NA- |
| | • Fire dampers. | -NA- | -NA- | -NA- |
| 4. | Smoke Management system. | | | |
| | • Basement | Required | Exhaust fan provided | MR |
| | • Upper floors | -NA- | -NA- | -NA- |
| 5. | Fire Extinguishers. | | | |
| | • Total numbers | | 25 No's | MR |
| | • Typés | ISI marked | ABC- 15, W.Co2- 10 | MR |
| | • ISI Marking | | Provided | MR |
| 6. | First Aid Hose Reels. | | | |
| | • Total numbers on each floor. | | One | MR |
| | • Length of hose-reel hose. | Hose Reel | 30 mtr | MR |
| | • Nozzle Diameter | | 05 mm | MR |

Renewal

Vasant Vihar Club at 88, Paschimi Marg, Vasant Vihar, New Delhi-57

| | | | | |
|-----|--|-------------|------------------------|------|
| 7 | Automatic fire detection & alarming system. | | | |
| | • Type of detectors | -NA- | -NA- | -NA- |
| | • Location of Main Panel | -NA- | -NA- | -NA- |
| | • Location of Repeater Panel | -NA- | -NA- | -NA- |
| | • Alternate source of power | -NA- | -NA- | -NA- |
| | • Hooter's location | -NA- | -NA- | -NA- |
| 8. | MOEFA | Required | Provided | MR |
| 9. | Public Address System | Required | Provided | MR |
| 10. | Automatic Sprinkler System | | | |
| | • Basement | Required | Provided | MR |
| | • Upper floors | Required | Provided in restaurant | MR |
| | • Sprinkler above false ceiling | -NA- | -NA- | -NA- |
| 11. | Internal Hydrants. | | | |
| | • Size of Riser/Down-comer | Required | 100 mm | MR |
| | • Number of Hydrant per floor | Required | One | MR |
| | • Hose box. | Required | One | MR |
| 12. | Yard Hydrants. | | | |
| | • Total number of hydrants. | Required | 2 No's | MR |
| | • Hose box. | Required | 2 No's | MR |
| 13. | Pumping arrangements. | | | |
| | • Ground Level | | | |
| | ➤ Discharge of main pump. | 1620 LPM | 1020 LPM | MR |
| | ➤ Head of main pump. | -NA- | 44m | MR |
| | ➤ Number of main pumps. | One | One | MR |
| | ➤ Jockey Pump output. | 180 LPM | 180 LPM | MR |
| | ➤ Jockey Pump head. | -NA- | 60m | MR |
| | ➤ Standby Pump output. | 1620 LPM | Provided diesel pump | MR |
| | ➤ Standby Pump head. | -NA- | 60m | MR |
| | ➤ Auto Starting / Manual Stopping. | Required | Provided | MR |
| | • Terrace Level | | | |
| | ➤ Discharge of pump. | 450 LPM | 900 LPM | MR |
| | ➤ Head of pump. | Required | 60m | MR |
| | ➤ Power supply. | Required | Provided | MR |
| | ➤ Auto starting of pump. | Required | Provided | MR |
| 14. | Captive water storage for Fire Fighting. | | | |
| | • Underground tank capacity. | 50,000 Ltr. | 50,000 Ltr. | MR |
| | ➤ Draw-off connection. | Required | Provided | MR |
| | ➤ Fire Service Inlet. | Required | Provided | MR |
| | ➤ Access to tank. | Required | Provided | MR |
| | • Overhead tank capacity. | 10,000 Ltr. | 10,000 Ltr. | MR |
| 15. | Exit Signage. | Required | Provided | MR |
| 16. | Provision of Lifts. | | | |
| | • Pressurization of lift shaft. | Required | Provided | MR |
| | • Pressurization of lift lobby. | -NA- | -NA- | -NA- |
| | • Communication in lift car. | Required | Provided | MR |
| | • Fireman's switch. | Required | Provided | MR |
| | • Lift signage. | Required | Provided | MR |
| 17 | Standby Power Supply | Required | Provided | MR |
| 18. | Refuge Area | | | |
| | • Total area | -NA- | -NA- | -NA- |
| | • Location | -NA- | -NA- | -NA- |

Renewal


Vasant Vihar Club at 88, Paschimi Marg, Vasant Vihar, New Delhi-57

| | | | | |
|-----|--|------|--|------|
| 19. | Fire Control Room. | | | |
| | 1. Detector System Panel. | -NA- | -NA- | -NA- |
| | 2. Flow Switch Panel. | -NA- | -NA- | -NA- |
| | 3. PA system Panel. | -NA- | -NA- | -NA- |
| | 4. Battery backup | -NA- | -NA- | -NA- |
| | 5. Building floor plan | -NA- | -NA- | -NA- |
| 20. | Special Fire Protection System for the Protection of special Risk, if any : | -NA- | ABC type fire extinguishers provided near electrical panel | -NA- |

The Fire protection systems provided in the building were checked /operated and found functional at the time of inspection. Shortcomings communicated vide letter dated 04.08.2017 found complied.

Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the FSC issued vide letter No. F6/DFS/MS/Club2014/SZ/1000 dated 08.08.2014, renewal under rule 37 of the Delhi Fire Service rules, 2010 is recommended.

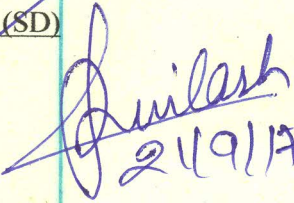
Accordingly, DFA is put up for approval and signature please.

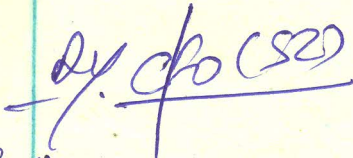

 Signature of the Inspecting Officer
 Name : R.N. Singh
 Designation: ADO

Renewal

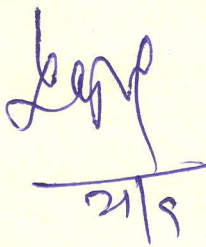
Vasant Vihar Club at 88, Paschimi Marg, Vasant Vihar, New Delhi-57

DO (SD)


21/9/17


DCFO (SZ)

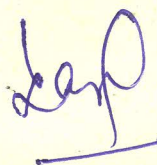
1251/Ch 12
26/9/16/X/1201X


21/9

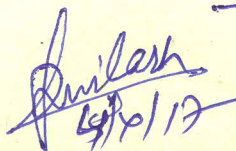
DCFO (SZ)

PI check point no 13 again
25/9


DCFO SZ



DO (SD)


21/9/17

DO
21/9

Sir, Regretted and need full correction,
re-submitted file. 
21/9

