

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI- 110001

No. F.6/DFS/MS/EH/2017/SZ/ 1571

Dated: 3/11/17

FIRE SAFETY CERTIFICATE

Certified that the **McDonald's Family Restaurant** at (Ground, Mezzanine and first floor only) 47, Basant Lok, Vasant Vihar, New Delhi-57, comprised of basement (storage), Ground, Mezzanine plus three upper floors Owned/Occupied by M/s Connaught Plaza Restaurants Pvt Ltd was granted Fire Safety Certificate by this department vide letter No. F.6/DFS/MS/EH/2014/SZ/1118 dated 03/09/2014. The restaurant premises was re-inspected by the officer concerned of this department on 09/10/2017 in the presence of Mr. Champak Kumar (Manager) and found that the said restaurant premises have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the restaurant premises is fit for occupancy class-D "**Assembly**" (restaurant) as above with effect from the date of issue of this certificate for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 3/11/17 at New Delhi by


(Vipin Kental)
Chief Fire Officer
Ph. 011-23412225

Copy to: -

1. The Manager, McDonald's Restt., 47, Basant Lok , Vasant Vihar, New Delhi-110057
2. The DHO, South MCD, Public Health Deptt., South Zone, Green Park, New Delhi-110016

Conditions for the validity of Fire Safety Certificate

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life or property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of firefighting system.
4. The basement shall be used strictly as per the provisions of Building Bye Laws.
5. The Owner/Occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules, 2010. The form is available on www.dfs.delhigovt.nic.in.
6. The Owner/Occupier shall apply for renewal of this Fire Safety Certificate to the Director in the form 'J' [sub rule (1) of rule 37] along with copy of this certificate, six months prior to its expiry. The form is available on www.dfs.delhigovt.nic.in.

INSPECTION REPORT				
1	Name & Address of the Building	MCDONALD'S FAMILY RESTAURANT, 47, Basant Lok, Vasant Vihar, New Delhi-110057 (Operated By M/s Connaught Plaza Restt Pvt Ltd)		
2	Type of Occupancy	Group-D Assembly Building. (Restaurant)		
3	Building comprised of	B+ G+M+3 upper floors (2 nd & 3 rd floor others property)		
4	Type of Case	Renewal		
5	Details of Previous NOC	No.F.6/DFS/MS/EH/2014/SZ/1118 Dated 03-09-2014		
6	Fire Safety Directives Letter No	Cir. No. F.6/DFS//EH/MS/2005/718 Dated 04-04-2005		
7	Date of Inspection	09.10.2017		
8	Name of the Inspecting Officers	ADO R.N. Singh		
9	Name & Designation of Officers from the building side	Mr. Champak Kumar (Manager)		
10	Year of construction	1990	Restt running at B+G+M+1 st floor of the bldg.	
11	Applicant letter No.	CPRPL/FM/NOC/2017-18/OM/101 Dated 20.09.2017		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	Old NOC requirements	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	• Road width	Required	9 mtr	MR
	• Gate width	N/A	N/A	N/A
	• Width of internal road	N/A	N/A	N/A
2	Number, width, type & arrangement of exits			
	a. Number of Staircase			
	• Upper floors	2 Nos	2 Nos	MR
	• Basement floor	2 Nos	2 Nos	MR
	b. Width of Staircase			
	• Upper floors	1.08 & 1.18m	1.08 & 1.18m	MR
	• Basement floor	1.08 & 1m	1.08 & 1m	MR
	c. Protection of exits			
	• Fire check door	N/A	N/A	N/A
	• Pressurization	N/A	N/A	N/A
	d. No. of continuous staircase to terrace	Required	One	MR
	e. Width of corridor	N/A	N/A	N/A
	f. Door size	N/A	N/A	N/A
3	Compartmentation.			
	• Fire check door.	N/A	N/A	N/A
	• Sealing of electrical shafts.	N/A	N/A	N/A
	• Fire rating of shaft door.	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire dampers.	N/A	N/A	N/A
4.	Smoke Management system.			
	• Basement	30 ACPH	Exhaust fan provided	MR
	• Upper floors	12 ACPH	Exhaust fan provided	MR
5.	Fire Extinguishers.			
	• Total numbers	08 Nos	08 Nos	MR
	• Types	ABC / Co2	ABC-05 & Co2-03	MR
	• ISI Marking	ISI marked	Provided	MR
6.	First Aid Hose Reels.			
	• Total numbers on each floor.	One	One	MR
	• Length of hose-reel hose.	30 m	30m	MR
	• Nozzle Diameter	5 mm	5mm	MR

McDonald's Family Restt. 47, Basant Lok, Vasant Vihar, New Delhi

7	Automatic fire detection & alarming system.			
	• Type of detectors	N/A	N/A	N/A
	• Location of Main Panel	N/A	N/A	N/A
	• Location of Repeater Panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Hooter's location	N/A	N/A	N/A
8.	MOEFA / MCP's	Required	Provided	MR
9.	Public Address System	N/A	N/A	N/A
10.	Automatic Sprinkler System			
	• Basement	Required	Provided	MR
	• Upper floors	Required	Provided	MR
	• Sprinkler above false ceiling	N/A	N/A	N/A
11.	Internal Hydrants.			
	• Size of Riser/Down-comer	Required	100 mm	MR
	• Number of Hydrant per floor	Required	One	MR
	• Hose box.	Required	One	MR
12.	Yard Hydrants.			
	• Total number of hydrants.	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
13.	Pumping arrangements.			
	• Ground Level			
	➤ Discharge of main pump.	N/A	N/A	N/A
	➤ Head of main pump.	N/A	N/A	N/A
	➤ Number of main pumps.	N/A	N/A	N/A
	➤ Jockey Pump output.	N/A	N/A	N/A
	➤ Jockey Pump head.	N/A	N/A	N/A
	➤ Standby Pump output.	N/A	N/A	N/A
	➤ Standby Pump head.	N/A	N/A	N/A
	➤ Auto Starting / Manual Stopping.	N/A	N/A	N/A
	• Terrace Level			
	➤ Discharge of pump.	450 LPM	450 LPM	MR
	➤ Head of pump.	35m	35m	MR
	➤ Power supply.	Required	Provided	MR
	➤ Auto starting of pump.	Required	Provided	MR
14.	Captive water storage for Fire Fighting.			
	• Underground tank capacity.	N/A	N/A	N/A
	➤ Draw-off connection.	N/A	N/A	N/A
	➤ Fire Service Inlet.	N/A	N/A	N/A
	➤ Access to tank.	N/A	N/A	N/A
	• Overhead tank capacity.	5,000 ltrs	10,000 ltrs	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	• Pressurization of lift shaft.	N/A	N/A	N/A
	• Pressurization of lift lobby.	N/A	N/A	N/A
	• Communication in lift car.	N/A	N/A	N/A
	• Fireman's switch.	N/A	N/A	N/A
	• Lift signage.	N/A	N/A	N/A
17	Standby Power Supply	Required	Provided	MR
18.	Refuge Area			
	• Total area	N/A	N/A	N/A
	• Location	N/A	N/A	N/A

McDonald's Family Restaurant at 47, Basant Lok, Vasant Vihar, New Delhi

19.	Fire Control Room.			
	• Detector System Panel.	N/A	N/A	N/A
	• Flow Switch Panel.	N/A	N/A	N/A
	• PA system Panel.	N/A	N/A	N/A
	• Battery backup	N/A	N/A	N/A
	• Building floor plan	N/A	N/A	N/A
20.	Special Fire Protection System for the Protection of special Risk, if any :			N/A
<p>The Fire protection systems provided in the building were checked /operated and found functional at the time of inspection.</p> <p>Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the FSC issued vide letter No. F6/DFS/MS/EH2014/SZ/1118/ dated 03/09/2014, renewal under rule 37 of the Delhi Fire Service rules, 2010 is recommended.</p> <p>Accordingly, DFA is put up for approval and signature please.</p>				
<p><i>R.N. Singh</i> Signature of the Inspecting Officer Name : R.N. Singh Designation: ADO</p>				


McDonald's Family Restt. 47, Basant Lok, Vasant Vihar, New Delhi

DO (SD)

Anilans
17/11/17

dy. of (S2)

Kapoor
17/11

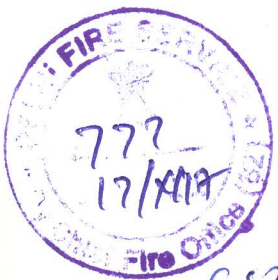

13171 of S2
23/11 11/11

CFO S2

M.Scell

FI 107

23/10/17

FI letter is put up for sign. please

CFO S2

M.Scell

11/11

27/11