

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI-110001.**

No. F.6/DFS/MS/EH/2018/SZ/ 179

Dated: 28/1/18

FIRE SAFETY CERTIFICATE

Certified that the **McDonald's Family Restaurant**, 6A-6B, Sonia Cinema complex, Vikaspuri, New Delhi 110018, is running at basement, ground floor and one upper floor only. The above restaurant was issued FSC vide Letter No. F6/DFS/MS/EH/2014/SZ/1578 dated 15.12.2014 owned/ occupied by M/S Connaught Plaza Restaurant Pvt. Ltd. The Restaurant building was re-inspected by the officers concerned of this department on 27.12.2017 in the presence of Sh. Vipin Panwar (1st Asstt.) and found that the M/S Connaught Plaza Restaurant Pvt. Ltd. have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the restaurant building/premises is fit for occupancy class Group D assembly building w.e.f. the date of issue of this certificate for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule-38 of the Delhi Fire Service Rules, 2010 printed overleaf.

Issued on.....28/1/18.....at New Delhi.

Vipin Kental

(VIPIN KENTAL)
CHIEF FIRE OFFICER

Copy to:-

The Manager,
Mc Donald's Family Restaurant,
6A-6B, Sonia Cinema complex,
Vikaspuri, New Delhi 110018.

INSPECTION REPORT

1. Name & address of the building: Mc Donald's Family Restaurant, 6A-6B, Sonia Cinema complex, Vikaspuri, New Delhi 110018.
2. Type of Occupancy : Group D (Assembly)
3. Type of Case : Renewal
4. Details of Previous NOC : F6/DFS/MS/EH/2014/SZ/1578 dated 15.12.2014.
5. Fire Safety directives letter No : Nil.
6. Date of inspection : 27.12.2017
7. Name of Inspecting Officer : D.O. M.K. Chattopadhyay and A.D.O. Sandeep Duggal
8. Name and designation of officers
From the building side : Sh. Vipin Panwar (1st Asstt.)
9. Year of Construction : Before 2007
10. Applicant's letter No. : Nil dated 09.10.2017

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	Requirement as per FSC dt. 15.12.2014	Provided at site	Remarks MR/NMR
1.	Access to building			
	<ul style="list-style-type: none"> • Road width • Gate width • Width of internal road 	Accessible 4.5 mtrs 06 mtrs	12 mtrs Directly accessible from road Provided	M/R MR MR
2.	Number, Width, Type & Arrangement of Exits			
	a. Number of staircases			
	<ul style="list-style-type: none"> • Upper Floors • Basements 	Two Two	Two Two	M/R M/R
	b. Width of staircases			
	<ul style="list-style-type: none"> • Upper Floor • Basements 	Two Exits	134 & 121 cms	M/R, Being Old case
	c. Protection of exits			
	<ul style="list-style-type: none"> • Fire check door • Pressurization 	Two Exits	120 & 112 cms	M/R, Being Old case
		Required	Provided	M/R
	d. No. of continuous staircases to terrace	NA	NA	NA
	e. Width of Corridor	Required	One	MR
	f. Door Size	150 cms	160 cms	MR
		Two Exits	180 & 100 cms	M/R, Being Old case
3.	Compartmentation			
	<ul style="list-style-type: none"> • Fire check door • Sealing of electrical shafts • Fire Rating of shaft door • Water Curtain • Fire Dampers 	N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
		N/A	N/A	N/A
4.	Smoke Management System			
	<ul style="list-style-type: none"> • Basements 	Required	Exhaust Fans Provided	M/R
	<ul style="list-style-type: none"> • Upper floors 	Required	Natural Ventilation	M/R
5.	Fire Extinguishers			
	<ul style="list-style-type: none"> • Total numbers • Types • IS marking 	Three no's / floor ABC/CO ₂	Provided	M/R
			Provided	M/R
		ISI marked	ISI marked	M/R
6.	First-Aid Hose Reels			
	<ul style="list-style-type: none"> • Total numbers on ground floor 	one	Provided	M/R

7.	Automatic fire detection and alarming system			
	<ul style="list-style-type: none"> Type of detectors Location of Main Panel Location of Repeater Panel Alternate source of power Hooters' Location 	Smoke & Heat Required NA Required Required	Provided G. Floor NA Provided Near exits	M/R M/R NA M/R M/R
8.	MOEFA	Required	Provided	M/R
9.	Public Address System	Required	Provided	M/R
10.	Automatic Sprinkler System	(common with sonia PVR complex)		
	<ul style="list-style-type: none"> Basement Ground Floor Sprinkler above false ceiling 	Required Required N/A	Provided Provided N/A	M/R M/R N/A
11.	Internal Hydrants	(common with sonia PVR complex)		
	<ul style="list-style-type: none"> Size of riser/down-comer Number of hydrants Hose Box 	Required Required Required	Provided Provided Provided	M/R M/R M/R
12.	Yard Hydrants			
	<ul style="list-style-type: none"> Total number of hydrants Hose Box 	N/A N/A	N/A N/A	N/A N/A
13.	Pumping Arrangements	(common with sonia PVR complex)		
	<ul style="list-style-type: none"> Ground Level <ul style="list-style-type: none"> Discharge of main Pump Head of Main pump Number of main pumps Jockey Pump out put Jockey pump head Standby Pump out put Standby Pump Head Auto Starting/Manual Stopping Terrace level <ul style="list-style-type: none"> Pump House Access Discharge of pump Head of the pump Power Supply Auto Starting of pump 	2250 LPM 80 mtrs 01 900 LPM 30 mtrs 2250 LPM & 450Lpm 88 & 30 mtrs Required Required N/A N/A N/A N/A	Provided Provided Provided Provided Provided Provided Provided Provided Provided N/A N/A N/A N/A	M/R M/R M/R M/R M/R M/R M/R M/R M/R N/A N/A N/A N/A
14.	Captive Water Storage for fire fighting	(common with sonia PVR complex)		
	<ul style="list-style-type: none"> Underground tank capacity <ul style="list-style-type: none"> Draw-off connection Fire service inlet Access to tank Overhead Tank capacity 	Required Required Required Required Required	120000 Ltrs Provided Provided Provided 30000 ltrs	M/R M/R M/R M/R M/R
15.	Exit Signage.	Required	Provided	M/R
16.	Provision of Lifts.			
	<ul style="list-style-type: none"> Pressurization of Lift Shaft Pressurization of Lift lobby Communication In lift Car Fireman's Grounding Switch 	N/A N/A N/A N/A	N/A N/A N/A N/A	N/A N/A N/A N/A

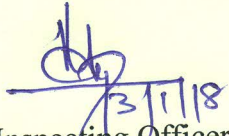
2/14
Basement, Ground Plus One upper Floor


Refuge Area.				
	➤ Total Area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A
19.	Fire Control Room			
	• Detector System Panel	N/A	Basement	N/A
	• Flow Switch Panel	N/A	N/A	N/A
	• PA System Panel	N/A	N/A	N/A
	• Battery backup	N/A	Provided	N/A
	• Building Floor Plans	N/A	N/A	N/A
20.	Special Fire Protection System for Protection of special Risks, if any:		N/A	N/A


The fire protection systems provided in the building were tested, checked and found functional at the time of inspection.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules the FSC issued vide letter number F6/DFS/MS/EH/2014/SZ/1578 dated 15.12.2014 renewal under rule 37 of the Delhi Fire Service Rules 2010 is recommended.

Note: - The restaurant is in the PVR Cinema Complex, Vikaspuri and have common fire safety installations.

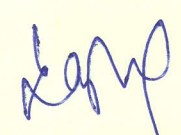

Signature of Inspecting Officer
Name:- M.K. Chattopadhyay
Designation:- Divisional Officer


Signature of Inspecting Officer
Name:- Sandeep Duggal
Designation:- Asstt. Divisional Officer



Dy.C.F.O.(South Zone)


838/DO/80
10/01/2018
1532/CF/SZ
12/11/18

Date: 10-1-18
Diary No: 1097


19/1
CFO (SZ)
m:scell FT/18/1
11/1

F.T. letter is put up for signature please.


m:scell 16/1/18


16/1/18