

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE**  
**NEW DELHI-110001**

No. F.6 DFS/MS/School/2018/SZ/ 569

Dated: 3/4/18

**FIRE SAFETY CERTIFICATE**

Certified that **Paul George Global School** located at Alaknanda, New Delhi-110019, comprises of basement, ground and four upper floors owned/occupied by St. George Education Society (Regd.) was issued FSC by this department vide letter No. F6/DFS/MS/School/2015/SZ/1050 dated 19/06/2015. The premises was re-inspected by officer concerned of this department on 14/03/2018 in presence of Mr. Raja (Admin) and observed that the school building have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the building is fit for occupancy class "**Educational Building**" Group-B, as above with effect from the date of issue of this certificate for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 3/4/18 at New Delhi by

W  
3/4  
(Vipin Kental)  
Chief Fire Officer

Copy to: -

1. The Principal, Paul George Global School, Alaknanda, New Delhi-110019
2. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi.

**Conditions for the validity of Fire Safety Certificate**

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life or property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of firefighting system.
4. The owner/occupier shall submit a declaration every year in Form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or Alteration (Clause 1.4.3 of UBBL-2016), if any.
6. "The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry."


INSPECTION REPORT				
1	Name & Address of the Building	PAUL GEORGE GLOBAL SCHOOL, ALAKNANDA, NEW DELHI-110019		
2	Type of Occupancy	Educational 'Group-B' (School)		
3	Building Comprised of	Basement, Ground + 4 upper floors		
4	Type of Case	Renewal		
5	Details of Previous NOC	F6/DFS/MS/School/2015/SZ/1050 dated 19-06-2015		
6	Fire Safety Directives Letter No	F.6/DFS/MS/BP/2013/257 dated 29-08-2013		
7	Date of Inspection	14-03-2018		
8	Name of the Inspecting Officers	R.N. Singh, ADO (BCP)		
9	Name & Designation of Officers from the building side	Mr. Raja (Admin)		
10	Year of construction	2015		
11	Applicant letter No.	Nil Dt. 12.02.2018, ODD No. 2422 Dt. 15/02/2018		
S. No.	Minimum standards on Fire Prevention and Fire Safety U/R 33	Old NOC requirement	Provided at Site	Remarks MR/NMR
1	<b>Access to Building.</b>			
	• Road width	Required	9 mtr	MR
	• Gate width	Required	5 mtr	MR
	• Width of internal road	Required	6 mtr	MR
2	<b>Number, width, type &amp; arrangement of exits</b>			
	<b>a) Number of Staircase</b>			
	➤ Upper floors	Required	06 Nos	MR
	➤ Basement floor	Required	05 Nos	MR
	<b>b) Width of Staircase</b>			
	➤ Upper floors	1.50 mtr	1.6m x 2 & 2m x 4	MR
	➤ Basement floor	1.50 mtr	1.6m x 2 & 2m x 3	MR
	<b>c) Protection of exits</b>			
	➤ Fire check door	Required	Provided	MR
	➤ Pressurization	N/A	N/A	N/A
	<b>d) No. of continuous staircase to terrace</b>	Required	Six nos	MR
	<b>e) Width of corridor</b>	1.50 mtr	2.84m & 1.76m	MR
	<b>f) Door size</b>	1m	Provided	MR
3	<b>Compartmentation.</b>			
	• Fire check door.	Required	Provided	MR
	• Sealing of electrical shafts.	Required	Provided	MR
	• Fire rating of shaft door.	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire dampers.	Required	Provided	MR
4.	<b>Smoke Management system.</b>			
	• Basement	30 ACPH	Exhaust fans provided	MR
	• Upper floors	12 ACPH	N/A	N/A
5.	<b>Fire Extinguishers.</b>			
	• Total numbers	Required	60 No's	MR
	• Types	ABC / CO2	ABC & CO2	MR
	• ISI Marking	ISI marked	Provided	MR
6.	<b>First Aid Hose-reels.</b>			
	• Total numbers on each floor.	05 Nos	Provided	MR
	• Length of hose-reel hose.	30 m	Provided	MR
	• Nozzle Diameter	5 mm	Provided	MR

Paul George Global School, Alaknanda, New Delhi-110019

As


7	<b>Automatic fire detection &amp; alarming system</b>			
	<ul style="list-style-type: none"> <li>Type of detectors</li> <li>Location of Main Panel</li> <li>Location of Repeater Panel</li> <li>Alternate source of power</li> <li>Hooter's location</li> </ul>	Required	Smoke type	MR
		Required	Control room	MR
		N/A	Basement	N/A
		Required	Provided	MR
		Required	Every floor	MR
8.	<b>MOEFA</b>	Required	Provided	MR
9.	<b>Public Address System</b>	Required	Provided	MR
10.	<b>Automatic Sprinkler System</b>			
	<ul style="list-style-type: none"> <li>Basement</li> <li>Upper floors</li> <li>Sprinkler above false ceiling</li> </ul>	Required	Provided	MR
		N/A	N/A	N/A
		N/A	N/A	N/A
11.	<b>Internal Hydrants.</b>			
	<ul style="list-style-type: none"> <li>Size of Riser/Down-comer</li> <li>Number of Hydrant per floor</li> <li>Hose box.</li> </ul>	Required	100 mm	MR
		Required	5 Nos	MR
		Required	5 Nos	MR
12.	<b>Yard Hydrants.</b>			
	<ul style="list-style-type: none"> <li>Total number of hydrants.</li> <li>Hose box.</li> </ul>	N/A		N/A
		N/A	N/A	N/A
13.	<b>Pumping arrangements.</b>			
	<ul style="list-style-type: none"> <li><b>Ground Level</b> <ul style="list-style-type: none"> <li>Discharge of main pump.</li> <li>Head of main pump.</li> <li>Number of main pumps.</li> <li>Jockey Pump output.</li> <li>Jockey Pump head.</li> <li>Standby Pump output.</li> <li>Standby pump head.</li> <li>Auto Starting/Manual Stopping.</li> <li>Pump House Access</li> </ul> </li> <li><b>Terrace Level</b> <ul style="list-style-type: none"> <li>Discharge of pump.</li> <li>Head of pump.</li> <li>Power supply.</li> <li>Auto starting of pump.</li> </ul> </li> </ul>			
		2280 LPM	Provided	MR
		80 mtr	Provided	MR
		01 No	Provided	MR
		180 LPM	Provided	MR
		40 mtr	Provided	MR
		2280 LPM	Provided	MR
		80 mtr	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		900 LPM	900 LPM	MR
		35 mtr	35 mtr	MR
		Required	Provided	MR
		Required	Not on auto mode	NMR
14.	<b>Captive water storage for Fire Fighting.</b>			
	<ul style="list-style-type: none"> <li>Underground tank capacity. <ul style="list-style-type: none"> <li>Draw-off connection.</li> <li>Fire Service Inlet.</li> <li>Access to tank.</li> </ul> </li> <li>Overhead tank capacity.</li> </ul>	50,000 Ltr	50,000 Ltr	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		25,000 ltrs	Provided	MR
15.	<b>Exit Signage.</b>	Required	Provided	MR
16.	<b>Provisions of Lifts.</b>			
	<ul style="list-style-type: none"> <li>Pressurization of lift shaft.</li> <li>Pressurization of lift lobby.</li> <li>Communication in lift car.</li> <li>Fireman's switch.</li> <li>Lift signage.</li> </ul>	Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
17	<b>Standby Power Supply</b>	Required	Provided	MR
18.	<b>Refuge Area</b>			
	<ul style="list-style-type: none"> <li>Total area</li> <li>Location</li> </ul>	N/A	N/A	N/A
		N/A	N/A	N/A

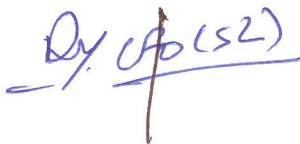
N/

19.	<b>Fire Control Room.</b>			
	• Detector System Panel.	Required	Provided	MR
	• Flow Switch Panel.	Required	Provided	MR
	• PA system Panel.	Required	Provided	MR
	• Battery backup	Required	Provided	MR
	• Building floor plan	Required	Provided	MR
20.	<b>Special Fire Protection System for the Protection of special Risk, if any.</b>			N/A
<p>The Fire protection systems provided in the building were test checked at random and found functional at the time of inspection. Keeping in view of deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the FSC issued vide letter No. F.6/DFS/MS/School/2015/SZ/1050 dated 19/06/2015, renewal under rule 37 of the Delhi Fire Service rules, 2010 is recommended.</p> <p>Accordingly, DFA is put up for approval and signature please.</p> <p style="text-align: right;">   Signature of the Inspecting Officer  Name: R.N. Singh  Designation: ADO (BCP) </p>				

Paul George Global School, Alaknanda, New Delhi-110019

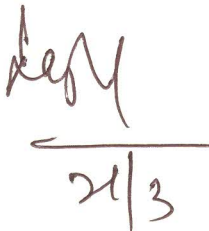
DO (SD)

  
20/3/18

  
Dy. CPO (S2)

1146/CFO/12  
22/3/18



  
21/3

CFO (S2)

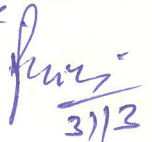
M. Sella

FT/M.

  
27/3

FT letter is put up for sign. ple

  
CFO/S2 M. Sella   
3/4

  
3/12