

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI- 110001

Fax No. 011-23412593, Ph. 011-23412225

No. F.6/DFS/MS/School/2018/SZ/ 770

Dated: 20/4/18

FIRE SAFETY CERTIFICATE

Certified that **New Surya Public School** located at B-110, Thana Road, Sangam Vihar, New Delhi-110062, comprised of ground plus two upper floors was issued NOC by this department vide letter No. F.6/DFSMS/School/2014/SZ/363 dated 28/03/2014. The premises was re-inspected by officer concern of this department on 07/04/2018 in presence of Mr. Divaker Pandey (owner) of the school and found that said school building have deemed complied with the fire prevention and fire safety requirements in accordance with Directorate of Education circular F.16//Estate/CC/Fire Safety/2011/3298 to 3398 dated 01.03.2011 issued by Director of Education, Govt. of NCT of Delhi and that the building is fit for occupancy class '**Educational**' Group-B as above with effect from the date of issue of this certificate for a period of **Three years** subject to compliance of the conditions mentioned below.

Issued on 20/4/18 at New Delhi by

Vk
20/4
(Vipin Kental)
Chief Fire Officer

Copy to: -

1. The Manager, New Surya Public School, B-110, Thana Road, Sangam Vihar, N. Delhi-62
2. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi.

Conditions for the validity of Fire Safety Certificate

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life or property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of firefighting system.
4. The owner/ occupier shall submit a declaration every year in Form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in.
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or Alteration (Clause 1.4.3 of UBBL-2016), if any.
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry.

INSPECTION REPORT				
1	Name & Address of the Building	New Surya Public School, B-110/B, Thana Road, Sangam Vihar, New Delhi-110062		
2	Type of Occupancy	Educational 'Group-B' (School)		
3	Building Comprised of	Ground + 02 upper floors.		
4	Type of Case	Renewal		
5	Details of Previous NOC	F.6/DFS/MS/School/2014/SZ/363 Dt. 28-03-2014		
6	Fire Safety Directives Letter No	DOE Circular No. 262-362 dated 17-01-2005		
7	Date of Inspection	07-04-2018		
8	Name of the Inspecting Officers	ADO R.N. Singh		
9	Name & Designation of Officers from the building side	Mr. Divakar Pandey (Owner)		
10	Year of construction	2004-05		
11	Applicant letter No.	NSPS/03/21/03/18 dated 21/03/2018		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	Old NOC requirements	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	• Road width	6 mtr	Provided	MR
	• Gate width	N/A	N/A	N/A
	• Width of internal road	N/A	N/A	N/A
2	Number, width, type & arrangement of exits			
	a. Number of Staircase			
	➤ Upper floors	Required	One	MR
	➤ Basement floor	N/A	N/A	N/A
	b. Width of Staircase			
	➤ Upper floors	Required	GF to FF - 1.50m FF to SF - 1.10 to 1.25m	MR (old case)
	➤ Basement floor	N/A	N/A	N/A
	c. Protection of exits			
	➤ Fire check door	N/A	N/A	N/A
	➤ Pressurization	N/A	N/A	N/A
	d. No. of continuous staircase to terrace	Required	One	MR
	e. Width of corridor	N/A	N/A	N/A
	f. Door size	N/A	N/A	N/A
3	Compartmentation.			
	• Fire check door.	N/A	N/A	N/A
	• Sealing of electrical shafts.	N/A	N/A	N/A
	• Fire rating of shaft door.	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire dampers.	N/A	N/A	N/A
4.	Smoke Management system.			
	• Basement	N/A	N/A	N/A
	• Upper floors	N/A	N/A	N/A
5.	Fire Extinguishers.			
	• Total numbers	Required	8 Nos	MR
	• Types	ABC / CO2	ABC-08	MR
	• ISI Marking	ISI marked	Provided	MR
6.	First Aid Hose Reels.			
	• Total numbers on each floor.	One	Provided	MR
	• Length of hose-reel hose.	30 mtr	Provided	MR
	• Nozzle Diameter	5 mm	Provided	MR

New Surya Public School, B-110/B, Thana Road, Sangam Vihar, New Delhi


7	Automatic fire detection & alarming system.			
	• Type of detectors	N/A	N/A	N/A
	• Location of Main Panel	N/A	N/A	N/A
	• Location of Repeater Panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Hooter's location	N/A	N/A	N/A
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System			
	• Basement.	N/A	N/A	N/A
	• Upper floors	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	N/A
11.	Internal Hydrants.			
	• Size of Riser/Down-comer	N/A	N/A	N/A
	• Number of Hydrant per floor	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
12.	Yard Hydrants.			
	• Total number of hydrants.	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
13.	Pumping arrangements.			
	a) Ground Level			
	➤ Discharge of main pump.	N/A	N/A	N/A
	➤ Head of main pump.	N/A	N/A	N/A
	➤ Number of main pumps.	N/A	N/A	N/A
	➤ Jockey Pump output.	N/A	N/A	N/A
	➤ Jockey Pump head.	N/A	N/A	N/A
	➤ Standby Pump output.	N/A	N/A	N/A
	➤ Standby Pump head.	N/A	N/A	N/A
	➤ Auto Starting / Manual Stopping.	N/A	N/A	N/A
	➤ Pump house access.	N/A	N/A	N/A
	b) Terrace Level			
	➤ Discharge of pump.	450 LPM	Provided	MR
	➤ Head of pump.	40 mtr	Provided	MR
	➤ Power supply.	N/A	N/A	N/A
	➤ Auto starting of pump.	Required	Provided	MR
14.	Captive water storage for Fire Fighting.			
	• Underground tank capacity.	N/A	N/A	N/A
	➤ Draw-off connection.	N/A	N/A	N/A
	➤ Fire Service Inlet.	N/A	N/A	N/A
	➤ Access to tank.	N/A	N/A	N/A
	• Overhead tank capacity.	2,500 Ltr	Provided	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	• Pressurization of lift shaft.	N/A	N/A	N/A
	• Pressurization of lift lobby.	N/A	N/A	N/A
	• Communication in lift car.	N/A	N/A	N/A
	• Fireman's switch.	N/A	N/A	N/A
	• Lift signage.	N/A	N/A	N/A
17	Standby Power Supply	N/A	N/A	N/A
18.	Refuge Area			
	• Total area	N/A	N/A	N/A
	• Location	N/A	N/A	N/A

19.	Fire Control Room.			
	• Detector System Panel.	N/A	N/A	N/A
	• Flow Switch Panel.	N/A	N/A	N/A
	• PA system Panel.	N/A	N/A	N/A
	• Battery backup	N/A	N/A	N/A
	• Building floor plan	N/A	N/A	N/A
20.	Special Fire Protection System for the Protection of special Risk, if any.	Required	ABC type fire extinguisher provided near electrical panel	MR

The Fire protection systems provided in the building were test checked at random and found functional at the time of inspection. The shortcomings communicated vide letter dated 02.05.2017 found complied.

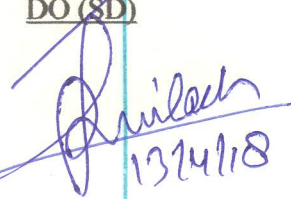
Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under DOE circular, the FSC issued vide letter No. F.6/DFS/MS/School/2014/SZ/363 dated 28-03-2014, renewal under rule 37 of the Delhi Fire Service Rules, 2010 is recommended.

Accordingly DFA is put up for approval and signature please.


 Signature of the Inspecting Officer
 Name: R.N. Singh
 Designation: ADO (BCP)

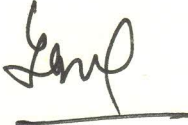
New Surya Public School, B-110/B, Thana Road, Sangam Vihar, New Delhi

DO (SD)


13/4/18






16/4

FTM.

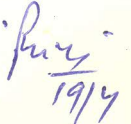

18/4.

CFO 3/4 m.scell

FT letter is put up for sign. pde.

CFO/sp

M'scell 16/20/4


19/4

1242/CFOS2
18/4/2014.