

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI- 110001

No. F.6/DFS/MS/EH/2018/SZ/ 2665

Dated: ...10/12/18

FIRE SAFETY CERTIFICATE

Certified that the Eating House in the name & style of M/s TAPPA (A Unit of Lite Bite Foods Pvt. Ltd) situated at Shop No-03, Ground Floor, Worldmark-I, Aerocity, IGI Airport, New Delhi-110037, comprised of three tiers basement, mezzanine, ground plus 06 upper floors. The restaurant running at ground floor of the building have complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and verified by the officer concerned of this department on 30/11/2018 in the presence of Mr. Sanjay (Manager) and that the premises is fit for occupancy class 'Assembly' Group-D (Restaurant) with effect from the date of issue of this certificate for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 10/12/18 at New Delhi by

W
10/12
(Vipin Kental)
Chief Fire Officer
Ph. 011-23412225

Copy to: -

1. Director, TAPPA (A Unit of Lite Bite Foods Pvt. Ltd) situated at Shop No-03, Ground Floor, Worldmark-I, Aerocity, IGI Airport, New Delhi-110037,
2. Dy. Health Officer, South M.C.D., Public Health Department, Najafgarh Zone, Dhansa Stand, Najafgarh, New Delhi-110043

Conditions for the validity of Fire Safety Certificate: -


1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life or property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of fire-fighting system.
4. The owner/ occupier shall submit a declaration every year in Form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or alteration (Clause 1.4.3 of UBBL-2016), if any.
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry.
7. This FSC will become null & void, if the FSC of the main premise is not renewed under rule 37 of DFS Rules-2010

INSPECTION REPORT

| | | | | |
|--------|---|---|--|------------------------------|
| 1 | Name & Address of the Building | M/s TAPPA (A Unit of Lite Bite Foods Pvt. Ltd) at Shop No-03, GF, World Mark-1, Aerocity, IGI Airport, New Delhi-110037 (95 Covers) | | |
| 2 | Type of Occupancy | Assembly 'Group-D' (Restaurant at Ground Floor) | | |
| 3 | Building comprised of | 03 Basements, Mezzanine, Ground + 06 floors. | | |
| 4 | Type of Case | New | | |
| 5 | Details of Previous NOC | F.6/DFS/MS/Mixed/SZ/2018/338 dated 28/02/2018 (Bldg) | | |
| 6 | Fire Safety Directives Letter No | F.6/DFS/MS/BP/2017/Hotel/368 dated 21/02/2017 (Bldg) | | |
| 7 | Date of Inspection | 30-11-2018 | | |
| 8 | Name of the Inspecting Officers | Mehmood, ADO (SJ) | | |
| 9 | Name & Designation of Officers from the building side | Mr. Sanjay (Manager) | | |
| 10 | Year of construction | 2014 | | |
| 11 | Applicant letter No. | Outdoor Diary No. 15328 Dated 22-10-2018 | | |
| S. No. | Minimum standards on Fire Prevention and Fire Safety U/R 33 | UBBL/NBC-2016 Requirements | Provided at Site | Remarks MR/NMR |
| 1 | Access to Building. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Road width Gate width Width of internal road | Restt located within Worldmark-I | As above As above As above | MR N/A N/A |
| 2 | Number, width, type & arrangement of exits | Provided & Maintained by Bldg Mgmt. | | |
| | a. Number of Staircase | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Upper floors Basement floor | -NA- -NA- | As above As above | -NA- -NA- |
| | b. Width of Staircase | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Upper floors Basement floor | N/A N/A | As above As above | -NA- -NA- |
| | c. Protection of exits | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Fire check door Pressurization | -NA- -NA- | As above As above | -NA- -NA- |
| | d. No. of continuous staircase to terrace | Required | As above | MR |
| | e. Width of corridor | -NA- | -NA- | -NA- |
| | f. Door size | 2m / 1.35m | 2m & 1.5m | MR |
| 3 | Compartmentation. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Fire check door. Sealing of electrical shafts. Fire rating of shaft door. Water curtain Fire dampers. | Required Required Required Required -NA- | As above As above As above As above As above | MR MR MR MR -NA- |
| 4 | Smoke Management system. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Basement Upper floors / Restt. | -NA- Required | As above Smoke venting provided | -NA- MR |
| 5 | Fire Extinguishers. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Total numbers Types ISI Marking | 06 Nos ABC / CO2 ISI marked | Provided ABC type Provided | MR MR MR |
| 6 | First Aid Hose Reels. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Total numbers on each floor. Length of hose-reel hose. Nozzle Diameter | One 30m 5mm | As above As above As above | MR MR MR |

M/s TAPPA at Shop No-03, GF, World Mark-1, Aerocity, IGI Airport, New Delhi


| | | Provided & Maintained by Bldg Mgmt. | | |
|----|--|---|-----------------------|------|
| 7 | Automatic fire detection & alarming system. | | | |
| | <ul style="list-style-type: none"> Type of detectors Location of Main Panel Location of Repeater Panel Alternate source of power Hooter's location | -NA- | Smoke & Heat | -NA- |
| | | -NA- | Mezzanine floor | -NA- |
| | | -NA- | FCR at GF | -NA- |
| | | -NA- | Provided | -NA- |
| | | -NA- | All area | -NA- |
| 8 | MOEFA | Required | Provided | MR |
| 9 | Public Address System | -NA- | As above | -NA- |
| 10 | Automatic Sprinkler System | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Basement Upper floors / Rest Area Sprinkler above false ceiling | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| 11 | Internal Hydrants. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Size of Riser/Down-comer Number of Hydrant per floor Hose box. | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| 12 | Yard Hydrants. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Total number of hydrants. Hose box. | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| 13 | Pumping arrangements. | Pumping arrangements are common for the complex | | |
| | <ul style="list-style-type: none"> Ground Level ➤ Discharge of main pump. ➤ Head of main pump. ➤ Number of main pumps. ➤ Jockey Pump output. ➤ Jockey Pump head. ➤ Standby Pump output. ➤ Standby Pump head. ➤ Auto Starting / Manual Stopping. ➤ Pump House Access | Provided & Maintained by Bldg Mgmt. | | |
| | | -NA- | 2280 LPM | -NA- |
| | | -NA- | 105m | -NA- |
| | | -NA- | Two | -NA- |
| | | -NA- | 2 x 180 LPM | -NA- |
| | | -NA- | 105m | -NA- |
| | | -NA- | 2280 LPM | -NA- |
| | | -NA- | 105m | -NA- |
| | | -NA- | Provided | -NA- |
| | | -NA- | Provided | -NA- |
| | <ul style="list-style-type: none"> Terrace Level ➤ Discharge of pump. ➤ Head of pump. ➤ Power supply. ➤ Auto starting of pump. | Provided & Maintained by Bldg Mgmt. | | |
| | | 450 LPM | 900 LPM | MR |
| | | 40 mtr | Provided | MR |
| | | Required | Provided | MR |
| | | Required | Provided | MR |
| 14 | Captive water storage for Fire Fighting. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Underground tank capacity. <ul style="list-style-type: none"> ➤ Draw-off connection. ➤ Fire Service Inlet. ➤ Access to tank. Overhead tank capacity. | -NA- | 1,50,000 Ltr | -NA- |
| | | -NA- | Provided | -NA- |
| | | -NA- | Provided | -NA- |
| | | -NA- | Provided | -NA- |
| | | 10,000 Ltr | 20,000 Ltr | MR |
| 15 | Exit Signage. | Required | Provided | MR |
| 16 | Provision of Lifts. | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Pressurization of lift shaft. Pressurization of lift lobby. Communication in lift car. Fireman's switch. Lift signage. | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| | | -NA- | As above | -NA- |
| 17 | Standby Power Supply | Required | Provided | MR |
| 18 | Refuge Area | Provided & Maintained by Bldg Mgmt. | | |
| | <ul style="list-style-type: none"> Total area Location | -NA- | 550 m ² | -NA- |
| | | -NA- | 6 th floor | -NA- |

| 19 | Fire Control Room. | Provided & Maintained by Bldg Mgmt. | | |
|---|--|-------------------------------------|----------|------|
| | • Detector System Panel. | -NA- | As above | -NA- |
| | • Flow Switch Panel. | -NA- | As above | -NA- |
| | • PA system Panel. | -NA- | As above | -NA- |
| | • Battery backup | -NA- | As above | -NA- |
| | • Building floor plan | -NA- | As above | -NA- |
| 20 | Special Fire Protection System for the Protection of special Risk, if any : | | | N/A |
| <p>Total Covered Area= 357.43m²/1.5= 238.29 Person</p> <p>The Fire protection systems provided in the premises were test checked at random and found functional at the time of inspection. Keeping in view of the substantial satisfactory compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, it is recommended to issue Fire Safety Certificate under rule 35 of the Delhi Fire Service Rules, 2010.</p> <p>Accordingly, DFA is put up for approval and signature please.</p> <p style="text-align: right;">  Signature of the Inspecting Officer Name: Mehmood Design: ADO (SJ) </p> | | | | |

M/s TAPPA at Shop No-03, GF, World Mark-1, Aerocity, IGI Airport, New Delhi

DO (SD)


Please mention the occupancy as marked on the approved plans.


6/12/18

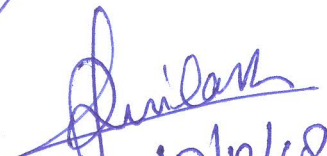

ADO (SJ)

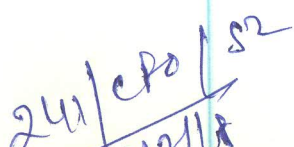
Sir the area is marked as 'Retail' in the Approved drawing as confirmed by the mall management also.


Submitted please



10/12/18
Anil (SJ)

DO (S2)


10/12/18



24/12/18
ADO (S2)


ADO (S2) / on leave


ADO (S2)

M: Scell

FTD.


10/12