

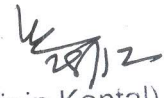
GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE  
NEW DELHI- 110001

No.F.6/DFS/MS/EH/2018/NDZI/ 2753

Dated: 28/12/18

FIRE SAFETY CERTIFICATE

Certified that the Burger King India Pvt. Ltd. running at ground floor of the building comprised of basement, ground plus three upper floors at V3S Mall Laxmi Nagar, Delhi-92, owned/occupied by Burger King India Pvt. Ltd. have complied with the fire prevention and fire safety requirements in accordance with the NBC Part-IV and verified by the officer concerned of this department on 24/12/18 in the presence of Mr. Sunil Kumar and found that the **assembly** building is fit for occupancy 'Class D "Assembly Building"(Restaurant) ' for with effect from ..28.12.18... for a period of **three** years in accordance with the rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010, printed overleaf  
Issued on.....28.12.18.....at New Delhi by

  
(Vipin Kental)  
Chief Fire Officer  
9/12/18

To,

M/s Burger King India Pvt. Ltd,  
Ground Floor V3S Mall Laxmi Nagar, Delhi-92,

Copy to:-

The Dy. Health Officer,  
EDMC, Health Department, Shahdara( South) Zone,  
Karkardooma, Shahdara, Delhi.

### INSPECTION REPORT

1. Name & address of the building : Burger King India Pvt. Ltd., Ground Floor V3S Mall Laxmi Nagar, Delhi-92.
2. Building is comprised of : Burger King running at Ground floor building is comprised of Basement, ground plus three upper floors
3. Type of Occupancy : Assembly
4. Type of Case : New
5. Details of Previous NOC : F6/DFS/MS/2016/NDZ/1762 Dated 07/12/16 (for entire Mall)
6. Fire Safety direction letter No : Nil
7. Date of Inspection : 24/12/18
8. Name of the Inspecting Officers: : R.K.Yadav (ADO)
9. Name of the designation of Officer from the building side : Sh. Suresh
10. Year of Construction : 2006
11. Applicant's letter No : Nil dated 30/11/18

S.No	Minimum Standards on fire safety requirements	Requirement	Provided Site	at	Remarks MR/NMR
1	Access to building for entire Mall				
	Road width	12 m	36 m & 13.8 m		MR
	Gate width	4.5 m	06 m		MR
	Width of internal road	06 m	06 m		MR
2	Number, Width, Type and Arrangement of Exits. for entire Mall				
	a. Number of Staircases				
	Upper Floor	02 Nos.	06 Nos.		MR
	Basement	02 Nos.	3 Nos+1 ramp		MR
	B. Width of Staircases				
	Upper Floor	N.A.	N.A.		N.A.
	Basement	N.A.	N.A.		N.A.
	c. Protection of exits				
	Fire check door	Required	Provided		MR
	Pressurization	Required	Provided		MR
	e. No. of continuous staircases to terrace	1no.	1 no.		MR
g. Width of Corridor	2.0	2.0		MR	
h. No. of door	2 no.	2 no.		MR	
i. Door Size	2 m	2 m each		MR	
3	Compartmentation. for entire Mall				
	Fire check door	Required	Provided		MR
	Sealing of electrical shafts	Required	Provided		MR
	Fire rating of shaft door	Required	Provided		MR
	Water curtain	N.A.	N.A.		N.A.
	Fire Dampers	N.A.	N.A.		N.A.
4	Smoke Management System. for entire Mall				
	Basement	Required	Provided		MR
	Upper floor	Required	Provided		MR




5.	Fire Extinguisher for entire Mall			MR
	Total numbers types ISI marking	20 no.	39 no.	MR
		ABC & CO <sub>2</sub>	ABC & CO <sub>2</sub>	MR
		ISI marked	ISI marked	MR
6	First-aid-Hose Reels. for entire Mall			MR
	Total numbers of each floor	02 no.	02 no.	MR
		30 m	30 m	MR
Length of hose reel hose Nozzle diameter	5 mm	5 mm	MR	
7	Automatic fire detection and alarming system. for entire Mall			
	Type of detectors	Heat & Smoke	Provided	MR
	Location of main panel	Control Room	Basement	MR
	Location of repeater panel	Security Room	Provided	MR
	Alternate source of power	Battery & DG Set	Provided	MR
	Hooters	Staircase	Provided	MR
8	MOEFA	Required	Provided	MR
9	Public address System.	Required	Provided	MR
10	Automatic Sprinkler System.			
	Basement upper floor sprinkler above false ceiling	Required	Provided	MR
		Required	Provided	MR
Required		Provided	MR	
11	Internal Hydrants for entire Mall			
	size of riser/down-comer	150 mm	150 mm	MR
		2 no.	2 no.	MR
Number of hydrants each floor Hose box each floor	2 no.	2 no.	MR	
12	Yard Hydrants. for entire Mall			
	Total number of hydrants Hose Box	5 no.	5 no.	MR
		5 no.	5 no.	MR
13	Pumping Arrangements. for entire Mall			
	<ul style="list-style-type: none"> <li>• Ground Level</li> <li>• Discharge of main Pump</li> <li>• Head of Main Pump</li> <li>• Number of main pumps</li> <li>• Jockey pump out put</li> <li>• Jockey pump head</li> <li>• Standby pump out put</li> <li>• Standby pump Head</li> <li>• Auto Starting /Manual stopping</li> <li>• Pump House Access</li> <li>• Terrace Level</li> <li>• Discharge of pump</li> <li>• Head of the Pump</li> <li>• Power supply</li> <li>• Auto Starting of pump</li> </ul>	Required	Provided	MR
		2850 LPM	2850 LPM	MR
		70 M	70 M	MR
		1No.	1No.	MR
		180 LPM	180 LPM	MR
		70 M	70 M	MR
		2850 LPM	2850 LPM	MR
		70 M	70 M	MR
		Required	Auto	MR
		Required	Provided	MR
		450 LPM	450 LPM	MR
		40 M	40 M	MR
Required	Provided	MR		
Required	Provided	MR		

14	Captive Water Storage for Fire Fighting. for entire Mall			
	Underground tank capacity	1,00,000 ltrs	1,20,000 ltrs	MR
	Draw-off connection	Required	Provided	MR
	Fire service inlet	Required	Provided	MR
	Access to tank	Required	Provided	MR
	Overhead Tank capacity	20,000 Liters	40,000 Liters	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of Lifts. for entire Mall			
	Pressurization of Lift Shaft	Required	Provided	MR
	Pressurization of Lift lobby	Required	Provided	MR
	Communication in lift car	Required	Provided	MR
	Firemen's grounding switch	Required	Provided	MR
	Lift Signage	Required	Provided	MR
17	Standby power supply	Required	Provided	MR
18	Refuge Area.			
	Total area	N.A.	N.A.	N.A.
	Location	N.A.	N.A.	N.A.
19	Fire Control Room for entire Mall			
	Detector system panel	Required	Provided	MR
	Flow switch panel	Required	Provided	MR
	PA system panel	Required	Provided	MR
	Batter backup	Required	Provided	MR
	Building Floor Plans	Required	Provided	MR
20	Special Fire Protection systems for protection of special Risks, if any:	Required	Provided in all LT & HT Panels	MR

The fire protection systems provided in the building were tested/checked and found functional at the time of inspection. FSC was issued V3S Mall vide letter no. F6/DFS/MS/NDZ/1762 Dated 07/12/16.

Keeping in view the compliance of the minimum standards on fire prevention and fire safety required under the rules it is recommended to grant Fire Safety Certificate under rule 35 of the Delhi Fire Service Rule 2010. (Total area is 180 sq. meter and total 100 persons may be accommodated).

  
 Signature of the Inspecting Officer  
 Name :- R. K. Yadav  
 Designation :- ADO (LN)

DO (ED) on leave  
 Dy CEO (M2)

  
 26/12

CFD

M-scell

FTM  
 27/12