

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CANNAUGHT PLACE
NEW DELHI- 110 001

No. F6/DFS/MS/2019/NDZ/ 2507

Dated: 12/12/19

FIRE SAFETY CERTIFICATE

Certified that the Shree Laxmi Narayan Sewa Ashram Trust (Regd.) Mandawali Fazalpur (Near Balco Society Mkt.) Delhi-92, owned/occupied by Shree Laxmi Narayan Sewa Ashram Trust Comprised of Basement, ground plus two upper floors was issued FSC for ground plus first floor vide letter no. F6/DFS/MS/2016/1467 Dated 03/10/2016. The building have deemed complied with the fire prevention and fire safety requirements in accordance with rules 33 of the Delhi Fire Service Rules, 2010 and verified by the officer concerned of Fire Service on 09/10/19 & 11/11/19 in the presence of Mr. R.S. Negi (Manager) of the Community Hall and that the building is fit for occupancy class "D" 'Assembly Building' at G.F & F.F with effect from 12/12/19. For a period of **three** years, subject of conditions printed overleaf.

Issued on 12/12/19 at New Delhi by


(Vipin Kental)
Chief Fire Officer
Delhi Fire Service

To,

Manager,
Shree Laxmi Narayan Sewa Ashram Trust (Regd.),
Mandawali Fazalpur (Near Balco Society Mkt.) Delhi..

Copy to:-

1. The Deputy Health Officer (EDMC),
SHD (N)-Zone, Health Department,
Delhi-110032

INSPECTION REPORT

1. Name & address of the building : Shree Laxmi Narayan Sewa Ashram Trust (Regd.)
Mandawali Fazalpur (Near Balco Society Mkt.) Delhi.
2. Building is comprised of : B+G+2 Upper floors
3. Type of Occupancy : Assembly (Banquet Hall) *at G.F+FF. (15)*
4. Type of Case : New Case
5. Details of Previous NOC : F6/DFS/MS/2016/1467 dated 03/10/2016
6. Fire Safety direction letter No : F6/DFS/MS/BP/2004/72 Dated-12/01/04
7. Date of Inspection : 09/10/19 & 11/11/19
8. Name of the Inspecting Officers: : R.K.Yadav (ADO)
9. Name of the designation of Officer
from the building side : R.S.Negi (Manager)
10. Year of Construction : 2004
11. Applicant's letter No : Nil dated 06/09/19

S.No	Minimum Standards on fire prevention and fire safety U/R33	Requirement /NBC	Provided at Site	Remarks MR/NMR
1	Access to building			
	Road width	6 m	18 m	MR
	Gate width	4.5 m	4.5 m	MR
	Width of internal road	N.A.	N.A.	N.A.
2	Number, Width, Type and Arrangement of Exits			
	a. Number of Staircases			
	Upper Floor	2 no.	2 no.	MR
	Basement	2 no.	2 no.	MR
	b. Width of Staircases			
	Upper Floor	1.5 m	1.5 m each	MR
	Basement	1.5 m	1.5 m each	MR
	c. Protection of exits			
	Fire check door	Required	provided	MR
	Pressurization	Required	provided	MR
	e. No. of continuous staircases to terrace	2 no.	2 no.	MR
	g. Width of Corridor	N.A.	N.A.	N.A.
	h. No. of door	2 no.	2 no.	MR
	i. Door Size	2 m	<i>at</i> 2 m, 1.10m & 1.60 m	MR
3	Compartmentation.			
	Fire check door	Required	provided	MR
	Sealing of electrical shafts	Required	Provided	MR
	Fire rating of shaft door	N.A.	N.A.	N.A.
	Water curtain	N.A.	N.A.	N.A.
	Fire Dampers	N.A.	N.A.	N.A.
4	Smoke Management System.			
	Basement	Ventilated	provided	MR
	Upper floor	Ventilated	Ventilated	MR
5	Fire Extinguisher			
	Total numbers	10 no.	provided	MR
	types	CO ₂ & ABC	provided	MR
	IS marking	ISI marked	provided	MR

Conditions for the validity of Fire Safety Certificate

1. All the means of escape/entry/exit shall be kept unlocked & free from any obstruction.
2. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
3. All the fire fighting equipments shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
4. The clarification with regards electrical installation, ventilation, structure stability set back areas, occupancy and constructional deviation in building etc .may be got verified from the authorities concerned.
5. This Fire Safety certificate cannot be treated in any case for regularizations of unauthorized construction or Alteration if any.
6. All comments/ directions of the Licensing Department shall always be permitted and followed.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in

N/10

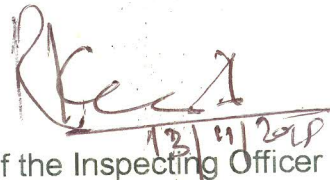
6	First-aid-Hose Reels.			
	Total numbers of each floor	1 no.	Provided	MR
	Length of hose reel hose	30 m	Provided	MR
	Nozzle diameter	5 mm	Provided	MR
7	Automatic fire detection and alarming system.			
	Type of detectors	Required	Provided	MR
	Location of main panel	Required	Provided	MR
	Location of repeater panel	Required	Provided	MR
	Alternate source of power	Required	Provided	MR
	Hooters's location	Required	Provided	MR
8	MOEFA	Required	provided	MR
9	Public address System.	N.A.	N.A.	N.A.
10	Automatic Sprinkler System.			
	Basement	Required	Provided	MR
	upper floor	Required	provided	MR
	sprinkler above false ceiling	Required	provided	MR
11	Internal Hydrants			
	size of riser/down-comer	100 mm	Provided	MR
	Total no. of hydrants each floor	1 no.	Provided	MR
	Hose Box per floor	1 no.	Provided	MR
12	Yard Hydrants.			
	Total number of hydrants	Required	provided	MR
	Hose Box	Required	provided	MR
13	Pumping Arrangements. As per directives			
	<ul style="list-style-type: none"> Ground Level ➤ Discharge of main Pump ➤ Head of Main Pump ➤ Number of main pumps ➤ Jockey pump out put ➤ Jockey pump head ➤ Standby pump out put ➤ Standby pump Head ➤ Auto Starting /Manual stopping ➤ Pump House Access Terrace Level ➤ Discharge of pump ➤ Head of the Pump ➤ Power supply ➤ Auto Starting of pump 			
		900 Lpm	900 Lpm	MR
		40 M	40 M	MR
		1 No.	1 No.	MR
		180 Lpm	180 Lpm	MR
		40 M	40 M	MR
		900 Lpm	900 Lpm	MR
		40 M	40 M	MR
		Required	Manual	MR
		N.A.	N.A.	N.A.
		900 LPM	900 LPM	MR
		40 m	40 m	MR
		Required	Provided	MR
		Required	provided	MR
14	Captive Water Storage for Fire Fighting.			
	Underground tank capacity	50,000 Liters	Provided	MR
	Draw-off connection	Required	Provided	MR
	Fire service inlet	Required	provided	MR
	Access to tank	Required	provided	MR
	Overhead Tank capacity	10,000 Liters	Provided	MR
15	Exit Signage.	Required	Provided	MR

N/A

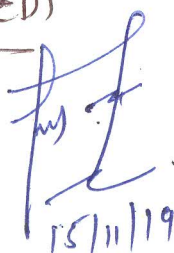
16	Provision of Lifts.			
	Pressurization of Lift Shaft	Required	Provided	MR
	Pressurization of Lift lobby	Required	provided	MR
	Communication in lift car	Required	Provided	MR
	Firemen's grounding switch	Required	provided	MR
	Lift Signage	Required	Provided	MR
17	Standby power supply	Required	Provided	MR
18	Refuge Area.			
	Total area	N.A.	N.A.	N.A.
	Location	N.A.	N.A.	N.A.
19	Fire Control Room			
	Detector system panel	N.A.	N.A.	N.A.
	Flow switch panel	N.A.	N.A.	N.A.
	PA system panel	N.A.	N.A.	N.A.
	Batter backup	N.A.	N.A.	N.A.
	Building Floor Plans	N.A.	N.A.	N.A.
20	Special Fire Protection systems for protection of special Risks, if any:	N.A.	N.A.	N.A.

The fire protection systems provided in the building were tested/ checked and found functional at the time of inspection.

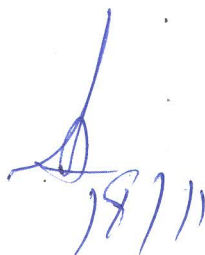
In view of the deemed compliance of the minimum standards on fire prevention and fire safety required under the rules. The FSC was issued vide letter no.F6/DFS/MS/2016/1467 Dated 03/10/2016 renew under the rule 35 of the Delhi Fire Service Rule 2010 is recommended.


 Signature of the Inspecting Officer
 Name- R.K. Yadav
 Designation- ADO (LN)

DO (ED)


 15/11/19

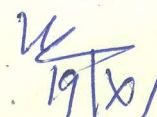
(Dy. cfo/NPZ)


 18/11

C.F.O

DeFONDZ

Pl speak


 19/11/19