

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE
NEW DELHI- 110001

No. F6/DFS/MS/BNQT/2020/NDZ/ 341

Dated: 02/09/2020

FIRE SAFETY CERTIFICATE

Certified that the **Tru Hallmark Banquets** Hall running at ground, first & second floor at Commercial Area Karkardooma Metro Station, Pkg.-A, Delhi, owned/occupied by M/s Tru Hallmark Banquets Pvt.Ltd , comprised of basement, ground plus three upper floors was granted fire safety certificate vide letter no. F6/DFS/MS/BNQT/2017/NDZ/280 dated 25/08/17. The Banquets hall building was inspected by the officer concerned of this department on 31/08/2020 in the presence of **Sh.Vinod Arora** and found that the banquets hall building have deemed complied with the fire prevention and fire safety requirements in accordance with the rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and that the building is fit for occupancy Group D "Assembly Building" with effect from 02/09/2020 for a period of **three years**, subject to conditions printed overleaf.
Issued on 02/09/2020 at New Delhi by



(Sunil Chawdhary)
Dy.Chief Fire Officer
Delhi Fire Service

To,

M/s Tru Hallmark Banquets Pvt.Ltd
Commercial Area Karkardooma Metro Station,
Pkg. -A, Delhi,

CONDITIONS:

1. All the means of escape shall be kept free of all type of obstruction all the time.
2. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
3. All the fire fighting equipments shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
4. The clarification with regards electrical installation,ventilation,structure stability set back areas, occupancy and constructional deviation in building etc .may be got verified from the authorities concerned.
5. This Fire Safety certificate can not be treated in any case for regularizations of unauthorized if any.
6. All comments/ directions of the Licensing Department shall always be permitted and followed.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in

Extra

N/17

1. Name & address of the building : Tru Hallmark Banquets at GF,FF& Second floor Commercial Area Karkardooma Metro Station,Pkg-A, Delhi.
2. Building is comprised of : Basement,Ground plus two upper floors
3. Type of Occupancy : Assembly(Banquet Hall)
4. Type of Case : Renewal
5. Details of Previous FSC : F6/DFS/MS/BNQT/2017/NDZ/280 dt 25/08/17
6. Fire Safety direction letter No : F6/DFS/MS/BP/2011/82390Dated-30/09/11
7. Date of Inspection : 31/08/2020
8. Name of the Inspecting Officers: DO F.Brown & ADO R.K.Yadav
9. Name of the designation of Officer from the building side : Mr. Vinod Arora (Owner)
10. Year of Construction : 2011
11. Applicant's letter No : Nil Dated 25/08/2020

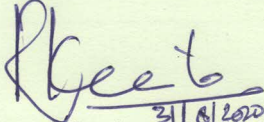
Sr. no.	Minimum Standards on fire prevention and fire safety U/R33	Requirement	Provided at Site	Remarks MR/NMR
1	Access to building			
	Road width	06 m	08 m	MR
	Gate width	4.5 m	4.5 m	MR
	Width of internal road	06 m	06 m	MR
2	Number, Width, Type and Arrangement of Exits			
	a. Number of Staircases			
	Upper Floor	2 nos.	4 nos.	MR
	Basement	N/A	N/A	N/A
	b. Width of Staircases			
	Upper Floor	1.5 m	1 no of 2 m, 2 no of 1.5 m & 1 no of 1.20m	MR
	Basement	N/A	N/A	N/A
	c. Protection of exits			
	Fire check door	Required	Provided	MR
	Pressurization	N/A	N/A	N/A
	e. No. of continuous staircases to terrace	N/A	N/A	N/A
g. Width of Corridor	N/A	N/A	N/A	
h. Door Size	2 m	2 m	MR	
3	Compartmentation.			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire rating of shaft door	Required	Provided	MR
	• Water curtain	N/A	N/A	N/A
	• Fire Dampers	Required	Provided	MR
4	Smoke Management System.			
	• Basement	30a/c per hour	N/A	N/A
	• Upper floor	12a/c per hour	Ventilated	MR

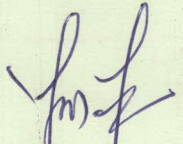
5.	Fire Extinguisher			
	• Total numbers	24 nos.	30 Nos.	MR
	• Types	CO ₂ + ABC	Provided	MR
	• ISI marking	ISI marked	Provided	MR
6	First-aid-Hose Reels.			
	Total numbers of each floor	03 no.	Provided	MR
	Length of hose reel hose	30 m	Provided	MR
	Nozzle diameter	5 mm	Provided	MR
7	Automatic fire detection and alarming system.			
	Type of detectors	Heat & Smoke	Provided	MR
	Location of main panel	Ground floor	Provided	MR
	Location of repeater panel	Required	Provided	MR
	Alternate source of power	Battery & DG Set	Provided	MR
	Hooter's location	Staircase& hall	Provided	MR
8	MOEFA	Required	Provided	MR
9	Public address System.	Required	Provided	MR
10	Automatic Sprinkler System.			
	basement	N/A	N/A	N/A
	upper floor	Required	Provided	MR
	sprinkler above false ceiling	N/A	N/A	N/A
11	Internal Hydrants			
	size of riser/down-comer	100 mm	Provided	MR
	Number of hydrants per floor	3 no.	Provided	MR
	Hose Box	3 no.	Provided	MR
12	Yard Hydrants.			
	Total number of hydrants	2 nos.	3 no.	MR
	Hose Box	2 nos.	3 no.	MR
13	Pumping Arrangements. Under DMRC Control			
	• Ground Level			
	➤ Discharge of main Pump	2850 LPM	2850 LPM	MR
	➤ Head of Main Pump	70 m	80 m	MR
	➤ Number of main pumps	2 Nos	2 Nos	MR
	➤ Jockey pump out put	1 no 180 LPM	1 no 180 LPM	MR
	➤ Jockey pump head	70 m	80 m	MR
	➤ Standby pump out put	2850 LPM	2850 LPM	MR
	➤ Standby pump Head	70 m	80 m	MR
	➤ Auto Starting /Manual stopping	Required	Provided	MR
	➤ Pump House Access	Required	Provided	MR
	• Terrace Level			
	➤ Discharge of pump	N/A	N/A	N/A
	➤ Head of the Pump	N/A	N/A	N/A
	➤ Power supply	N/A	N/A	N/A
	➤ Auto Starting of pump	N/A	N/A	N/A

14	Captive Water Storage for Fire Fighting.	Under DMRC Control		
	Underground tank capacity	1,00,000 ltrs	2,00,000 ltrs	MR
	Draw-off connection	Required	Provided	MR
	Fire service inlet	Required	Provided	MR
	Access to tank	Required	Provided	MR
	Overhead Tank capacity	20,000 Liters	Provided	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of Lifts.			
	Pressurization of Lift Shaft	N/A	N/A	N/A
	Pressurization of Lift lobby	N/A	N/A	N/A
	Communication in lift car	Required	Provided	MR
	Firemen's grounding switch	Required	Provided	MR
	Lift Signage	Required	Provided	MR
17	Standby power supply	Required	Provided	MR
18	Refuge Area.			
	Total area	N/A	N/A	N/A
	Location	N/A	N/A	N/A
19	Fire Control Room	Provided for Metro Station		
	Detector system panel	N/A	N/A	N/A
	Flow switch panel	N/A	N/A	N/A
	PA system panel	N/A	N/A	N/A
	Batter backup	N/A	N/A	N/A
	Building Floor Plans	N/A	N/A	N/A
20	Special Fire Protection systems for protection of special Risks, if any:	Required for HT/LT Panels	Provided	MR

The fire protection systems provided in the building were tested/checked and found functional at the time of inspection.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules. The fire safety certificate issued vide letter no. F6/DFS/MS/BNQT/2017/NDZ/280 dt 25/08/17 renewal under rule 35 of the Delhi Fire Service Rules 2010 is recommended.


 Signature of the Inspecting Officer
 Name :-R.K.Yadav
 Designation :-ADO(LN)

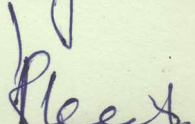

 Signature of the Inspecting Officer
 Name :-F. Brown
 Designation :-DO(East)

Dr. Chandra
 F. t. please

A D D 2 N

F T holder is put sep for signature pt

Dr. Chandra


 24/9/2020