

FORM 'H': FORM FOR ISSUING FIRE SAFETY CERTIFICATE
[See sub-rule (1) of rule 35]
GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001

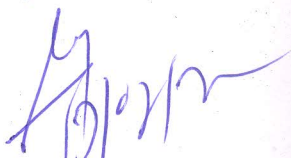
No. F6/DFS/MS/EH/2021/SZ/ 37

Dated: 19/2/2021

FIRE SAFETY CERTIFICATE

Certified that the M/s White Delhi (A Unit of Newera Feast and Hospitality Private Limited), 50-B, Hotel Samrat, Chanakya Puri, New Delhi-110021, building comprised of Small Basement, Lower Ground, Upper Ground and Six Upper Floors, **restaurant is running at Lower Ground Floor only** owned / occupied by A Unit of Newera Feast and Hospitality Private Limited, have complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rule, 2010 and verified by the officer concerned of this department on 12/02/2021 in the presence of Sh. Nitin (Manager) and found that the building / premises is fit for the occupancy class "Assembly" (Group-D) / **Eating House** with effect from 19/2/21... for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 19/2/21 at New Delhi by.


(ATUL GARG)
DIRECTOR

Copy to :-

1. Joint Commissioner, Licensing Unit, 1st Floor, Police Station, Defence Colony, New Delhi-110024.
2. Authorized Signatory, M/s White Delhi (A Unit of Newera Feast and Hospitality Private Limited), 50-B, Hotel Samrat, Chanakya Puri, New Delhi-110021.

Conditions for the validity of Fire Safety Certificate:

1. All the fire safety arrangement provided their in shall be maintained in good working conditions at all times.
2. Loss of life or property due to non functional fire safety measure shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. Any deviation with regard to the construction etc shall be verified by the concerned building sanctioning agency.
5. This certificate cannot be treated in any case for regularizations of unauthorized construction.
6. "The owner / Occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule37] along with a copy of this Certificate, six months prior to its expiry".
7. The owner / occupier shall submit a declaration every year in form "K" provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on WWW.dfs.Delhigovt.nic.in

INSPECTION REPORT

Covered area of the restaurant is 494.5m² and as per NBC (Part-IV) the no. of occupants comes out to be Approx. 275 (494.5/1.8=274.72). Thus capacity of restaurant is 275 persons which is covered under DFS Act 2007, Rules 2010. Subsequently inspection of Eating House is carried out as per NBC (Part-IV).

1. Name & address of the building: **M/s White Delhi (A UNIT OF NEWERA FEAST AND HOSPITALITY PRIVATE LIMITED), 50-B, Hotel Samrat, Chanakya Puri, New Delhi-21.**
2. Type of Occupancy : **Assembly (Group-D) (Eating House) (Small Basement, Lower Ground, Upper Ground and Six Upper Floors). (But restaurant is running at Lower Ground Floor only)**
3. Type of Case : **New**
4. Details of previous NOC : **Nil (FSC issued to the Hotel Samrat-F6/DFS/MS/Hotel/2020/SZ/39 dated 15/01/2020)**
5. Fire Safety directives Letter No. : **Nil**
6. Date of inspection : **12/02/2021**
7. Name of the Inspecting Officer : **A.D.O. (S.J.)**
8. Name and designation of Officer from the building side : **Sh. Nitin (Manager)**
9. Year of Construction : **1982**
10. Applicant's letter : **MHA Id-2021020810260 dated 09/02/2021**

S No	Minimum standards on fire prevention and fire safety U/R 33	Requirements	Provided at site	Remarks MR/NMR
1.	Access of building			
	• Road width	9m	15m	MR
	• Gate width	5m	6m	MR
	• Width of internal road	6m	Provided	MR
2.	Number, width, Type & Arrangements of exits			
	a. Number of staircases			
	• Upper floors	NA	NA	NA
	• Basements	NA	NA	NA
	b. Width of staircases			
	• Upper floors	NA	NA	NA
	• Basements	NA	NA	NA
	c. Protection of exits			
	• Fire check door	Required	Provided	MR
	• Pressurization	NA	NA	NA
	d. No of continuous staircase to terrace	Required	2	NA
	e. Width Of Corridor	NA	NA	NA
	f. Door Size	2m & 1.5m	Provided	MR
3.	Compartmentation			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire Rating of shaft door	NA	NA	NA
	• Water Curtain	NA	NA	NA
	• Fire Dampers	NA	NA	NA
4.	Smoke managements System			
	• Basements	30 a/c per hour	NA	NA
	• Upper floors	12 a/c per hour	NA	NA
5.	Fire Extinguishers			
	• Total numbers	2	4	M/R
	• Types	ABC, CO ₂ & WCO ₂	ABC, CO ₂ , Water CO ₂	M/R
	• ISI	Required	Provided	M/R

	• Total numbers on each floor	4	4	MR
	• Length of hose reel hose	30 Mtr.	30 Mtr.	MR
	• Nozzle diameter	5 mm	5 mm	MR
7.	Automatic fire detection and alarming system (Fire Fighting System is common for entire Hotel building)			
	• Type of detector	NA	NA	NA
	• Location of Main Panel	NA	NA	NA
	• Location of Repeater Panel	NA	NA	NA
	• Alternate source of power	Required	Provided	MR
	• Hooters' Location	Required	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System (Fire Fighting System is common for entire Hotel building)			
	• Basements	NA	NA	NA
	• Upper Floor	NA	NA	NA
	• Sprinkler above false ceiling	NA	NA	NA
11.	Internal Hydrants (Fire Fighting System is common for entire Hotel building)			
	• Size of riser/down-comer	150mm	150mm	MR
	• Number of hydrants per floor	4	4	MR
	• Hose Box	4	4	MR
12.	Yard Hydrants (Fire Fighting System is common for entire Hotel building)			
	• Total number of hydrants	NA	10	NA
	• Hose Box	NA	10	NA
13.	Pumping Arrangements (Fire Fighting System is common for entire Hotel building)			
	• Ground Level			
	➤ Discharge of main pump	NA	2850 LPM	NA
	➤ Head of main pump	NA	105 M	NA
	➤ Number of main pumps	NA	2	NA
	➤ Jockey pump out put	NA	280 LPM	NA
	➤ Jockey pump head	NA	105m	NA
	➤ Standby Pump out put	NA	2850 LPM	NA
	➤ Standby Pump Head	NA	105m	NA
	➤ Auto Staring/Manual stopping	NA	Provided	NA
	➤ Pump House Access	NA	Provided	NA
	• Terrace level			
	➤ Discharge of pump	450 LPM	450 LPM	MR
	➤ Head of the pump	40MH	40MH	MR
	➤ Power supply	Required	Provided	MR
	➤ Auto starting of pump	Required	Provided	MR
14.	Captive water Storage for fire fighting (Fire Fighting System is common for entire Hotel building)			
	• Underground tank capacity	NA	2,50,000 ltr	NA
	➤ Draw of connection	NA	Provided	NA
	➤ Fire service inlet	NA	Provided	NA
	➤ Access to tank			NA

15	Exit Signage	Required	Provided	MR
16.	Provision of Lifts			
	➤ Pressurization of Lift Shaft	N/A	N/A	N/A
	➤ Pressurization of lift lobby	N/A	N/A	N/A
	➤ Communication in lift Car	Required	Provided	MR
	➤ Fireman's Grounding Switch	Required	Provided	MR
	➤ Lift Signage	Required	Provided	MR
17.	Standby power supply	Required	DG Set Provided	MR
18.	Refuge Area			
	➤ Total area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A
19.	Fire control room (Fire Fighting System is common for entire Hotel building)			
	➤ Detector system panel	Required	Provided	MR
	➤ Flow Switch Panel	N/A	N/A	N/A
	➤ PA System Panel	Required	Provided	MR
	➤ Battery backup	Required	Provided	MR
	➤ Building Floor Plans	N/A	Provided	N/A
20.	Special Fire Protection Systems for Protection of special Risks, if any;	CO ₂ & ABC Type Fire Extinguishers Provided near Electric Panel=MR		

The fire protection systems provided in the building were tested, checked and found functional at the time of inspection.

Keeping in view of the substantial compliance of the minimum standards of fire prevention and fire safety required under the rules it is recommended to grant Fire Safety Certificate under rule 35 of the Delhi Fire Service Rules 2010 is recommended.

DO (SD) on MR

Dy CFO (SZ)

[Handwritten signature]

C.F.O. (on day off)

Director for *[Handwritten signature]*

[Handwritten signature]
16/02/2021

Signature of the Inspecting Officer
Name : A.K. Jaiswal
Designation : A.D.O. (S.J.)

ATP/