

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE**  
**NEW DELHI**

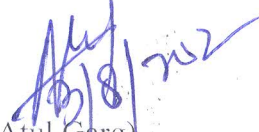
No. F6/DFS/MS/WZ/2021/ 577

Dated: 03/08/2021

**FIRE SAFETY CERTIFICATE**

Certified that the **HRM Global School Located at PU-Block, Pitampura, New Delhi-110034** comprised of Basement, Ground + 03 Upper Floors owned/ occupied by **Gulshan Educational Society** have complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rule, 2010 and verified by the officers concerned of Fire Service on 22.07.2021 in the presence of Sh. Rahul Mangla (Chairman), Sh. S.K. Chauhan A.E & Sh. Sumit Dalal J.E (MCD) and that the said building is fit for occupancy class " Educational Buidling Group B with effect from 03/08/2021 for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010, printed overleaf.

Issued on .. 03/08/2021 at New Delhi by.

  
(Atul Garg)  
Director

Copy to:-

1. The Director, Directorate of Education, GNCT of Delhi, Old Secretariat Delhi – 110054
2. The Executive Engineer (Bldg.), HQ, North Delhi Muincipal corporation, 8<sup>th</sup> floor, Civil Centre, JLN Marg, New Delhi.
3. Sh. Hari Parkesh Mangla (President) Gulshan Educational Society, PU-Block, Pitampura, New Delhi-110034.

## CONDITIONS

1. All the means of escape shall be kept free of all type of obstruction all the time. It should not bolted /locked.
2. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
3. All the fire fighting equipments shall be maintained in perfect working condition all the time and any loss of life any property due to the non-functional of any fire safety measures, management shall be held responsible.
4. Any deviation, with regards to construction, ventilation, occupation, electric installation etc. may be got verified from the concerned authorities.
5. The Fire Safety Certificate may not be treated in any case for regularizations of unauthorized construction / unauthorized use of land if any.
6. All comments / directions of licensing Department shall always be permitted and followed.
7. The owner /occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in)
8. The owner / occupier shall apply for renewal of this **Fire Safety Certificate to the Director in 'Form J' (sub Rule (1) of Rule 37)** along with copy of the certificate, six months prior to its expiry.
9. The Basement shall be used as per BBL.

INSPECTION REPORT

176

1. Name & address of the building: **HRM Global School (Gulshan Educational Society)**  
**Located at PU-Block, Pitampura, New Delhi-110034.**
2. Type of Occupancy : Educational (Basement + Ground + 03 Upper Floors)
3. Type of Case : New
4. Details of previous NOC: Nil
5. Fire Safety directives Letter No. : F6/DFS/MS/BP/2019/205 dated 29.05.2019
6. Date of inspection : 22.07.2021
7. Name of the Inspecting Officer : M.K. Chattopadhyay, DO (West) &  
S.P. Bhardwaj ADO (WP)
8. Name and designation of Officer  
from the building side: Sh. Rahul Mangla (Chairman), Sh. S.K. Chauhan, A.E &  
Sh. Sumit Dalal, J.E (MCD)
9. Year of Construction : 2019-20
10. Applicant's letter No. : Online dated 15.07.2021

S No	Minimum standards on fire prevention and fire safety U/R 33	NBC/UBBL Requirements/Guideline letter dated 29.05.2019	Provided at site	Remarks MR/NMR
1.	Access of building			
	• Road width	06 m	Provided	MR
	• Gate width	4.5 m	Provided	MR
	• Width of internal road	Required	Provided	MR
2.	Number, width, Type & Arrangements of exits			
	a. Number of staircases			
	• Upper floors	04	Provided	MR
	• Basements	04 & 01 Ramp	Provided	MR
	b. Width of staircases			
	• Upper floors	1.5 m	2 X 1.70 m & 2 X 1.50m	MR
	• Basements	1.5 m	1.70-1.98, 1.70, 1.55 & 1.54 m	MR
	c. Protection of exits			
	• Fire check door	Required	Provided	MR
	• Pressurization	NA	NA	NA
	d. No of continuous staircase to terrace	04	Provided	MR
	e. Width Of Corridor	1.5 m	Provided	MR
	f. Door Size	1.20 m	Provided (02 each classroom)	MR
3.	Compartmentation			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire Rating of shaft door	NA	NA	NA
	• Water Curtain	NA	NA	NA
	• Fire Dampers	NA	NA	NA
4.	Smoke managements System			
	• Basements	30 a/c per hour	Provided	MR
	• Upper floors	12 a/c per hour	Natural Ventilation	MR

*(Signature)*

177

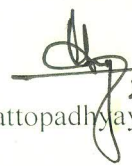
5.	Fire Extinguishers			
	<ul style="list-style-type: none"> <li>Total numbers</li> <li>Types</li> <li>IS marking</li> </ul>	36 nos. ABC & CO <sub>2</sub> ISI marked	Provided Provided Provided	MR MR MR
6.	First – Aid Hose Reels			
	<ul style="list-style-type: none"> <li>Total numbers on each floor</li> <li>Length of hose reel hose</li> <li>Nozzle diameter</li> </ul>	04 30m 5mm	Provided Provided Provided	MR MR MR
7.	Automatic fire detection and alarming system			
	<ul style="list-style-type: none"> <li>Type of detectors</li> <li>Location of Main Panel</li> <li>Location of Repeater Panel</li> <li>Alternate source of power</li> <li>Hooters' Location</li> </ul>	NA NA NA NA NA	NA NA NA NA NA	NA NA NA NA NA
8.	MOEFA	NA	NA	NA
9.	Public Address System	NA	NA	NA
10.	Automatic Sprinkler System			
	<ul style="list-style-type: none"> <li>Basements</li> <li>Upper Floor</li> <li>Sprinkler above false ceiling</li> </ul>	Required NA NA	Provided NA NA	MR NA NA
11.	Internal Hydrants:			
	<ul style="list-style-type: none"> <li>Size of riser/down- comer</li> <li>Number of hydrants per floor</li> <li>Hose Box</li> </ul>	NA NA NA	Provided 04 Provided	NA NA NA
12.	Yard Hydrants			
	<ul style="list-style-type: none"> <li>Total number of hydrants</li> <li>Hose Box</li> </ul>	NA NA	04 Provided	NA NA
13.	Pumping Arrangements:			
	<ul style="list-style-type: none"> <li>Ground Level</li> <li>Discharge of main pump</li> <li>Head of main pump</li> <li>Number of main pumps</li> <li>Jockey pump out put</li> <li>Jockey pump head</li> <li>Standby Pump out put</li> <li>Standby Pump Head</li> <li>Auto Staring/Manual stopping</li> <li>Pump House Access</li> <li>Terrace level</li> <li>Discharge of pump</li> <li>Head of the pump</li> <li>Power supply</li> <li>Auto starting of pump</li> </ul>	2280 lpm 70 m 01 180 lpm 70 m 2280 lpm 70 m Required Required 900 lpm 70Mtr Required Required	Provided Provided Provided Provided Provided Provided Provided Provided Provided Provided Provided Provided Provided	MR MR MR MR MR NA MR MR MR MR MR MR MR
14.	Captive water Storage for firefighting:			
	<ul style="list-style-type: none"> <li>Underground tank capacity</li> <li>Draw off connection</li> <li>Fire service inlet</li> <li>Access to tank</li> <li>Overhead Tank capacity</li> </ul>	2,00,000 ltrs. Required NA Required 15,000 ltrs.	Provided Provided NA Provided Provided	MR MR NA MR MR
15	Exit Signage	Required	Provided	MR
16.	Provision of Lifts			
	<ul style="list-style-type: none"> <li>Pressurization of Lift Shaft</li> <li>Pressurization of lift lobby</li> <li>Communication in lift Car</li> </ul>	NA NA Required	NA NA Provided	NA NA MR


*[Handwritten signature]*

	➤ Fireman's Grounding Switch	Required	Provided	MR
	➤ Lift Signage	Required	Provided	MR
17.	Standby power supply	Required	Provided	MR
18.	Refuge Area			
	➤ Total area	NA	NA	NA
	➤ Location	NA	NA	NA
19.	Fire control room			
	➤ Detector system panel	NA	NA	NA
	➤ Flow Switch Panel	NA	NA	NA
	➤ PA System Panel	NA	NA	NA
	➤ Battery backup	NA	NA	NA
	➤ Building Floor Plans	NA	NA	NA
20.	Special Fire Protection Systems for Protection of special Risks, if any;	Required 02 ABC type fire extinguishers near electrical panel	Provided	MR

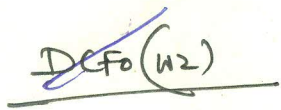
The fire protection systems provided in the building were checked and found functional at the time of inspection. Shortcomings vide letter no. F6/DFS/MS/WZ/School/87 dated 19.02.2021 are rectified.

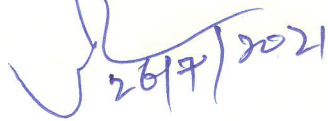
Keeping in view substantial compliance of the minimum standards on fire prevention and fire safety requirements under the rules, grant of Fire safety Certificate is recommended under rule 35 of the Delhi Fire service Rules 2010 under the DFS Act 2007.

  
M.K. Chattopadhyay, DO (West)

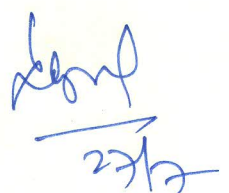
  
S. P. Bhardwaj, ADO (WP)

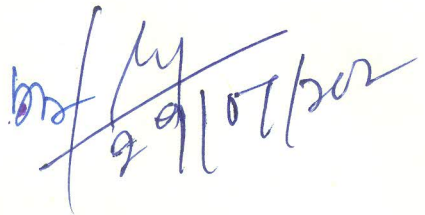
D.O. (WEST) 167  
DATED 23/07/21

  
DFO (W2)

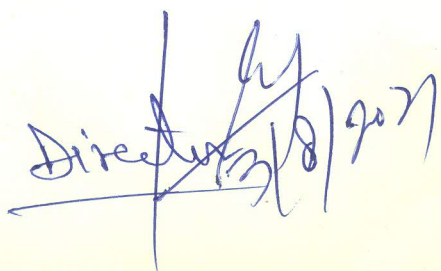
  
26/7/2021

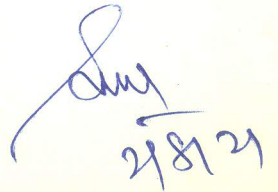


  
23/7

  
29/07/2021

DQ/W FT is put up for Synch plan

  
Director 23/8/2021

  
28/21

