

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE
NEW DELHI

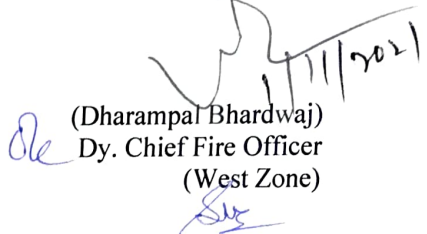
No.F6/DFS/MS/Banq./WZ/2021/ 540

Dated: 01/11/2021

FIRE SAFETY CERTIFICATE

Certified that the M/s. **Green Lounge Banquet** Located at **LGF-1 &LGF-2(Basement) of Aggarwal City Mall Plot No-05, Road No-44, Pitampura, New Delhi-110034** in a building comprised of Basement + Ground + 3Upper Floors owned/occupied by Green Lounge Banquet was issued FSC by this department vide Letter No.F6/DFS/MS/EH/2018/154 Dated-23/01/2018. The said premises was re inspected by the officers concerned of this department on 12-10-2021 in the presence of Sh. Rattan Singh (Manager) and found that the premises/building have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rule, 2010 and that the premises is fit for occupancy class " Assembly" Group D with effect from 01/11/2021 for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 01/11/2021..... at New Delhi by.


(Dharampal Bhardwaj)
Dy. Chief Fire Officer
(West Zone)

Copy to:

1. The Dy. Health Officer, Keshav Puram Zone, NDMC, Public Health Department, A-1 Block Keshav Puram Zone, Delhi.
2. Sh. Rajeev Nagpal (Director), Green Lounge Banquet, LGF-1 & LGF-2, Aggarwal City Mall, Plot No-05, Road No-44, Pitampura, New Delhi-110034.

Following fire safety directives must be adhered to:-

1. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
2. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
3. The trained staff should be available round the clock.
4. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
5. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
6. Basement shall be used as per building bye laws.
7. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on www.dfs.delhigovt.nic.in.
8. The owner/ occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this certificate, six months prior to its expiry.

INSPECTION REPORT

1. Name & address of the building: **M/s. Green Lounge Banquet** Located at **LGF-1 & LGF-2 (Basement), 39-43, Aggarwal City Mall, Plot No-05, Road No-44, Pitampura, New Delhi-110034.**
2. Type of Occupancy : Class-D (Assembly)
3. Type of Case : Renewal
4. Details of previous NOC : F6/DFS/MS/EH/2018/154 Dated-23.01.2018 & F6/DFS/MS/Mercantile/WZ/2021/464 dated 24.09.2021 (For Mall)
5. Fire Safety directives Letter No. : F-6/DFS/MS/2005/1527 Dated 19/07/2005 For the mall
6. Date of inspection : 12.10.2021
7. Name of the Inspecting Officer : S.P. Bhardwaj, ADO (WP)
8. Name and designation of Officer from the building side : Sh. Rattan Singh (Manager)
9. Year of Construction : 2014
10. Applicant's letter No. : 2021092022037 dated 09.10.2021

S N o	Minimum standards on fire prevention and fire safety U/R 33	BBL Requirements/letter dated 23.01.2018	Provided at site	Remarks MR/NMR
1.	Access of building			
	• Road width	12 m	Provided	MR
	• Gate width	6 m	Provided	MR
	• Width of internal road	As per sanction plan	Provided	MR
2.	Number, width, Type & Arrangements of exits			
	a. Number of staircases	02	Provided	MR
	• Upper floors	02 + one ramp	Provided	MR
	• Basements	NA	NA	NA
	b. Width of staircases	NA	NA	NA
	• Upper floors	Old case	One varies from 150cm to 200cm	MR(Old case)
	• Basements	1x90cm & 1x83cm & Ramp 5mtrs	5mtrs	MR(Old case)
	c. Protection of exits			
	• Fire check door	Required	Provided	MR
	• Pressurization	NA	NA	NA
	d. No of continuous staircase to terrace	NA	NA	NA
	e. Width Of Corridor	Old case	Old case	Old case
	f. Door Size	Old case	Old case	Old case
3.	Compartmentation			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire Rating of shaft door	Required	Provided	MR
	• Water Curtain	NA	NA	NA
	• Fire Dampers	Required	Provided	MR
4.	Smoke managements System			
	• Basements	Required	Provided	MR
	• Upper floors	NA	NA	NA
5.	Fire Extinguishers			
	• Total numbers	04 nos.	Provided	MR
	• Types	ABC & CO2	Provided	MR
	• IS marking	ISI marked	Provided	MR

(Signature)

6.	First – Aid Hose Reels			
	• Total numbers on each floor	02	Provided	
	• Length of hose reel hose	30 m	Provided	MR
	• Nozzle diameter	5 mm	Provided	MR
7.	Automatic fire detection and alarming system	Common with Mall		
	• Type of detectors	Smoke & Heat	Provided	MR
	• Location of Main Panel	Required	Provided	MR
	• Location of Repeater Panel	Required	Provided	MR
	• Alternate source of power	Required	Provided	MR
	• Hooters' Location	At strategic location	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Common with Mall	MR
10	Automatic Sprinkler System			
	• Basements	Required	Provided	MR
	• Upper Floor	NA	NA	NA
	• Sprinkler above false ceiling	NA	NA	NA
11	Internal Hydrants			
	• Size of riser/down- comer	150 mm	Provided	MR
	• Number of hydrants per floor	2	Provided	MR
	• Hose Box	Required	Provided	MR
12	Yard Hydrants			
	• Total number of hydrants	4	Provided	MR
	• Hose Box	Required	Provided	MR
13	Pumping Arrangements	Common with Mall		
	• Ground Level			
	• Discharge of main pump	2280 lpm	Provided	MR
	➤ Head of main pump	60m	Provided	MR
	➤ Number of main pumps	One diesel Two electric	Provided	MR
	➤ Jockey pump out put	180lpm	Provided	MR
	➤ Jockey pump head	60m	Provided	MR
	➤ Standby Pump out put	2280 lpm	Provided	MR
	➤ Standby Pump Head	60m	Provided	MR
	➤ Auto Staring/Manual stopping	Required	Provided	MR
	➤ Pump House Access	Required	Provided	MR
	• Terrace level			
	➤ Discharge of pump	180 lpm	Provided	MR
	➤ Head of the pump	60 m	Provided	MR
	➤ Power supply	Required	Provided	MR
	➤ Auto starting of pump	Required	Provided	MR
14	Captive water Storage for fire fighting	Common with Mall		
	• Under ground tank capacity	2 lakh	Provided	MR
	➤ Draw of connection	Required	Provided	MR
	➤ Fire service inlet	Required	Provided	MR
	➤ Access to tank	Required	Provided	MR
	• Overhead Tank capacity	20,000 ltrs	Provided	MR
15	Exit Signage	Required	Provided	MR
16	Provision of Lifts			
	➤ Pressurization of Lift Shaft	NA	NA	NA
	➤ Pressurization of lift lobby	NA	NA	NA
	➤ Communication in lift Car	NA	NA	NA
	➤ Fireman's Grounding Switch	NA	NA	NA
	➤ Lift Signage	NA	NA	NA
17	Standby power supply	Required	Provided	MR
18	Refuge Area			
	➤ Total area	NA	NA	NA
	➤ Location	NA	NA	NA
19	Fire control room	Common with Mall		
	➤ Detector system panel	Required	Provided	MR
	➤ Flow Switch Panel	Required	Provided	MR

	➤ PA System Panel	Required	Provided	MR
	➤ Battery backup	Required	Provided	MR
	➤ Building Floor Plans	Required	Provided	MR
20	Special Fire Protection Systems for Protection of special Risks, if any;	Manually operated CO ₂ system	Provided	MR

The fire protection systems provided in the building were checked and found functional at the time of inspection. The Mall FSC already issued vide letter no. F6/DFS/MS/Mercantile/WZ/2021/464 dated 24.09.2021.

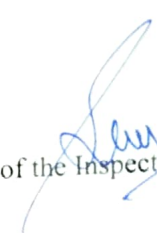
In view of the deemed compliance of minimum standards on fire prevention and fire safety as required under the rules the NOC issued vide letter no. F6/DFS/MS/EH/2018/154 Dated-23.01.2018 renewal under rule 37 of the Delhi Fire Service Rules 2010 is recommended.

Signature of the Inspecting Officer

Name : S.P. Bhardwaj

Designation : ADO (WP)


~~DO/West DO#~~
~~Defo WZ~~

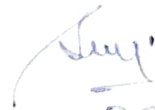

21/10/2021

~~ADO/Retired WZ~~

FT is put up for signature for

~~Defo WZ~~


11/11/2021


25/10/21

MS/all