

C-57

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001

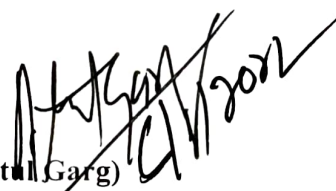
No. F.6/DFS/MS/EH/WZ/2021/ 03

Dated: 07/01/2022

FIRE SAFETY CERTIFICATE

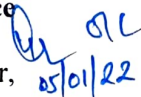
Certified that the M/s. Jubilant Food Works Ltd. (Domino's Pizza) located at Ground Floor, Shop No.- 6, 7 & 51, Radisson Blu Hotel, Paschim Vihar, District Centre, New Delhi 110063, is running at Ground floor of a bulding comprised of 03 tier Basement, Ground plus 12 upper floors. The premise was inspected by the officer concerned of this department on 22/12/2021 in the presence of Mr. Danish Siddiqui (liaison manager) and observed that said eating house have complied with the fire safety and fire prevention requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the building/premises is fit for occupancy class-D (Assembly) "Eating House" with effect from 07/01/2022 for a period of **Three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010, printed overleaf.

Issued on 07/01/2022 at New Delhi by.


(Atul Garg)
Director
Delhi Fire Service

Copy to: -

1. The Owner/occupier, M/s. Jubilant Food Works Ltd. (Domino's Pizza), Ground Floor, Shop No.- 6, 7 & 51, Radisson Blu Hotel, Paschim Vihar, District Centre, New Delhi 110063
2. The Deputy Health Officer, North DMC, Rohini Zone, Rohini, Sector-5, New Delhi.
3. The Joint Commissioner of Police, Licensing Unit, 1st Floor, Police Station Defence Colony, New Delhi


07/01/22

CONDITIONS

1. All the means of escape shall be kept free of all type of obstruction all the time.
2. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
3. All the fire fighting equipments shall be maintained in perfect working condition all the time and any lapse rendering non-functional if fire safety measures, management shall be responsible.
4. Any deviation, with regards to construction, ventilation, occupation, electric installation etc. may be got verified from the concerned authorities.
5. The Fire Safety Certificate may not be treated in any case for regularizations of unauthorized construction / unauthorized use of land if any.
6. All comments / directions of licensing Department shall always be permitted and followed.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in
8. The owner / occupier shall apply for renewal of this Fire Safety Certificate to the Director in 'Form J' (sub Rule (1) of Rule 37) along with copy of the certificate, six months prior to its expiry.

INSPECTION REPORT

1	Name & Address of the Building	Jubilant Food Works Ltd. (Domino's Pizza) located at Ground Floor, Shop No. 6, 7 & 51, Hotel Radisson Blu, Plot no. D, District Centre, Paschim Vihar, New Delhi.		
2	Type of Occupancy	Group-D, Assembly Building		
3	Building Comprised of	Running at GF of a building comprised of 3 tier Basement, Ground floor plus 12 upper floors.		
4	Type of Case	New		
5	Details of Previous NOC	Nil		
6	Fire Safety Directives Letter No	Nil		
7	Date of Inspection	22/12/2021		
8	Name of the Inspecting Officers	ADO Aman Kumar Lathar		
9	Name & Designation of Officers from the building side	Mr. Danish Siddiqui, Liaison Manager		
10	Year of construction	2020-21		
11	Applicant letter No.	MHA ID- 202100823719		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	UBBL/NBC-IV Requirement	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	<ul style="list-style-type: none"> • Road width • Gate width • Width of internal road 	12 m 05 m 06 m	Provided Provided Provided	MR MR MR
2	Number, width, type & arrangement of exits.			
	a) Number of Staircase			
	<ul style="list-style-type: none"> ➤ Upper floors ➤ Basement 	-N/A- -N/A-	Running at GF only -N/A-	-N/A- -N/A-
	b) Width of Staircase			
	<ul style="list-style-type: none"> ➤ Upper floors ➤ Basement 	-N/A- -N/A-	Running at GF only -N/A-	-N/A- -N/A-
	c) Protection of exits			
	<ul style="list-style-type: none"> ➤ Fire check door ➤ Pressurization 	Required -N/A-	Provided -N/A-	MR -N/A-
	d) No. of continuous staircase to terrace	-N/A-	-N/A-	-N/A-
	e) Width of corridor	-N/A-	-N/A-	-N/A-
	f) Door size	02 x 1.5 m	2.0 , 1.5 m	MR
3	Compartmentation.			
	<ul style="list-style-type: none"> • Fire check door. • Sealing of electrical shafts. • Fire rating of shaft door. • Water curtain • Fire dampers. 	-N/A- -N/A- -N/A- -N/A- -N/A-	-N/A- -N/A- -N/A- -N/A- -N/A-	-N/A- -N/A- -N/A- -N/A- -N/A-
4.	Smoke Management system.			
	<ul style="list-style-type: none"> • Basement • Upper floors 	-N/A- 12 ACPH	-N/A- Provided	-N/A- MR
5.	Fire Extinguishers.			
	<ul style="list-style-type: none"> • Total numbers • Types • ISI Marking 	06 ABC & CO ₂ ISI marked	06 ABC- 03 & CO ₂ -03 Provided	MR MR MR

Common with the building			
6. First Aid Hose Reels.			
• Total numbers on each floor	Required	Provided by Hotel	MR
• Length of hose-reel hose.	30 m	Provided by Hotel	MR
• Nozzle Diameter	05 mm	Provided by Hotel	MR
Common with the building			
7 Automatic fire detection & alarming system.			
• Type of detectors	Smoke & Heat	Provided	MR
• Location of Main Panel	Ground floor	Provided by Hotel	MR
• Location of Repeater Panel	All floor	Provided	MR
• Alternate source of power	Required	USB + DG set	MR
• Hooter's location	All floor	Provided	MR
8. MOEFA	Required	Provided	MR
9. Public Address System	Required	Provided	MR
Common with the building			
10. Automatic Sprinkler System			
• Basement.	-N/A-	-N/A-	-N/A-
• Upper floors	Required	Provided	MR
• Sprinkler above false ceiling	Required	Provided	MR
Common with the building			
11. Internal Hydrants.			
• Size of Riser / Down-comer	150 mm	Provided by Hotel	MR
• Number of Hydrant per floor	Required	Provided by Hotel	MR
• Hose box.	Required	Provided by Hotel	MR
Common with the building			
12. Yard Hydrants.			
• Total number of hydrants.	-N/A-	-N/A-	-N/A-
• Hose box.	-N/A-	-N/A-	-N/A-
Common with the building			
13. Pumping arrangements.			
• Ground Level			
Discharge of main pump.	2850 LPM	Provided by Hotel	MR
➤ Head of main pump.	80 m	Provided by Hotel	MR
➤ Number of main pumps.	2	Provided by Hotel	MR
➤ Jockey Pump output.	2 × 180 LPM	Provided by Hotel	MR
➤ Jockey Pump head.	2 × 180 LPM	Provided by Hotel	MR
➤ Standby Pump output.	2850 LPM	Provided by Hotel	MR
➤ Standby Pump head.	80 m	Provided by Hotel	MR
➤ Auto Starting/Manual stopping.	Required	Provided by Hotel	MR
➤ Pump house access.	Required	Provided by Hotel	MR
Common with the building			
• Terrace Level			
➤ Discharge of pump.	900 LPM	Provided by Hotel	MR
➤ Head of pump.	80 m	Provided by Hotel	MR
➤ Power supply.	Required	Provided by Hotel	MR
➤ Auto starting of pump.	Required	Provided by Hotel	MR
Common with the building			
14. Captive water storage for firefighting.			
• Underground tank capacity.	2,00, 000 ltrs	Provided by Hotel	MR
➤ Draw-off connection.	Required	Provided by Hotel	MR
➤ Fire Service Inlet.	Required	Provided by Hotel	MR
➤ Access to tank.	Required	Provided by Hotel	MR
• Overhead tank capacity.	20,000 ltrs	Provided by Hotel	MR
Common with the building			
15. Exit Signage.	Required	Provided	MR

ing
M
MI
MR

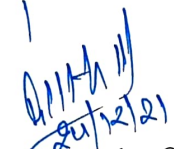
16.	Provision of Lifts. <ul style="list-style-type: none"> • Pressurization of lift shaft. • Pressurization of lift lobby. • Communication in lift car. • Fireman's switch. • Lift signage. 	-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		Required	UPS + DG set	MR
17	Standby Power Supply			
18.	Refuge Area <ul style="list-style-type: none"> • Total area • Location 	-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
Common with the building				
19.	Fire Control Room. <ul style="list-style-type: none"> • Detector System Panel. • Flow Switch Panel. • PA system Panel. • Battery backup • Building floor plan 	Required	Provided	MR
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
20.	Special Fire Protection System for the Protection of special Risk, if any.	-N/A-	-N/A-	-N/A-

The fire protection systems provided in the building were test checked and found functional at the time of inspection.

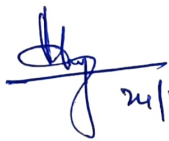
Keeping in view the substantial compliance of the minimum standards on fire prevention and fire safety required under the rules it is recommended to grant Fire Safety Certificate after acceptance of above note under rule 37 of the Delhi Fire Service Rules 2010.

Accordingly DFA is put up for approval and signature please.

D.O. (WESTY) 196
DATED 24/12/21

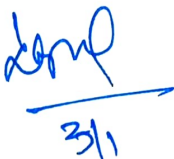

Signature of the Inspecting Officer
Name : Aman Kumar Lathar
Designation: ADO (JWP)




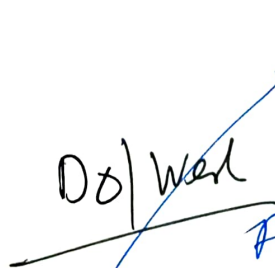

24/12/2021


31/1/22
493

DcfO (W2) - E/L
cfO


31/1


3/1/2022


04/1/2022
ADO (JWP)