

0/55

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE  
NEW DELHI-110 001.

No.F.6/DFS/MS/BNQT./2022/SZ/ 135

Dated: 01/08/2022

FIRE SAFETY CERTIFICATE

Certified that the **M/s K D Grand Banquet** located at Plot no. 24,25,26,Sewa Park,Near NSIT, Dwarka Mod, New Delhi-110078 comprised of basement, ground plus three upper floors, owned/occupied by M/s K D Grand Banquet was issued FSC by this department vide letter no. F.6/DFS/MS/2019/SZ/BNQT./1718 dated 04/09/2019. The premises was re-inspected by the officers concerned of this department on 22/07/2022 in the presence of Mr. Divay and found that the building have deemed complied with the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010 and that the building/ premises is fit for occupancy class Group-D "Assembly Building" w.e.f. the date of issue of this certificate for a period of three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule-38 of the Delhi Fire Service Rules, 2010 printed overleaf.  
Issued on..... 01/08/2022 ..... at New Delhi.

(SUNIL CHAUDHARY)  
DY.CHIEF FIRE OFFICER

Copy to:-

1. The Authorized Signatory, K D Grand Banquet,  
Plot no. 24,25,26,Sewa Park,Near NSIT, Dwarka Mod, New Delhi-110078.
2. The Dy. Health Officer, S.D.M.C, Public Health Department, West Zone,  
Vishal Enclave, Rajouri Garden, New Delhi-110027

Following fire safety directives must be adhered to:-

1. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
2. The means of escape arrangements shall be kept unlocked & unobstructed for speedy evacuation of occupants in case of an emergency.
3. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
4. The trained staff should be available round the clock.
5. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
6. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
7. Basement shall be used as per the building bye laws.
8. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).
9. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in the Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry.

N/19

1. Name & address of the building : M/s K D Grand Banquet, Plot no. 24,25,26,Sewa Park,Near NSIT, Dwarka Mod, New Delhi-110078.
2. Building is comprised of : Basement, Ground, Plus three upper floors
3. Type of Occupancy : Assembly (Banquet Hall)
4. Type of Case : Renewal
5. Details of Previous FSC : F6/DFS/MS/ 2019/SZ/ Bnqt/1718 Dated 04/09/2019
6. Fire Safety direction letter No : F6/DFS/MS/BP/2019/2241 Dated 22/04/2019
7. Date of Inspection : 22/07/2022
8. Name of the Inspecting Officers: ADO R.K.Yadav & D.O Vedpal Chhikara
9. Name of the designation of Officer from the building side : Mr. Divay
10. Year of Construction : Before 2010
11. Applicant's letter No : Nil Dated 12/07/2022

Sr. no.	Minimum Standards on fire prevention and fire safety U/R33	Requirement	Provided at Site	Remarks MR/NMR
1	Access to building			
	Road width	12 m	24 m Provided	MR
	Gate width	4.5 m	Direct accessible from road	MR
	Width of internal road	N/A	N/A	N/A
2	Number, Width, Type and Arrangement of Exits			
	a. Number of Staircases			
	Upper Floor	2 nos.	Provided	MR
	Basement	2 nos.	Provided	MR
	b. Width of Staircases			
	Upper Floor	2 m & 1.80 m	Provided	MR
	Basement	N/A	N/A	N/A
	c. Protection of exits			
	Fire check door	Required	Provided	MR
	Pressurization	N/A	N/A	N/A
	e. No. of continuous staircases to terrace	2 nos.	Provided	MR
	g. Width of Corridor	N/A	N/A	N/A
	h. Door Size	2 m & 1.80 m	Provided	MR
3	Compartmentation.			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	N/A	N/A	N/A
	• Fire rating of shaft door	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire Dampers	N/A	N/A	N/A
4	Smoke Management System.			
	• Basement	30 a/c per hour	Provided	MR
	• Upper floor	12 a/c per hour	Provided	MR

h

h

N/A  
N/20

Fire Extinguisher				
• Total numbers		04 at each floor	Provided	MR
• Types		CO2 & ABC	Provided	MR
• ISI marking		ISI marked	Provided	MR
First-aid-Hose Reels.				
Total numbers of each floor		02 no	Provided	MR
Length of hose reel hose		30 m	Provided	MR
Nozzle diameter		5 mm	Provided	MR
7 Automatic fire detection and alarming system.				
Type of detectors		Heat & Smoke	Provided	MR
Location of main panel		Ground floor	Provided	MR
Location of repeater panel		N/A	N/A	N/A
Alternate source of power		Required	Provided	MR
Hooter's location		Different Locations	Provided	MR
8 MOEFA		Required	Provided	MR
9 Public address System.		Required	Provided	MR
10 Automatic Sprinkler System.		Required	Provided	MR
Basement				
upper floor		Required	Provided	MR
sprinkler above false ceiling		N/A	N/A	N/A
11 Internal Hydrants		N/A	N/A	N/A
size of riser/down-comer		150 mm	Provided	MR
Number of hydrants per floor		2 no.	Provided	MR
Hose Box		2 no.	Provided	MR
12 Yard Hydrants.				
Total number of hydrants		N/A	One	MR
Hose Box		N/A	Provided	MR
13 Pumping Arrangements.				
• Ground Level				
➤ Discharge of main Pump		2280 LPM	Provided	MR
➤ Head of Main Pump		50 m	Provided	MR
➤ Number of main pumps		1 No	Provided	MR
➤ Jockey pump out put		180 LPM	Provided	MR
➤ Jockey pump head		50 m	Provided	MR
➤ Standby pump out put		2280 LPM	Provided	MR
➤ Standby pump Head		50 m	Provided	MR
➤ Auto Starting /Manual stopping		Required	Provided	MR
➤ Pump House Access		Required	Provided	MR
• Terrace Level				
➤ Discharge of pump		900 LPM	Provided	MR
➤ Head of the Pump		40 M	Provided	MR
➤ Power supply		Required	Provided	MR
➤ Auto Starting of pump		Required	Provided	MR

*(Handwritten marks)*

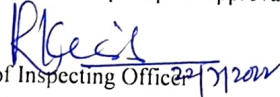



14	Captive Water Storage for Fire Fighting.			
	Underground tank capacity	2,00,000 ltrs	2,00,000 ltrs	MR
	Draw-off connection	Required	Provided	MR
	Fire service inlet	Required	Provided	MR
	Access to tank	Required	Provided	MR
	Overhead Tank capacity	10,000 Liters	10,000 Ltrs.	MR
15	Exit Signage.	Required	Provided	MR
16	Provision of Lifts.			
	Pressurization of Lift Shaft	N/A	N/A	N/A
	Pressurization of Lift lobby	N/A	Provided	MR
	Communication in lift car	Required	Provided	MR
	Firemen's grounding switch	Required	Provided	MR
	Lift Signage	Required	Provided	MR
17	Standby power supply	Required	DG Set	MR
18	Refuge Area.			
	Total area	N/A	N/A	N/A
	Location	N/A	N/A	N/A
19	Fire Control Room			
	Detector system panel	Required	Provided	MR
	Flow switch panel	N/A	N/A	N/A
	PA system panel	Required	Provided	MR
	Batter backup	Required	Provided	MR
	Building Floor Plans	N/A	N/A	N/A
20	Special Fire Protection systems for protection of special Risks, if any:	Required for HT/LT Panels	Provided	MR

The fire protection systems provided in the building were tested, checked and found not functional at the time of inspection. The shortcomings issued vide letter no.F6/DFS/MS/BNQT./2022/SZ/117 dated 11/07/2022 has been rectified.

In view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the Rules, the FSC issued vide letter No. F.6/DFS/MS/019/SZ/BNQT./1718 dated 04/09/2019, renewal under Rule 35 of the Delhi Fire Service Rules 2010 is recommended.

Accordingly DFA is put up for approval please.

Signature of Inspecting Officer   
 Name:- R.K. Yadav  
 Designation:- Asstt. Divisional Officer

  
 Signature of Inspecting Officer  
 Name:- Vedpal Chhikara  
 Designation:- Divisional Officer

DCFO (South Zone)

