

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI-110001**

No. F.6 DFS/MS/School/2022/SZ/ 1049

Dated: 21 / 9 / 2022

FIRE SAFETY CERTIFICATE

Certified that **Govt. Girls Senior Secondary School, (Tigri) Dr. Ambedkar Nagar, Sector-IV New Delhi 110062** comprised of 02 Building Block, each Ground plus Three upper floors owned/occupied by Directorate of Education, Govt. of NCT of Delhi have complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and verified by officer concern of this department on 05/09/2022 in the presence of Mr. Manish Kumar and that the premises is fit for occupancy class "**Educational, Group-B**" (School) as above with effect from 21 / 9 / 2022 for period of **Three years** in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 21 / 9 / 2022 at New Delhi by


(ATUL GARG)
DIRECTOR

Copy to: -

1. The Assistant Engineer (E) Edu. Maint. Sub-div-M1, PWD, Hauz Khas, New Delhi 110016.
2. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi- 110054

Conditions for the validity of Fire Safety Certificate

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life or property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of firefighting system.
4. This certificate cannot be treated as regularization of unauthorized construction, if any.
5. The owner/ occupier shall submit a declaration every year in Form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
6. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or Alteration (Clause 1.4.3 of UBBL-2016), if any.
7. "The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry."

INSPECTION REPORT

1	Name & Address of the Building	Govt. Girls Senior Secondary School, (Tigri) Dr. Ambedkar Nagar, Sector-IV New Delhi 110062		
2	Type of Occupancy	Educational, Group-B (School ID- 193080)		
3	Building Comprised of	02 Blocks, G + 3 Upper Floor		
4	Type of Case	New Case		
5	Details of Previous NOC	Nil		
6	Fire Safety Directives Letter No	NBC/UBBL 2016		
7	Date of Inspection	05-09-2022		
8	Name of the Inspecting Officers	Sh. Rajesh Kumar ADO (BCP)		
9	Name & Designation of Officers from the building side	Mr. Manish Kumar,		
10	Year of construction	2022		
11	Applicant letter No.	54(SPS-School)PWD/Edu./Maint./Sub-Div/M-1-3/2022-23/21 dated 18/09/2022		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	UBBL-2016 requirements	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	• Road width	Required	9 mtr	MR
	• Gate width	-NA-	-NA-	-NA-
	• Width of internal road	-NA-	-NA-	-NA-
2	Number, width, type & arrangement of exits.			
	a) Number of Staircase			
	➤ Upper floors.	02 Nos	02 Nos	MR
	➤ Basement floor.	-NA-	-NA-	-NA-
	b) Width of Staircase			
	➤ Upper floors	1.50 m	1.50 m each	MR
	➤ Basement floor	-NA-	-NA-	-NA-
	c) Protection of exits			
	➤ Fire check door	-NA-	-NA-	-NA-
	➤ Pressurization	-NA-	-NA-	-NA-
	d) No. of continuous staircase to terrace	02 Nos	Provided	MR
	e) Width of corridor	-NA-	-NA-	-NA-
	f) Door size	1.2 mtr	1.2 mtr	MR
3	Compartmentation.			
	• Fire check door.	-NA-	-NA-	-NA-
	• Sealing of electrical shafts.	-NA-	-NA-	-NA-
	• Fire rating of shaft door.	-NA-	-NA-	-NA-
	• Water curtain	-NA-	-NA-	-NA-
	• Fire dampers.	-NA-	-NA-	-NA-
4.	Smoke Management system.			
	• Basement	-NA-	-NA-	-NA-
	• Upper floors	-NA-	-NA-	-NA-
5.	Fire Extinguishers.			
	• Total numbers	10no's	12 Nos	MR
	• Types	ABC / co2	ABC / Co2 Type	MR
	• ISI Marking	ISI mark	Provided	MR
6.	First Aid Hose Reels.			
	• Total numbers on each floor.	02 at each	Provided	MR
	• Length of hose-reel hose.	30 mm	Provided	MR
	• Nozzle Diameter	5 m	Provided	MR
7	Automatic fire detection & alarming system.			
	• Type of detectors	-NA-	-NA-	-NA-
	• Location of Main Panel	-NA-	-NA-	-NA-
	• Location of Repeater Panel	-NA-	-NA-	-NA-
	• Alternate source of power	-NA-	-NA-	-NA-
	• Hooter's location	-NA-	-NA-	-NA-
8.	MOEFA	-NA-	-NA-	-NA-
9.	Public Address System	-NA-	-NA-	-NA-

N/111

7/1
असिस्टेंट
आफिसर

the fire protection
at the time of inspection
Keeping in view of
Prevention and
Safety Certificate

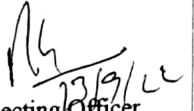
10.	Automatic Sprinkler System			
	• Basement	-NA-	-NA-	-NA-
	• Upper floors	-NA-	-NA-	-NA-
	• Sprinkler above false ceiling	-NA-	-NA-	-NA-
11.	Internal Hydrants.			
	• Size of Riser/Down-comer	-NA-	100 MM	-NA-
	• Number of Hydrant per floor	-NA-	02	-NA-
	• Hose box.	-NA-	02	-NA-
12.	Yard Hydrants.			
	• Total number of hydrants.	-NA-	-NA-	-NA-
	• Hose box.	-NA-	-NA-	-NA-
13.	Pumping arrangements.			
	• Ground Level			
	➤ Discharge of main pump.	-NA-	-NA-	-NA-
	➤ Head of main pump.	-NA-	-NA-	-NA-
	➤ Number of main pumps.	-NA-	-NA-	-NA-
	➤ Jockey Pump output.	-NA-	-NA-	-NA-
	➤ Jockey Pump head.	-NA-	-NA-	-NA-
	➤ Standby Pump output.	-NA-	-NA-	-NA-
	➤ Standby Pump head.	-NA-	-NA-	-NA-
	➤ Auto Starting / Manual Stopping.	-NA-	-NA-	-NA-
	➤ Pump house access.	-NA-	-NA-	-NA-
	• Terrace Level			
	➤ Discharge of pump.	2 x 450 LPM	Each blocks Provided	MR
	➤ Head of pump.	40 m	Provided	MR
	➤ Power supply.	Required	Provided	MR
	➤ Auto starting of pump.	Required	Provided	MR
14.	Captive water storage for fire fighting.			
	• Underground tank capacity.	-NA-	-NA-	-NA-
	➤ Draw-off connection.	-NA-	-NA-	-NA-
	➤ Fire Service Inlet.	-NA-	-NA-	-NA-
	➤ Access to tank.	-NA-	-NA-	-NA-
	• Overhead tank capacity.	10,000 ltrs each	Provided	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	• Pressurization of lift shaft.	-NA-	-NA-	-NA-
	• Pressurization of lift lobby.	-NA-	-NA-	-NA-
	• Communication in lift car.	-NA-	-NA-	-NA-
	• Fireman's switch.	-NA-	-NA-	-NA-
	• Lift signage.	-NA-	-NA-	-NA-
17.	Standby Power Supply	-NA-	-NA-	-NA-
18.	Refuge Area			
	• Total area	-NA-	-NA-	-NA-
	• Location	-NA-	-NA-	-NA-
19.	Fire Control Room.			
	• Detector system panel.	-NA-	-NA-	-NA-
	• Flow switch panel.	-NA-	-NA-	-NA-
	• PA system panel.	-NA-	-NA-	-NA-
	• Battery backup.	-NA-	-NA-	-NA-
	• Building floor plan.	-NA-	-NA-	-NA-
20.	Special Fire Protection System for the Protection of special Risk, if any.	-NA-	-NA-	-NA-

3


The fire protection system provided in the building were randomly checked and found functional at the time of inspection.

Keeping in view of the substantially satisfactory compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, it is recommended to issue Fire Safety Certificate under rule 35 (3) of the Delhi Fire Service Rules, 2010


Accordingly, DFA is put up for approval and signature please.


Signature of the Inspecting Officer
Name: Sh. Rajesh Kumar
Design: ADO (BCP)

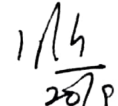
Dy. CFO (SZ)


 F.T.

~~ADO BCP~~ C.F.O. 
16/9/2012

Director 
12/9/12

As per

As approved, F.T. letter is put up for your signature P1 
20/9

Director 
20/9/12

NSM