



**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001**



**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001**

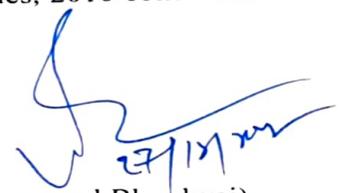
No. F6/DFS/MS/EH/WZ/2022/ 364

Dated: 27/12/2022

**FIRE SAFETY CERTIFICATE**

Certified that the M/s **The Met Restaurant (A Unit of West Face Services)**, Located at 17A, Ground Floor, North West Avenue, West Punjabi Bagh, New Delhi -110026 is running at Ground Floor in a building comprised of Basement, Ground + 3 Upper floors, Owned/Occupied by M/s. **The Met Restaurant (A Unit of West Face Services)** the premises was re-inspected by the officer concerned of this department on 28/11/2022 in the presence of Sh. Rajesh Gulla and found that the said eating house have deemed complied with fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire service Rules, 2010 & found that the said premises is fit for occupancy class "Assembly" Group D with effect from 27/12/2022 for a period of three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules, 2010 conditions mentioned below.

Issued on 27/12/2022 at New Delhi by.

  
(Dharampal Bhardwaj)  
Dy. Chief Fire Officer  
West Zone

Copy to: -

1. M/s M/s. The Met (A Unit of West Face Services), Located at 17A, Ground Floor, North West Avenue, West Punjabi Bagh, New Delhi -110026.
2. Dy. Health Officer, SDMC, West Zone, Vishal Enclave, Rajouri Garden, New Delhi 110027.

**Following fire safety directives must be adhered to:-**

1. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
2. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
3. The trained staff should be available round the clock.
4. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
5. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
6. Basement shall be used as per building bye laws.
7. The owner/ occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this certificate, six months prior to its expiry.
8. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).
9. No seating arrangements is allowed in the set back area of the building.

## INSPECTION REPORT

1. Name & address of the building : M/s The Met Restaurant (A unit of Westt Face Services) located at 17-A, North Avenue, Punajbi Bagh, New Delhi-110026.
2. Type of Occupancy : Assembly (Restaurant at Ground Floor)
3. Type of Case : Renewal
4. Details of previous NOC : F6/DFS/MS/EH/WZ/2019/1620 dated 13/08/2019
5. Fire Safety directives letter No : NBC (Part-IV)
6. Date of inspection : 28/11/2022
7. Name of the Inspecting Officers : Sarabjeet Singh ADO(MN)
8. Name and designation of officers from the building side : Sh. Rajesh Gulla
9. Year of Construction : 2010 (As Per Pre. Insp. Report dated 10/07/2019)
10. Applicant's letter No. : Online application No. 2022101018886 dated 10/10/2022

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	BBL /NBC Requirement As Per Pre. Insp. dtd. 10/07/2019	Provided at site	Remarks MR/NMR
1	<b>Access to building</b>			
	• Road width	12 mtr	Provided	MR
	• Gate width	06 mtr	Provided	MR
	• Width of internal road	NA	NA	NA
2	<b>Number, Width, Type &amp; Arrangement of Exits</b>			
	a. Number of staircases			
	• Upper Floors	NA	NA	NA
	• Basements	NA	NA	NA
	b. Width of staircases			
	• Upper Floors	NA	NA	NA
	• Basements	NA	NA	NA
	c. Protection of exits			
	• Fire check door	NA	NA	NA
	• Pressurization	NA	NA	NA
	e. No. of continuous staircases to terrace	NA	NA	NA
	f. Width of Corridor	NA	NA	NA
	g. Door Size	2 x 1.5 mtr	Provided	MR
3	<b>Compartmentation.</b>			
	• Fire check door	NA	NA	NA
	• Sealing of electrical shafts	NA	NA	NA
	• Fire Rating of shaft door	NA	NA	NA
	• Water Curtain	NA	NA	NA
	• Fire Dampers	NA	NA	NA
4	<b>Smoke Management System.</b>			
	• Basements	NA	NA	NA
	• Upper floors	NA	NA	NA
5	<b>Fire Extinguishers</b>			
	• Total numbers	04	Provided	MR
	• Types	CO <sub>2</sub> , ABC type	Provided	MR
	• IS marking	ISI marked	Provided	MR
6	<b>First-Aid Hose Reels.</b>			
	• Total numbers on each floor	01	Provided	MR
	• Length of hose reel hose	30 mtr	Provided	MR

	<ul style="list-style-type: none"> <li>Nozzle diameter</li> </ul>	5mm	Provided	MR
7	<b>Automatic fire detection and alarming system.</b>			
	<ul style="list-style-type: none"> <li>Type of detectors</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Location of Main Panel</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Location of Repeater Panel</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Alternate source of power</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Hooters' Location</li> </ul>	NA	Provided	NA
8	<b>MOEFA</b>	Required	Provided	MR
9	<b>Public Address System.</b>	NA	NA	NA
10	<b>Automatic Sprinkler System.</b>			
	<ul style="list-style-type: none"> <li>Basement</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Upper Floor</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Sprinkler above false ceiling</li> </ul>	NA	Provided	NA
11	<b>Internal Hydrants</b>			
	<ul style="list-style-type: none"> <li>Size of riser/down-comer</li> </ul>	Required	Provided	MR
	<ul style="list-style-type: none"> <li>Number of hydrants per floor</li> </ul>	Required	Provided	MR
	<ul style="list-style-type: none"> <li>Hose Box</li> </ul>	Required	Provided	MR
12	<b>Yard Hydrants.</b>			
	<ul style="list-style-type: none"> <li>Total number of hydrants</li> </ul>	NA	Provided	NA
	<ul style="list-style-type: none"> <li>Hose Box</li> </ul>	NA	Provided	NA
13	<b>Pumping Arrangements. (Common with Guest House)</b>			
	<ul style="list-style-type: none"> <li>Ground Level</li> </ul>			
	<ul style="list-style-type: none"> <li>➤ Discharge of main Pump</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Head of Main pump</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Number of main pumps</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Jockey Pump out put</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Jockey pump head</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Standby Pump out put</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Standby Pump Head</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Auto Starting/ Manual stopping</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Pump House Access</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>Terrace level</li> </ul>			
	<ul style="list-style-type: none"> <li>➤ Discharge of pump</li> </ul>	450 lpm	Provided	MR
	<ul style="list-style-type: none"> <li>➤ Head of the pump</li> </ul>	40m	Provided	MR
	<ul style="list-style-type: none"> <li>➤ Power Supply</li> </ul>	Required	Provided	MR
	<ul style="list-style-type: none"> <li>➤ Auto Starting of pump</li> </ul>	Required	Provided	MR
14	<b>Captive Water Storage for fire fighting. (Common with Guest House)</b>			
	<ul style="list-style-type: none"> <li>Underground tank capacity</li> </ul>	NA	1,00,000 ltr	NA
	<ul style="list-style-type: none"> <li>➤ Draw-off connection</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Fire service inlet</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>➤ Access to tank</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>Overhead Tank capacity</li> </ul>	20,000 <i>lks</i>	Provided	MR
15	<b>Exit Signage.</b>	Required	Provided	MR
16	<b>Provision of Lifts.</b>			
	<ul style="list-style-type: none"> <li>Pressurization of Lift Shaft</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>Pressurization of Lift lobby</li> </ul>	NA	NA	NA
	<ul style="list-style-type: none"> <li>Communication In lift Car</li> </ul>	NA	NA	NA

	<ul style="list-style-type: none"> <li>• Fireman's Grounding Switch</li> <li>• Lift Signage</li> </ul>	NA	NA	NA
17	<b>Standby power supply</b>	Required	Provided	MR
18	<b>Refuge Area.</b>			
	➤ Total Area	NA	NA	NA
	➤ Location	NA	NA	NA
19	<b>Fire Control Room</b>			
	<ul style="list-style-type: none"> <li>• Detector System Panel</li> <li>• Flow Switch Panel</li> <li>• PA System Panel</li> <li>• Batter backup</li> <li>• Building Floor Plans</li> </ul>	NA	NA	NA
		NA	NA	NA
		NA	NA	NA
		NA	NA	NA
20	Special Fire Protection Systems for Protection of special Risks, if any	NA	NA	NA

Note - Building comprised of Basement, Ground & 3 Upper Floors only, Basement is being used as storage purpose and three upper floors are used as guest house. Fire safety certificate for guest house has already been issued by this department vide letter no F6/DI S/MS/111/WZ/2019 620 dated 13/08/2019. Proposed restaurant is on ground floor only. Covered Area of ground floor is 226.09m<sup>2</sup> and no of occupants as per NBC (Part-IV) comes out to be 126 (226.09 / 1.8 = 126) which is covered under DFS Act 2007 & Rules 2010.

The fire protection system provide in the building were tested, checked and found functional at the time of inspection. The shortcomings issued by this department vide letter no F6/DFS/MS/MN/GH/2022/93 dated 01/02/2022 has been complied.

Keeping in view of the Substantial compliance of the minimum standards of fire prevention and fire safety required under the rules it is recommended to grant Fire Safety Certificate under rule 35 of the Delhi Fire Service Rules 2010 is recommended.

378/ADO/MN  
06/12/2022  
27/12/2022

~~Do (west)~~

~~Signature~~  
06/12/2022

Signature of the Inspecting Officer  
Name Sarabjeet Singh  
Designation ADO (MN)

put up file after the renewal of guest house in the name & style of West Face as the system is common with the guest house.

~~Do (west)~~  
ADO (MN)

06/12/2022

741/Do/WD  
27/12/2022

Shr, F.S.C of west face guest house is submitted after compliance. Submitted for approval pl.

~~Do (west)~~  
DCFO (MN)

27/12

27/12/2022

put Ref P-T ADO/RW

cont -