



No.F6/DFS/MS/EH/SZ/2022/ 315

Dated: 14/11/2022

FIRE SAFETY CERTIFICATE

Certified that the M/s FIG (A Unit of True To Plate Hospitality Pvt. Ltd.), located at 3/48, Ground & Mezzanine floor, Malcha Marg, Diplomatic Enclave, Chanakyapuri, New Delhi, was running on Ground + Mezzanine floor of the building which is comprised of Basement + Ground + Mezzanine + 01 upper floor was inspected by officer concerned of Delhi Fire Service on 09.11.2022 in the presence of Mr. Ryan Rajput, Manager and found that the building has deemed complied with the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010. Hence the premises/building (Ground + Mezzanine floor) is fit for occupancy of Group D "Assembly Building" (Restaurant) with effect from 14.11.2022 for a period of three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to conditions under Rule 38 of Delhi Fire Service Rules, 2010 printed below.

Issued on 14/11/2022 at New Delhi by

(Atul Garg)
Director
Delhi Fire Service

Copy to:

1. The Licensee, M/s FIG (A Unit of True To Plate Hospitality Pvt. Ltd.), located at 3/48, Ground & Mezzanine floor, Malcha Marg, Diplomatic Enclave, Chanakyapuri, New Delhi.

Conditions for the validity of Fire Safety Certificate

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times.
2. Any loss of life or property due to non functional fire safety measures shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. Any deviation w.r.t. construction etc. shall be verified by the concerned building sanctioning authority.
5. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
6. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
7. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry".
8. Basement shall be used as per NBC/UBBL.
9. Any change in the occupancy shall be intimated to this Deptt. and approval shall be obtained thereto before occupancy of the same.

N/7
INSPECTION REPORT

1.	Name and address of the building:	M/s FIG (A Unit of True To Plate Hospitality Pvt. Ltd.), located at 3/48, Ground & Mezzanine floor, Malcha Marg, Diplomatic Enclave, Chanakyapuri, New Delhi.
2.	Type of occupancy	Assembly (Restaurant)
3.	Building is comprised of	Basement + Ground + Mezzanine + 01 upper floor Basement – not part of restaurant Ground floor – seating area + kitchen Mezzanine floor- seating area 1 st floor – restaurant (other property independent entry & exits)
4.	Type of case:	New case
5.	Details of previous FSC:	No
6.	Fire safety directives no.:	NBC -Part IV/UBBL- 2016
7.	Date of inspection:	9.11.2022
8.	Name of the inspecting officer:	Rajesh Kumar Shukla, ADO (M. Road)
9.	Name and designation of the officer from the building side:	Mr. Ryan Rajput, Manager
10	Year of construction:	2000
11	Reference letter no.:	Email dated 14.10.2022

S.No	Minimum standard of Fire Prevention and Fire Safety U/R 33	Requirements (as per NBC/UBBL)	Provide at site	Remarks MR/NMR
1	Access to Building:			
	A Road width	6.0 mtrs.	9.0 mtrs.	MR
	B Gate width	NA	NA	NA
	C Width of internal roads	NA	NA	NA
2	Number, Width, Type & Arrangement of Exits:			
	A No. of Staircase:			
	a) Upper floor (Mezzanine floor)	2 nos.	2 nos.	MR
	b) Basements	2 nos.	2 nos.	MR
	B Width of the Staircase:			
	a) Upper floors (Mezzanine floor)	1.5 mtrs	2.0 mtrs & 1.60 mtrs	MR
	b) Basements	NA	NA	NA
	C Protection of Exits			
	a) fire check door	Required in continuous staircase communication from basement to terrace	Provided	MR
	b) pressurization	NA	NA	NA
	D No. of continuous staircase to terrace	01 no.	01 no.	MR
	E Width of the corridor	NA	NA	NA
	F Door size			
	a) Main exits	2.0 mtrs.	2.0 mtrs	MR
	b) Alternate exist	1.5 mtrs.	1.50 mtrs	MR
3	Compartmentation:			
	A Fire check doors	Required in kitchen	Provided	MR
	B Sealing of horizontal & vertical opening	NA	NA	NA
	C Fire rating of shaft doors	NA	NA	NA
	D Water curtain	NA	NA	NA
	E Fire dampers	NA	NA	NA
4	Smoke Management System:			
	A Basements	Mechanical/ Natural	Exhaust fan	MR
	B Upper floors	Mechanical/ Natural	Exhaust fan	MR
5	Fire Extinguishers:			
	A Total numbers	06 nos.	06 nos	MR
	B Types	ABC +CO ₂	ABC +CO ₂	MR
	C ISI marking	ISI marked	ISI marked	MR

6	First Aid Hose reel:				
	A	Total no. at each floor	01 no.	01 no.	MR
	B	Length of hose reel	30 m	30 m	MR
	C	Nozzle diameter	5 mm	5 mm	MR
7	Automatic Fire Detection and Alarm System (ADAS):				
	A	Type of detectors	NA	Provided	NA
	B	Location of main panel	NA	Provided	NA
	C	Location of repeater panel	NA	NA	NA
	D	Alternate power source	NA	Provided	NA
	E	Hooter's location	NA	Provided	NA
8	MOEFA:		Required	Provided	MR
9	Public Address System:		NA	NA	NA
10	Automatic Sprinkler System:				
	A	Basement	NA	Provided	NA
	B	Upper floor	NA	Provided	NA
	C	Sprinklers above false ceiling	NA	NA	NA
11	Internal Hydrants:				
	A	Size of down comer	100 mm	100 mm	MR
	B	No. of hydrants per floor	1 no	1 no	MR
	C	Hose box	1 no.	1 no.	MR
12	Yard Hydrants:				
	A	Total no. of hydrants	NA	NA	NA
	B	Hose box	NA	NA	NA
13	Pumping arrangements:				
	A Ground Level				
	a)	Discharge & head of main pump	NA	NA	NA
	b)	Number of main pump	NA	NA	NA
	c)	Discharge & head of jockey pump	NA	NA	NA
	d)	Discharge & head of standby pump	NA	NA	NA
	e)	Auto starting/ manual stopping	NA	NA	NA
	B Terrace Level				
	a)	Discharge of terrace pump	450 LPM	900 LPM	MR
	b)	Head of terrace pump	40 m	40 m	MR
	c)	Alternate power supply	Required	Provided	MR
	d)	Auto starting of pump	Auto	Provided	MR
14	Captive Water Storage for Fire Fighting:				
	A	Underground tank capacity	NA	NA	NA
	B	Draw off connection	NA	NA	NA
	C	Fire service inlet	NA	NA	NA
	E	Access to tank	NA	NA	NA
	D	Overhead tank capacity	20,000 Liters	Provided	MR
15	Exit Signage:		Required	Provided	MR
16	Provision of lift:				
	A	Pressurization of lift shaft	NA	NA	NA
	B	Pressurization of lift lobby	NA	NA	NA
	C	Communication in lift car	NA	NA	NA
	D	Fireman switch	NA	NA	NA
	E	Lift signage	NA	NA	NA
17	Standby Power Supply:		Required	Provided	MR

N/9

M/s FIG (A Unit of True To Plate Hospitality Pvt. Ltd), located at 3/48, Ground & Mezzanine floor, Malcha Marg, Diplomatic Enclave, Chanakypuri, New Delhi

18 Refuge Area:				
A	location	NA	NA	NA
B	Total area	NA	NA	NA
19 Fire Control Room:				
A	Fire detection system panel	NA	NA	NA
B	Flow switch panel	NA	NA	NA
C	P a system panel	NA	NA	NA
D	Battery backup	NA	NA	NA
E	Building floor plan	NA	NA	NA
20 Special Fire Protection for special risk if any				
A	Special Fire Protection system for Protection of Special Risk, if any:			NA

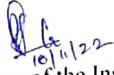
Meeting Requirement (MR), Not Meeting Requirement (NMR), Not Applicable (NA), Not Provided (NP) Provide Not Functional (PNF).

Note : The restaurant management has declared that the Basement is not part of the restaurant and the entry to the basement was found independent from the restaurant.


The fire protection systems provided in the building were tested checked and found properly functional at the time of inspection.

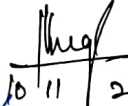
The shortcoming issued by this department vide letter no. No.F6/DFS/MS/EH/SZ/2022/569 dated 14.09.2022 has been rectified by the restaurant management.

Keeping in view the substantial compliance of the minimum standards on fire prevention and fire safety required under the Rules, it is recommended to grant Fire Safety Certificate under Rule 35 of the Delhi Fire Service Rules 2010.


Signature of the Inspecting Officer
Name Rajesh Kumar Shukla
Designation ADO (M. Road)

~~DO (SZ)~~
mrul

~~DO (SZ)~~ 
10/11/22

~~Director~~ 
10/11/2022

Director

any one copy to be put up. No physical copy should be given anyone


11/11/22

Asst/ Mrul