



e/33

75  
आजादी का  
अमृत महोत्सव

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEAD QUARTERS: DELHI FIRE SERVICE, NEW DELHI - 110001**

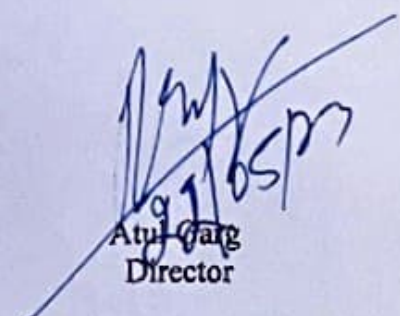
No. F6/DFS/MS/WZ/COS/2023/ 242

Dated: 23/05/2023

**FIRE SAFETY CERTIFICATE**

Certified that the M/s. Shree Balaji Cosmetics Located at Plot No.-54, Pvt No.- B-10, Najafgarh Road, Industrial Area, Rama Road, New Delhi-110015, in a building comprised of Basement + Ground + 02 Upper Floors, owned/occupied by M/s. Shree Balaji Cosmetics was issued Fire safety Certificate vide Letter No. F6/DFS/MS/2020/WZ/COS/224 dated 25/06/2020, The premises was re-inspected by officer concerned of this department on 09/05/2023 in the presence of Sh. Mukesh Kr. Goyal and found that the said building/Premises have deemed complied with the fire prevention & fire safety requirements in accordance with Rule 33 of Delhi Fire Service Rule 2010 & the said premises is fit for occupancy class "Industrial" Group G with effect from 23/05/2023 for a period of three year in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules 2010 condition mentioned below.

Issued on 23/05/2023 at New Delhi by.

  
Atul Garg  
Director

**Copy to:**

1. The Owner/occupier M/s. Shree Balaji Cosmetics , at Plot No.-54, Pvt No.- B-10, Najafgarh Road, Industrial Area, Rama Road, new Delhi-110015.
2. The Executive Engineer (Building), MCD, Shivaji Enclave, Rajouri Garden New Delhi-110027.

12  
SPP  
19/5/2023



## INSPECTION REPORT

1. Name & address of the building	M/s. Shree Balaji Cosmetics, Plot No.-54, Pvt No.- B-10, Najafgarh Road, Industrial Area, Rama Road, new Delhi-110015.
2. Type of Occupancy	Industry (Basement+ Ground + 02 Upper floors)
3. Type of Case	Renewal
4. Details of previous NOC	F6/DFS/MS/2020/WZ/COS/224 dated 25/06/2020
5. Fire Safety directives letter No	Nil
6. Date of inspection	09/05/2023
7. Name of the Inspecting Officers	Sarabjeet Singh ADO (MN)
8. Name and designation of officers from the building side	Sh. Museh Kr. Goyal
9. Year of Construction	2004 (As per prev, Insp. report dtd- 12/06/2020)
10. Applicant's letter No.	Outdoor Diary No.- 143 dated 06/04/2023

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	BBL /NBC Requirement / As per prev, Insp. report dtd- 12/06/2020	Provided at site	Remarks MR/NMR
1	<b>Access to building</b>			
	• Road width	Accessible	Accessible	MR
	• Gate width	Accessible	Accessible	MR
	• Width of internal road	NA	NA	NA
2	<b>Number, Width, Type &amp; Arrangement of Exits</b>			
	a. Number of staircases			
	• Upper Floors	01	Provided	MR(Old Case)
	• Basements	02	Provided	MR(Old Case)
	b. Width of staircases			
	• Upper Floors	Old Case	1.05 mtr Provided	MR(Old Case)
	• Basements	Old Case	1.05 mtr, 0.60 cm Provided	MR(Old Case)
	c. Protection of exits			
	• Fire check door	NA	NA	NA
	• Pressurization	NA	NA	NA
	e. No. of continuous staircases to terrace	01	NA	NA
	f. Width of Corridor	NA	NA	NA
	g. Door Size	Old Case	1.0 mtr Provided	MR(Old Case)
3	<b>Compartmentation.</b>			
	• Fire check door	NA	NA	NA
	• Sealing of electrical shafts	NA	NA	NA
	• Fire Rating of shaft door	NA	NA	NA
	• Water Curtain	NA	NA	NA
	• Fire Dampers	NA	NA	NA
4	<b>Smoke Management System.</b>			
	• Basements	Required	Provided	MR
	• Upper floors	NA	NA	NA
5	<b>Fire Extinguishers</b>			
	• Total numbers	06	Provided	MR
	• Types	CO <sub>2</sub> , ABC type	Provided	MR
	• IS marking	ISI marked	Provided	MR

4/      8/



6	<b>First-Aid Hose Reels.</b>			
	• Total numbers on each floor	01	Provided	MR
	• Length of hose reel hose	30m	Provided	MR
	• Nozzle diameter	5mm	Provided	MR
7	<b>Automatic fire detection and alarming system.</b>			
	• Type of detectors	NA	NA	NA
	• Location of Main Panel	NA	NA	NA
	• Location of Repeater Panel	NA	NA	NA
	• Alternate source of power	NA	NA	NA
	• Hooters' Location	NA	NA	NA
8	<b>MOEFA</b>			
9	<b>Public Address System.</b>			
		NA	NA	NA
10	<b>Automatic Sprinkler System.</b>			
	• Basement	Required	Provided	MR
	• Upper Floor	NA	Provided	NA
	• Sprinkler above false ceiling	NA	NA	NA
11	<b>Internal Hydrants</b>			
	• Size of riser/down-comer	100 mm	Provided	MR
	• Number of hydrants per floor	01	Provided	MR
	• Hose Box	01	Provided	MR
12	<b>Yard Hydrants.</b>			
	• Total number of hydrants	NA	NA	NA
	• Hose Box	NA	NA	NA
13	<b>Pumping Arrangements.</b>			
	• Ground Level			
	➤ Discharge of main Pump	NR	NR	NR
	➤ Head of Main pump	NR	NR	NR
	➤ Number of main pumps	NR	NR	NR
	➤ Jockey Pump out put	NR	NR	NR
	➤ Jockey pump head	NR	NR	NR
	➤ Standby Pump out put	NR	NR	NR
	➤ Standby Pump Head	NR	NR	NR
	➤ Auto Starting/ Manual stopping	NR	NR	NR
	➤ Pump House Access	NR	NR	NR
	• Terrace level			
	➤ Discharge of pump	450 lpm	Provided	MR
	➤ Head of the pump	40 m	Provided	MR
	➤ Power Supply	Required	Provided	MR
	➤ Auto Starting of pump	Required	Provided	MR
14	<b>Captive Water Storage for fire fighting.</b>			
	• Underground tank capacity	NR	NR	NR
	➤ Draw-off connection	NR	NR	NR
	➤ Fire service inlet	NR	NR	NR
	➤ Access to tank	NR	NR	NR
	• Overhead Tank capacity	2500 ltrs	Provided	MR
15	<b>Exit Signage.</b>			
		Required	Provided	MR



Provision of Lifts.				
	<ul style="list-style-type: none"> <li>• Pressurization of Lift Shaft</li> <li>• Pressurization of Lift lobby</li> <li>• Communication In lift Car</li> <li>• Fireman's Grounding Switch</li> <li>• Lift Signage</li> </ul>	NA	NA	NA
		NA	NA	NA
		NA	NA	NA
		NA	NA	NA
		NA	NA	NA
17	Standby power supply	NA	NA	NA
18	Refuge Area.			
	<ul style="list-style-type: none"> <li>✓ Total Area</li> <li>✓ Location</li> </ul>	NA	NA	NA
		NA	NA	NA
19	Fire Control Room			
	<ul style="list-style-type: none"> <li>• Detector System Panel</li> <li>• Flow Switch Panel</li> <li>• PA System Panel</li> <li>• Batter backup</li> <li>• Building Floor Plans</li> </ul>	NA	NA	NA
		NA	NA	NA
		NA	NA	NA
		NA	NA	NA
		NA	NA	NA
20	Special Fire Protection Systems for Protection of special Risks, if any:	NA	NA	NA

The fire protection systems provided in the building were checked and found functional at the time of inspection. The Shortcomings issued by this department vide Letter no. F6/DFS/MS/WZ/2023/701 Dated-11/04/2023 have been compiled.

Keeping in view of the deemed compliance of minimum standards of fire prevention and fire safety measures as required under the rules, the NOC vide letter no F6/DFS/MS/2020/WZ/COS/224 Dated- 25/06/2020 renewal under the rule 35 of the Delhi Fire Service rules 2010 is recommended.

~~DO (w/est)~~

~~Signature~~  
11/5/2023

Signature of the Inspecting Officer  
Name: - Sarabjeet Singh  
Designation: - ADO (MN)

ADO/MN  
10/5/2023  
10/20/2023  
11/05/2023

11/5  
(M.K. Chattopadhyay)

cfb

15/5/2023

Director  
16/5/23

ADOMN

Sr. F. T is put up for your kind personal & signature please.