

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI-110001

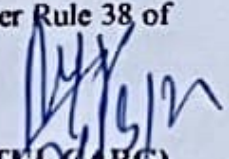
No F.6/DFS/MS/Hostel/2023/SZ/ 963

Dated: 30/05/2023

FIRE SAFETY CERTIFICATE

Certified that the Intern Hostel (Part of Phase-II), Institute of Liver & Biliary Sciences Hospital located at Plot No D-I, Vasant Kunj, New Delhi-110070 comprised of Ground + 08 upper floors Owned/Occupied by Institute of Liver & Biliary Sciences was issued Fire Safety Certificate by this department vide letter No. F6/DFS/MS/Hostel/2018/SZ/2443 Dated 31-10-2018. The premises was re-inspected by officer concerned of this department on 12/05/2023 in the presence of Mr. Laxman and observed that the said building have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the building is fit for occupancy class "Residential Group-A" (Hostel) as above with effect from 30/05/2023 for period of Five years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules, 2010

Issued 30/05/2023 at New Delhi by


(ATUL KARG)
DIRECTOR
DELHI FIRE SERVICE

Copy to: -

1. Lt. Col. R.S. Singh (Retd.), DHO (NM/HR), Institute of Liver & Biliary Sciences Hospital, Plot No D-I, Vasant Kunj, New Delhi-110070

Conditions for the validity of Fire Safety Certificate:

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangement provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of fire fighting system.
4. The owner/occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or Alteration (Clause 1.4.3 of UBBL-2016), if any.
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry.

N/47

INSPECTION REPORT

1	Name & Address of the Building	Intern Hostel (Part of Phase-II), Institute of Liver & Biliary Sciences, Plot No. D-I, Vasant Kunj, N. Delhi		
2	Type of Occupancy	Residential building, "Group-A" (Hostel)		
3	Building Comprised of	Ground + 08 upper floors.		
4	Type of Case	Renewal		
5	Details of Previous NOC	F6/DFS/MS/Hostel/2018/SZ/2443 Dated 31-10-2018		
6	Fire Safety Directives Letter No	F6/DFS/MS/Hospital/2011/723 dated 21-04-2011		
7	Date of Inspection	12-05-2023		
8	Name of the Inspecting Officers	ADO (BCP)		
9	Name & Designation of Officers from the building side	Mr. Laxman		
10	Year of construction	2015		
11	Applicant letter No.	F2/81/ONM/ILBS/2025/Fire & Security/CID-9057/1213-1215 dated 05-05-2023		

S. No. Minimum standards on Fire Prevention and Fire Safety U/R 33

1	Access to Building.	Old NOC Requirements	Provided at Site	Remarks MR/NMR
	<ul style="list-style-type: none"> Road width Gate width Width of internal road 	9 mtr	Provided	MR
		6 mtr	Provided	MR
		5 mtr	Provided	MR
2	Number, width, type & arrangement of exits.			
	a) Number of Staircase			
	➤ Upper floors	02 Nos	Provided	MR
	➤ Basement floor	-NA-	-NA-	-NA-
	b) Width of Staircase			
	➤ Upper floors	1.5 mtr each	Provided	MR
	➤ Basement floor	-NA-	-NA-	-NA-
	c) Protection of exits			
	➤ Fire check door	Required	Provided	MR
	➤ Pressurization	Required	Provided	MR
	d) No. of continuous staircase to terrace	Required	02 Nos	MR
	e) Width of corridor	1.5m	Provided	MR
	f) Door size	1m	Provided	MR
3	Compartmentation.			
	• Fire check door	Required	Provided	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire rating of shaft door	-NA-	-NA-	-NA-
	• Water curtain	-NA-	-NA-	-NA-
	• Fire dampers	-NA-	-NA-	-NA-
4	Smoke Management system.			
	• Basement	30 ACPH	-NA-	-NA-
	• Upper floors	12 ACPH	Natural ventilation	MR
5	Fire Extinguishers.			
	• Total numbers	Required	40 Nos	MR
	• Types	ABC/CO2/W.CO2	ABC, CO2 & W CO2	MR
	• ISI Marking	ISI marked	Provided	MR
6	First Aid Hose Reels.			
	• Total numbers on each floor	02 Nos	Provided	MR
	• Length of hose-reel hose	30m	Provided	MR
	• Nozzle Diameter	5mm	Provided	MR

Intern Hostel (Part of Phase-II), Institute of Liver & Biliary Sciences, Plot No. D-I, Vasant Kunj, N. Delhi

M

7	Automatic fire detection & alarming system.			
	• Type of detectors	-NA-	-NA-	-NA-
	• Location of Main Panel	-NA-	-NA-	-NA-
	• Location of Repeater Panel	-NA-	-NA-	-NA-
	• Alternate source of power	-NA-	-NA-	-NA-
	• Hooter's location	-NA-	-NA-	-NA-
8	MOEFA	Required	Provided	MR
9	Public Address System	Required	Provided	MR
10	Automatic Sprinkler System			
	• Basement	-NA-	-NA-	-NA-
	• Upper floors.	-NA-	-NA-	-NA-
	• Sprinkler above false ceiling	-NA-	-NA-	-NA-
11	Internal Hydrants.			
	• Size of Riser/Down-comer	100 mm	Provided	MR
	• Number of Hydrant per floor	02 Nos	Provided	MR
	• Hose box.	02 Nos	Provided	MR
12	Yard Hydrants.			
	• Total number of hydrants.	07 Nos	Provided	MR
	• Hose box	07 Nos	Provided	MR
13	Pumping arrangements.			
	• Ground Level	-NA-	-NA-	-NA-
	➢ Discharge of main pump.	-NA-	-NA-	-NA-
	➢ Head of main pump.	-NA-	-NA-	-NA-
	➢ Number of main pumps.	-NA-	-NA-	-NA-
	➢ Jockey Pump output.	-NA-	-NA-	-NA-
	➢ Jockey Pump head.	-NA-	-NA-	-NA-
	➢ Standby Pump output.	-NA-	-NA-	-NA-
	➢ Standby Pump head.	-NA-	-NA-	-NA-
	➢ Auto Starting/Manual Stopping.	-NA-	-NA-	-NA-
	➢ Pump house access.	-NA-	-NA-	-NA-
	• Terrace Level	900 LPM	Provided	MR
	➢ Discharge of pump.	40m	Provided	MR
	➢ Head of pump.	Required	Provided	MR
	➢ Power supply.	Required	Provided	MR
	➢ Auto starting of pump.			
14	Captive water storage for fire fighting.			
	• Underground tank capacity.	-NA-	-NA-	-NA-
	➢ Draw-off connection.	-NA-	-NA-	-NA-
	➢ Fire Service Inlet.	-NA-	-NA-	-NA-
	➢ Access to tank.	25,000 Ltr	35,000 Ltr	MR
	• Overhead tank capacity.	Required	Provided	MR
15	Exit Signage			
16	Provision of Lifts.			
	• Pressurization of lift shaft.	-NA-	-NA-	-NA-
	• Pressurization of lift lobby.	-NA-	-NA-	-NA-
	• Communication in lift car.	Required	Provided	MR
	• Fireman's switch.	Required	Provided	MR
	• Lift signage.	Required	Provided	MR
		Required	Provided (DG Set)	MR
17	Standby Power Supply			
18	Refuge Area			
	• Total area	-NA-	-NA-	-NA-
	• Location	-NA-	-NA-	-NA-

27

1

19.	Fire Control Room.			
	• Detector system panel.	NA	NA	NA
	• Flow switch panel.	-NA-	-NA-	-NA-
	• PA system panel.	-NA-	-NA-	-NA-
	• Battery backup.	-NA-	-NA-	-NA-
	• Building floor plan.	-NA-	-NA-	-NA-
20.	Special Fire Protection System for the Protection of special Risk, if any.	Required	CO2 type fire extinguishers provided near electrical panel	MR

The Fire protection systems provided in the building were checked/ tested at random and found functional at the time of inspection.

Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the FSC issued vide letter No F6/DFS/MS/Hostel/2018/SZ/2443 Dated 31-10-2018, renewal under rule 37 of the Delhi Fire Service Rules, 2010 is recommended.

Accordingly DFA is put up for approval and signature please.

Sh
13/11/2023

Signature of the Inspecting Officer
Name: Sh. Rajesh Kumar
Design: ADO (BCP)

Intern Hostel (Part of Phase-II), Institute of Liver & Biliary Sciences, Plot No. D-I, Vasant Kunj, N. Delhi

~~DO (South) on leave~~

~~CFO (HQ)~~

Mans
20/11/23
Vijay
24/11/2023
Director *[Signature]*
20/11/23

Approved
[Signature]

As approved, F.T. letter is put up for
your signature PI

[Signature]
26/11

Director *[Signature]*
26/11/23
[Signature]