



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CANNAUGHT PLACE
NEW DELHI- 110 001

No. F.6/DFS/MS/BNQT/2023/NDZ/ 33

Dated: 24/08/2023

FIRE SAFETY CERTIFICATE

Certified that the Silver Line Banquet Hall located at D-58, Dilshad Colony, Shahdara, Delhi-110095 building comprised of basement, stilt, ground plus two upper floors, owned/occupied by Silver Line was inspected by the officers concerned of this department on dated 16/08/2023 in the presence of Mr. Nitin Gupta and found that all the fire prevention and fire safety arrangements provided in the premises found in good working condition. The premises have complied with rule 33 of the Delhi Fire Service Rules, 2010 and that the building/premises is fit for occupancy Group 'D' "Assembly" with effect from 24/08/2023 valid up to 31/03/2026 in accordance with the rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010, printed below.

Issued on.... 24/08/2023at New Delhi by

(ATUL GARG)
DIRECTOR
DELHI FIRE SERVICE

To,

1. Mr. Nitin Gupta
Silver Line Banquet Hall at D-58, Dilshad Colony, Shahdara, Delhi-110095
2. The Joint Commissioner of Police (Lic.),
1st Floor Police Station, Defense Colony, New Delhi
MHA ID No. 2023080113761

Conditions for the validity of Fire Safety Certificate

1. All the means of escape shall be kept free of all type of obstruction all the time.
2. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
3. All the fire fighting equipment shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
4. Any deviation, with regards to construction, ventilation, occupancy, electric installation etc. may be got verified from the concerned authorities.
5. This Fire Safety Certificate may not be treated in any case for regularizations of unauthorized construction /unauthorized use of land if any.
6. The owner / occupier shall apply for renewal of this Fire Safety Certificate of the Director in Form 'J' [sub rule (1) of rule (37)] along with a copy of this Certificate, Six Months prior to its expiry.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in

INSPECTION REPORT

1. Name & address of the building : Silver Line Banquet Hall, D-58, Dilshad Colony, Shahdara, Delhi-110095.
2. Building is comprised of : Basement, Stilt, Ground, First & Second floor.
3. Type of Occupancy : Assembly (Banquet Hall)
4. Type of Case : New
5. Details of previous NOC : N/A
6. Fire Safety directives Letter No. : F6/DFS/MS/BP/2022/BNQT/215 Dated 21/11/2022
7. Date of inspection : 14/08/2023
8. Name of the Inspecting Officer : DO A.K. Jaiswal (ED) & ADO Deepak Kumar (Shah)
9. Name and designation of Officer from the building side : Sh. Nitin Gupta
10. Year of Construction : 2021
11. Applicant's E-mail : 2023080113761 dated 02/08/2023

S.No	Minimum Standards on fire prevention and fire safety U/R 33	Directive Requirement	Provided at Site	Remarks
1	Access to building			
	• Road width	12 m	18 m	MR
	• Gate width	N/A	N/A	N/A
	• Width of internal road	N/A	N/A	N/A
2	Number, Width, Type and Arrangement of Exits			
	a. Number of Staircases			
	• Upper Floor	02 nos.	02 nos.	MR
	• Basement	02 nos.	02 nos.	MR
	b. Width of Staircases			
	• Upper Floor	2.00 m	2.00 m x 2	MR
	• Basement	2.00 m	2.00 m x 2	MR
	c. Protection of exits			
	• Fire check door	Required	Provided	MR
	• Pressurization	Required	Provided	MR
	d. No. of continuous staircases to terrace	02 nos.	02 nos.	MR
	e. Width of Corridor	N/A	N/A	N/A
	f. Door size	2.00 m	2.00 m	MR
3	Compartmentation			
	• Fire check Door	Required	Provided	MR
	• Sealing of electrical Shafts	Required	Provided	MR
	• Fire rating of Shaft Door	N/A	N/A	N/A
	• Water Curtain	N/A	N/A	N/A
	• Fire Dampers	N/A	N/A	N/A
4	Smoke Management System			
	• Basement	12 a/c per hour	Provided	MR
	• Upper Floor	12 a/c per hour	Provided	MR
5	Fire Extinguishers			
	• Total Numbers	10 Nos.	20 Nos.	MR
	• Types	ABC & Co2	ABC & Co2	MR
	• IS Marking	ISI Marked	ISI Marked	MR

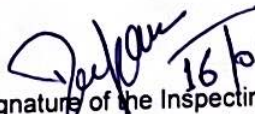
24/8/23

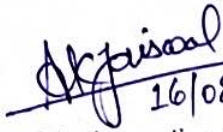
6	First-aid-Hose Reels			
	Total numbers of each floor	01 no.	01 no. ✓	MR
	• Length of hose reel hose	30 m	30 m ✓	MR
	• Nozzle diameter	05 mm	05 mm	MR
7	Automatic fire detection and alarming system			
	• Type of detectors	Required	Provided ✓	MR
	• Location of main panel	Required	Provided	MR
	• Location of repeater panel	Alternate Floor	Provided	MR
	• Alternate source of power	Required	Provided	MR
	• Hooter's Location	Ground Floor	Provided	MR
8	MOEFA	Required	Provided ✓	MR
9	Public address System	Required	Provided ✓	MR
10	Automatic Sprinkler System			
	• Basement	Required	Provided	MR
	• Upper Floor	Required	Provided	MR
	• Sprinkler above false Ceiling	Required	Provided	MR
11	Internal Hydrants			
	• Size of rise/down-comer	100 mm	100 mm ✓	MR
	• Number of Hydrants per Floor	01 nos.	01 nos. ✓	MR
	• Hose Box	01 nos.	01 nos.	MR
12	Yard Hydrants			
	• Total number of Hydrants	Required	Provided	MR
	• Hose Box	Required	Provided	MR
13	Pumping Arrangement			
	• Ground Level			
	➤ Discharge of main Pump	2280 LPM	2280 LPM ✓	MR
	➤ Head of Main Pump	60 m	60 m ✓	MR
	➤ Number of main Pumps	01 nos.	01 nos.	MR
	➤ Jockey pump output	180 LPM	180 LPM	MR
	➤ Jockey pump head	60 m	60 m	MR
	➤ Standby pump output	2280 LPM	2280 LPM	MR
	➤ Standby pump head	60 m	60 m	MR
	➤ Auto starting/Manual stopping	Required	Provided	MR
	➤ Pump house access	Required	Provided	MR
	• Terrace Level			
	➤ Discharge of pump	900 LPM	900 LPM	MR
	➤ head of the pump	40 m	40 m	MR
	➤ Power supply	Required	Provided	MR
	➤ Auto Starting of pump	Required	Provided	MR
14	Captive Water Storage for Fire Fighting			
	• Underground tank capacity	1,00,000 Ltrs.	1,00,000 Ltrs. ✓	MR
	➤ Draw-off connection	Required	Provided	MR
	➤ Fire service inlet	Required	Provided	MR
	➤ Access to tank	Required	Provided ✓	MR
	• overhead Tank capacity	25,000 Ltrs.	25,000 Ltrs. ✓	MR
15	Exit Signage	Required	Provided	MR


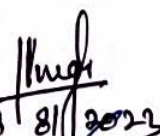
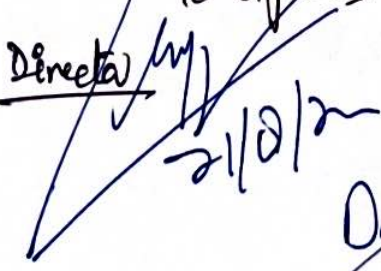
16	Provision of Lifts	• Pressurization of Lift Shaft	Required	Provided	MR
		• Pressurization of Lift lobby	Required	Provided	MR
		• Communication in lift car	Required	Provided	MR
		• Firemen's grounding switch	N/A	N/A	MR
		• Lift Signage	Required	Provided	MR
		17	Standby power supply	Required	Provided
18	Refuge Area	• Total area	N/A	N/A	N/A
		• Location	N/A	N/A	N/A
19	Fire Control Room	• Detector system panel	N/A	N/A	N/A
		• Flow switch panel	N/A	N/A	N/A
		• PA system panel	N/A	N/A	N/A
		• Battery backup	N/A	N/A	N/A
		• Building floor plans	N/A	N/A	N/A
		20	Special Fire Protection systems for protection of special Risks, if any:	N/A	N/A

The fire protection systems provided in the building were tested/checked and found functional at the time of inspection. The shortcomings as communicated earlier vide letter no. F.6/DFS/MS/BNQT/2023/NDZ/50 dated 01/03/2023 have been rectified now.

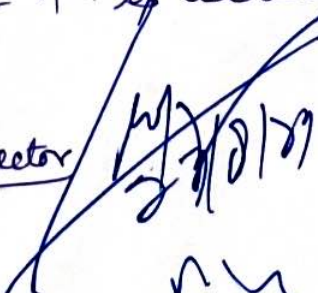
Keeping in view the substantial compliance of the minimum standards on fire prevention and fire safety required under the rule. It is recommended to grant Fire Safety Certificate under rule 35 of the Delhi Fire Service Rules 2010.



 Signature of the Inspecting Officer
 Name : Deepak Kumar
 Designation : ADO


 Signature of the Inspecting Officer
 Name : A.K. Jaiswal
 Designation : DO (ED)

~~Dy. CFO (NDZ)~~ 
 C.F.O. 
 Director 
 Dy. ED

F.T. is added for signature & base.

~~Director~~ 
 nu


 23/08/2023

Uploaded
 24/8/23

