



No.F6/DFS/MS/School/NDZ/2023/ 607

Dated: 19/12/2023

FIRE SAFETY CERTIFICATE

Certified that the M/s V3S Mall located at Plot No.10, District Centre, Laxmi Nagar, Delhi-110092, comprised of basement plus ground plus three upper floors owned/occupied by M/s V3S Infratech Limited was issued FSC vide letter no. F6/DFS/MS/NDZ/2021/136 dated 19.02.2021. The multiplex / mercantile building (Mix Occupancy) was re-inspected by the officers concerned of this department along with team of V3S mall on dated 09/12/2023 in presence of Mr. Vineet Kant Parashar (Manager) and found that the said building have deemed complied with the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010 and that the premises is fit for occupancy Group "Multiplex / Mercantile Building" with effect from 19/12/2023 for period of three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rule 2010, printed below.

Issued on 19/12/2023 at New Delhi by.

(ATUL GARG)
DIRECTOR
DELHI FIRE SERVICE

Copy to:-

1. The Dy. Director (Bldg.), C & I, DDA, C-1, 2nd floor, Vikas Sadan, New Delhi.
2. The Manager, V3S Infratech Limited located at Plot No. 10, District Centre, Laxmi Nagar, Delhi-110092.

Conditions for the validity of Fire Safety Certificate

1. The owner /occupier shall apply for renewal of this fire safety certificate to the Director in form 'J' [sub rule(1) of rule 37] along with a copy of this certificate, six months prior to its expiry
2. All the means of escape shall be kept free of all the type of obstruction all the time.
3. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
4. All the fire fighting equipments shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
5. The clarification with regards electrical installation, ventilation, structure stability set back areas, occupancy and constructional deviation in building etc .may be got verified from the authorities concerned.
6. This Fire Safety Certificate cannot be treated in any case for regularizations of unauthorized construction unauthorized use of land if any.
7. Basement shall be used as per NBC/UBBL.
8. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in.

INSPECTION REPORT


1	Name & address of the building	V3S Mall located at Plot No.10, District Centre, Laxmi Nagar, Delhi -110092.					
2	Building is comprised of	Basement, Ground + 03 upper floors only.					
3	Type of occupancy	Multiplex/Mercantile (Mixed Occupancy)					
4	Type of case	Renewal					
5	Details of previous FSC	F6/DFS/MS/NDZ/2021/136 dated 19.02.2021					
6	Fire safety directives letter no.	F6/MS/DFS/BP/2018/3538 dated 16/08/2018					
7	Date of inspection	12.12.2023					
8	Name of the inspecting officers	S.k Dua, DCFO/NDZ & Yashwant Singh Meena ADO (L.N)					
9	Name of the designation of officer from the building side	Mr. Vineet Kant Parashar (Manager)					
10	Year of construction	2019 - 20					
11	Applicant's letter no.	Outdoor dairy no.10136 dated 28/11/2023					
S.No	Minimum standard of fire prevention and fire safety U/R 33	Requirement as per Directive	Provided at site	Remarks MR/NMR			
1	Access to Building:						
	A	Road width	12 mtrs.	36 mtrs. & 13.8 mtrs.	MR		
	B	Gate width	4.50 mtrs	06 mtrs.	MR		
	C	Width of internal road	06 mtrs	06 mtrs.	MR		
2	Number, Width, Type and Arrangement of Exits:						
	A	Number of staircases					
		a	Upper floor	02 nos.	06 nos.	MR	
		b	Basement	02 nos.	03 nos. + 01 ramp	MR	
	B	Width of staircases					
		a	Upper floor	2.0 mtrs & 1.50 mtrs.	2.0 mtrs, 1.50 mtrs. & 1.8 mtrs.	MR	
		b	Basement	1.50 mtrs.	1.50 mtrs. & 01 mtrs.	MR	
	C	Protection of exits					
		a	Fire check door	Required	Provided	MR	
		b	Pressurization	Required	Sealed	MR	
	D	No. of continuous staircases to terrace			01 no.	01 no.	MR
	E	Width of corridor			02 mtrs.	2.50 mtrs.	MR
	F	Door size			2.0 mtrs & 1.50 mtr.	2.0 mtrs & 1.50 mtrs.	MR
3	Compartmentation:						
	A	Fire check door			Required	Provided	MR
	B	Sealing of electrical shafts			Required	Provided	MR
	C	Fire rating of shaft door			02 hrs	Provided	MR
	D	Water curtain			N/A	N/A	N/A
	E	Fire dampers			N/A	N/A	N/A
4	Smoke Management System:						
	A	Basement			30 a/c per hrs	Provided	MR
	B	Upper floor			12 a/c per hrs	Provided	MR

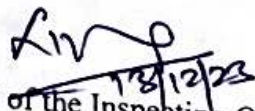
5. Fire Extinguisher:				
A	Total numbers	20 nos.	35 nos.	MR
B	Types	CO ₂ & ABC	CO ₂ & ABC	MR
C	ISI marking	ISI Marked	ISI Marked	MR
6 First-Aid-Hose Reel:				
A	Total numbers of each floor	02 no.	02 no.	MR
B	Length of hose reel hose	30 mtrs.	30 mtrs.	MR
C	Nozzle diameter	05 mm	05 mm	MR
7 Automatic Fire Detection and Alarming System:				
A	Type of detectors	Smoke/Heat	Provided	MR
B	Location of main panel	Control room	Provided	MR
C	Location of repeater panel	Security room	Provided	MR
D	Alternate source of power	Batter & DG Set	Provided	MR
E	Hooters location	Staircase	Provided	MR
8	MOEFA:	Required	Provided	MR
9	Public Address System:	Required	Provided	MR
10 Automatic Sprinkler System:				
A	Basement	Required	Provided	MR
B	Upper floor (P.S. Only)	Required	Provided	MR
C	Sprinkler above false ceiling	Required	Provided	MR
11 Internal Hydrants:				
A	Size of riser/down-comer	150 mm	150 mm	MR
B	Number of hydrants per floor	02 nos.	02 nos.	MR
C	Hose box	02 nos.	02 nos.	MR
12 Yard Hydrants:				
A	Total number of hydrants	05 nos.	05 nos.	MR
B	Hose box	05 nos.	05 nos.	MR
13 Pumping Arrangements:				
1 Ground level				
A	Discharge of main pump	2850 LPM	2850 LPM	MR
B	Head of main pump	70 M	70 M	MR
C	Number of main pumps	01 no	01 no	MR
D	Jockey pump out put	180 LPM	180 LPM	MR
E	Jockey pump head	70 M	70 M	MR
F	Standby pump out put	2850 LPM	2850 LPM	MR
G	Standby pump head	70 M	70 M	MR
H	Auto starting /manual stopping	Required	Provided	MR
I	Pump house access	Required	Provided	MR
2 Terrace Level				
A	Discharge of pump	N/A	N/A	N/A
B	Head of the pump	N/A	N/A	N/A
C	Power supply	N/A	N/A	N/A
D	Auto starting of pump	N/A	N/A	N/A

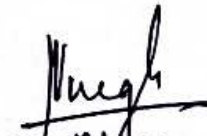

14	Captive Water Storage for Fire Fighting:			
A	Underground tank capacity	1,00,000 Ltr	1,50,000 Ltr	N/A
B	Draw-off connection	Required	Provided	MR
C	Fire service inlet	Required	Provided	MR
D	Access to tank	Required	Provided	MR
E	Overhead tank capacity	20,000 ltrs	40,000 ltrs.	MR
15	Exit Signage:			
16	Provision of Lifts:			
A	Pressurization of lift shaft	Required	Provided	MR
B	Pressurization of lift lobby	Required	Provided	MR
C	Communication in lift car	Required	Provided	MR
D	Firemen's grounding switch	Required	Provided	MR
E	Lift signage	Required	Provided	MR
17	Standby Power Supply:			
18	Refuge Area:			
A	Total area	N/A	N/A	N/A
B	Location	N/A	N/A	N/A
19	Fire Control Room:			
A	Detector system panel	Required	Provided	MR
B	Flow switch panel	Required	Provided	MR
C	PA system panel	Required	Provided	MR
D	Battery backup	Required	Provided	MR
E	Building floor plans	Required	Provided	MR
20	Special Fire Protection systems for protection of special Risks, if any:			
		Required for HT/LT Panels	Provided in all HT & LT Panels	MR

The Fire protection systems provided in the building were tested, checked and found functional at the time of inspection.

In view of above deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules. The NOC / FSC was issued vide letter no. F6/DFS/MS/NDZ/2021/136 dated 19.02.2021 renewal under rule 35 of the Delhi Fire Service rules 2010 is recommended.



 Signature of the Inspecting Officer
 Name: Yashwant Singh Meena
 Designation: A.D.O. (L.N.)


 Signature of the Inspecting Officer
 Name: S.K. Dua
 Designation: Dy.CFO/NDZ

cf/0 
 15/12/2022
 Director 
 15/12/2022
 ADY LON

F.T Letter is put up for sign. Please.

Director 
 19/12/2022


 19/12/2022