



No. F6/DFS/MS/School/NDZ/2024/ 278

Dated: 04/04/2024

FIRE SAFETY CERTIFICATE

Certified that Florence Public School running at ground plus two upper floors only located at 19 - A, Pratap Nagar, Mayur Vihar Phase - I, Delhi - 110091, building comprised of Ground plus three upper floors, owned / occupied by Florence Public School, was issued Fire Safety Certificate vide letter No F6/DFS/MS/School/2018/NDZ/2225 dated 03.10.2018. The school building was re-inspected by the officer concerned of this department on 27/03/2024 in presence of Mrs. Vibha Khanna (Manager) and observed that all the fire prevention and fire safety arrangements provided in the premises found in good working condition. The premises have therefore deemed complied with the Fire Prevention and Fire Safety requirements in accordance with Circular No. 262 - 362 dated 17/01/2005 issued by Director of Education and that the building is fit for occupancy class "Educational Building" (Group-B) with effect from 04/04/2024 for a period of three years in accordance with rule 36 unless renewal under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the DFS rule 2010.

Issued on 04/04/2024 at New Delhi by.

(ATUL GARG)
DIRECTOR
o/c DELHI FIRE SERVICE

Copy to: -

1. The Director of Education, Govt. of NCT, Old Sectt., Delhi - 110054
2. The Manager Florence Public School at 19 - A, Pratap Nagar, Mayur Vihar Phase - I, Delhi - 110091.

Conditions for the validity of Fire Safety Certificate

1. The owner /occupier shall apply for renewal of this fire safety certificate to the Director in form 'J' [sub rule (1) of rule 37] along with a copy of this certificate, six months prior to its expiry
2. All the means of escape shall be kept free of all the type of obstruction all the time.
3. All the employees shall be acquainted with the use and maintenance of all fire equipment's and method of smooth and speedy safe evacuation of occupants in case of emergency.
4. All the fire fighting equipment's shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
5. The clarification with regards electrical installation, ventilation, structure stability set back areas, occupancy and constructional deviation in building etc. may be got verified from the authorities concerned.
6. This Fire Safety Certificate cannot be treated in any case for regularizations of unauthorized construction unauthorized use of land if any.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in.

N/12

INSPECTION REPORT

1	Name & address of the building	Florence Public School located at 19 - A, Pratap Nagar, Mayur Vihar Phase - I, Delhi - 110091.		
2	Building is comprised of	Ground + 03 upper floors. (But school running ground plus two upper floors only)		
3	Type of occupancy	Educational Building		
4	Type of case	Renewal		
5	Details of previous FSC	F6/DFS/MS/School/2018/NDZ/2225 dated 03.10.2018		
6	Fire safety directives letter no.	Circular No. 262 - 362 Dated 17/01/2005		
7	Date of inspection	27/03/2024		
8	Name of the inspecting officers	Yashwant Singh Meena ADO (L.N)		
9	Name of the designation of officer from the building side	Mrs. Bivha Khanna (Manager) Vibha		
10	Year of construction	2005		
11	Applicant's letter no.	Email. Dated - 29/02/2024		
S.No	Minimum standard of fire prevention and fire safety U/R 33	Old Circular Requirement	Provided at site	Remarks MR/NMR
1	Access to Building:			
A	Road width	06 mtrs.	06 mtrs. ✓	MR
B	Gate width	N/A	N/A	N/A
C	Width of internal road	N/A	N/A	N/A
2	Number, Width, Type and Arrangement of Exits:			
A	Number of staircases			
a	Upper floor	02 no.	02 nos. ✓	MR
b	Basement	N/A	N/A	N/A
B	Width of staircases			
a	Upper floor	1.50 mtrs.	1.30 mtrs. & 0.80mtrs. ✓	MR (old accepted)
b	Basement	N/A	N/A	N/A
C	Protection of exits			
a	Fire check door	N/A	N/A	N/A
b	Pressurization	N/A	N/A	N/A
D	No. of continuous staircases to terrace	01 no.	01 no. ✓	MR
E	Width of corridor	1.50 mtrs.	1.50 mtrs. ✓	MR
F	Door size	1.0 mtr.	1.0 mtr. ✓	MR
3	Compartmentation:			
A	Fire check door	NA	NA	NA
B	Sealing of electrical shafts	N/A	N/A	N/A
C	Fire rating of shaft door	N/A	N/A	N/A
D	Water curtain	N/A	N/A	N/A
E	Fire dampers	N/A	N/A	N/A
4	Smoke Management System:			
A	Basement	N/A	N/A	N/A
B	Upper floor	N/A	N/A	N/A

5. Fire Extinguisher:				
	A	Total numbers	08 nos.	08 nos. MR
	B	Types	CO ₂ & ABC	CO ₂ & ABC MR
	C	ISI marking	ISI Marked	Provided MR
6 First-Aid-Hose Reel:				
	A	Total numbers of each floor	01 no.	01 no. MR
	B	Length of hose reel hose	30 mtrs.	30 mtrs. MR
	C	Nozzle diameter	05 mm	05 mm MR
7 Automatic Fire Detection and Alarming System:				
	A	Type of detectors	N/A	N/A N/A
	B	Location of main panel	N/A	N/A N/A
	C	Location of repeater panel	N/A	N/A N/A
	D	Alternate source of power	N/A	N/A N/A
	E	Hooters	N/A	N/A N/A
8 MOEFA:			Required	Provided MR
9 Public Address System:			N/A	N/A N/A
10 Automatic Sprinkler System:				
	A	Basement	N/A	N/A N/A
	B	Upper floor	N/A	N/A N/A
	C	Sprinkler above false ceiling	N/A	N/A N/A
11 Internal Hydrants:				
	A	Size of riser/down-comer	N/A	N/A N/A
	B	Number of hydrants per floor	N/A	N/A N/A
	C	Hose box	N/A	N/A N/A
12 Yard Hydrants:				
	A	Total number of hydrants	N/A	N/A N/A
	B	Hose box	N/A	N/A N/A
13 Pumping Arrangements:				
1 Ground level				
	A	Discharge of main pump	N/A	N/A N/A
	B	Head of main pump	N/A	N/A N/A
	C	Number of main pumps	N/A	N/A N/A
	D	Jockey pump out put	N/A	N/A N/A
	E	Jockey pump head	N/A	N/A N/A
	F	Standby pump out put	N/A	N/A N/A
	G	Standby pump head	N/A	N/A N/A
	H	Auto starting /manual stopping	N/A	N/A N/A
	I	Pump house access	N/A	N/A N/A
2 Terrace Level				
	A	Discharge of pump	450 LPM	450 LPM MR
	B	Head of the pump	40 mtrs	40 mtrs MR
	C	Power supply	Required	Provided MR
	D	Auto starting of pump	Required	Provided MR

W

501

2/14

Florence Public School located at 19-A, Pratap Nagar, Mayur Vihar Phase-01, Delhi-110091.

14	Captive Water Storage for Fire Fighting:			
	A	Underground tank capacity	N/A	N/A
	B	Draw-off connection	N/A	N/A
	C	Fire service inlet	N/A	N/A
	D	Access to tank	N/A	N/A
	E	Overhead tank capacity	5,000 liters.	5,000 liters. MR
15	Exit Signage:		Required	Provided MR
16	Provision of Lifts:			
	A	Pressurization of lift shaft	N/A	N/A
	B	Pressurization of lift lobby	N/A	N/A
	C	Communication in lift car	N/A	N/A
	D	Firemen's grounding switch	N/A	N/A
	E	Lift signage	N/A	N/A
17	Standby Power Supply:			
18	Refuge Area:			
	A	Total area	N/A	N/A
	B	Location	N/A	N/A
19	Fire Control Room:			
	A	Detector system panel	N/A	N/A
	B	Flow switch panel	N/A	N/A
	C	PA system panel	N/A	N/A
	D	Battery backup	N/A	N/A
	E	Building floor plans	N/A	N/A
20	Special Fire Protection systems for protection of special Risks, if any:			
			N/A	N/A

Note: - Earlier, the school building was comprised of ground plus two upper floors & was issued FSC vide letter no. F6/DFS/MS/School/2018/NDZ/2225 dated 03.10.2018. Now, the school building is comprised of ground plus three upper floors but the manager (Owner) of the school has given an under taking that he has sealed the third with brick wall (Photos placed on file). (C-27/C-28/C-29).

The fire protection system was randomly checked and tested and was found functional at the time of inspection. The shortcomings issued vide letter no. F6/DFS/MS/School/2022/NDZ/168 dated 08/04/2022 by this department has been rectified by the management.

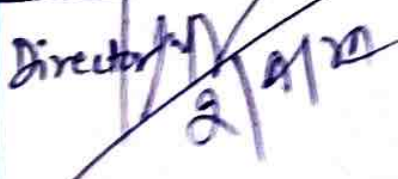
Keeping in view of the deemed compliance of minimum standards of fire prevention and fire safety measured as required under the rules. The FSC issued vide letter no. F6/DFS/MS/School/2018/NDZ/2225 dated 03.10.2018 renewal under the circular no.262-362 dated 17/01/2005 is recommended.


01/4/2024

Signature of the Inspecting Officer
Name Yashwant Singh Meena
Designation ADO (L.N)

~~IV. CFO/NDZ~~

CFO. - on m/r

Director 
2/4/24

