

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001
No. F.6/DFS/MS/EH/2024/SZ/227 Dated: 18/07/2024

FIRE SAFETY CERTIFICATE

Certified that the Eating House in the name & style of **M/s ZIU** located at **Shop No 8, 9 & 10, Ground floor**, Sangam Courtyard, Major Som Nath Marg, Sector 9, R.K Puram, New Delhi 110022 in the building comprised of 03 tier Basement, ground plus three upper floor owner/occupied by Unit of Eurasian Speciality LLP was issued FSC by this department vide letter no F6/DFS/MS/EH/2021/SZ/371 dated 14/12/2021. The premise was re-inspected by the officers concerned of this department on 09/07/2024 in the presence of Mr. Pardeep Kumar (Manager) and found that the said restaurant premises have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rule, 2010 and that the building/premises is fit for occupancy **Class- D "Assembly Building"** (Restaurant at GF only) and **validity upto 31/03/2027** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on18/07...../2024 at New Delhi by.

(ATUL GARG)
DIRECTOR
DELHI FIRE SERVICE

Copy to: -

1. The Addl. Commissioner of Police (Lic/Branch), First floor, P.S. Defence Colony, New Delhi-110049 (Ref. MHA Portal ID 2024061809531 dated 19/06/2024 & 2024062710055 dated 27/06/2024)

Conditions for the validity of Fire Safety Certificate: -

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangement provided therein shall be maintained in good working condition at all time as seen during inspection. Any loss of life property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of fire fighting system.
4. The owner/occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or alteration (Clause 1.4.3 of UBBL-2016), if any.
6. "The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (l) of rule 37] along with a copy of this Certificate, six month prior to its expiry."

114
INSPECTION REPORT

1	Name & Address of the Building	M/s ZIU (A Unit of Eurasian Speciality LLP), Shop No 8, 9 & 10, at Sangam Courtyard, Major Som Nath Marg, Sector 9, R.K Puram, New Delhi 110022		
2	Type of Occupancy	Group-D Assembly Building. (Eating house)		
3	Building Comprised of	03 tier basement, ground plus three upper floors		
4	Type of Case	Renewal		
5	Details of Previous NOC	F6/DFS/MS/EH/2021/SZ/371 dated 14/12/2021		
6	Fire Safety Directives Letter No	F6/DFS/MS/Cinema/2023/SZ/576 dated 01/12/2023		
7	Date of Inspection	09/07/2024		
8	Name of the Inspecting Officers	DO (South) & ADO (BCP)		
9	Name & Designation of Officers from the building side	Mr. Pardeep Kumar		
10	Year of construction	2015	Restt. located at ground floor only	
11	Applicant letter No.	MHA Portal ID 2024061809531 dated 19/06/2024 & 2024062710055 dated 27/06/2024		
S. No.	Minimum standards on Fire Prevention and Fire Safety U/R 33	UBBL-2016 Requirements	Provided at Site	Remarks MR/NMR
1	Access to Building.	F6/DFS/MS/Cinema/2023/SZ/576 dated 01/12/2023		
	<ul style="list-style-type: none"> Road width Gate width Width of internal road 	Restt. within Mall	Provided* Provided* Provided*	MR MR MR
2	Number, width, type & arrangement of exits.	Provided & Maintained by Mall		
	a) Number of Staircase	NA	Restt. at GF	NA
	> Upper floors.	N/A	As above	N/A
	> Basement floor.	Provided & Maintained by Mall		
	b) Width of Staircase	NA	Restt. at GF	NA
	> Upper floors	N/A	As above	N/A
	> Basement floor	Provided & Maintained by Mall		
	c) Protection of exits	N/A	N/A	N/A
	> Fire check door	N/A	N/A	N/A
	> Pressurization	Required	One	MR
	d) No. of continuous staircase to terrace	N/A	N/A	N/A
	e) Width of corridor	1.50 mtr each	2.29 m & 2.40 m	MR (old case)
	f) Door size	Provided & Maintained by Mall		
3	Compartmentation.	N/A	N/A	N/A
	• Fire check door.	N/A	N/A	N/A
	• Sealing of electrical shafts.	N/A	N/A	N/A
	• Fire rating of shaft door.	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire dampers.	N/A	N/A	N/A
4	Smoke Management system.	Provided & Maintained by Mall		
	• Basement	30 ACPH	Provided*	MR
	• Upper floors	12 ACPH	Exhaust Fans Provided	MR
5	Fire Extinguishers.	Required	10 Nos	MR
	• Total numbers	ABC/CO ₂	ABC-07 & CO ₂ -03	MR
	• Types	ISI marked	Provided	MR
	• ISI Marking	Provided & Maintained by Mall		
6	First Aid Hose Reels.	Two	Provided*	MR
	• Total numbers on each floor.	30m	Provided*	MR
	• Length of hose-reel hose.	5mm	Provided*	MR
	• Nozzle Diameter	Provided & Maintained by Mall		
7	Automatic fire detection & alarming system.	N/A	Provided*	N/A
	• Type of detectors	N/A	Provided*	N/A
	• Location of Main Panel	N/A	Provided*	N/A
	• Location of Repeater Panel	N/A	Provided*	N/A
	• Alternate source of power	N/A	Provided*	N/A
	• Hooter's location	N/A	Provided*	N/A


8	MOEFA	Required	Provided	MR
9	Public Address System	N/A	N/A	N/A
10	Automatic Sprinkler System	Provided & Maintained by Mall		
	• Basement	N/A	N/A	N/A
	• Ground floor.	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	N/A
11	Internal Hydrants.	Provided & Maintained by Mall		
	• Size of Riser/Down-comer	N/A	N/A	N/A
	• Number of Hydrant per floor	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
12	Yard Hydrants.			
	• Total number of hydrants.	N/A	N/A	N/A
	• Hose box.	N/A	N/A	N/A
13	Pumping arrangements.			
	• Ground Level	Provided & Maintained by Mall		
	➢ Discharge of main pump.	2850 LPM	Provided*	MR
	➢ Head of main pump.	70 m	Provided*	MR
	➢ Number of main pumps.	02	Provided*	MR
	➢ Jockey Pump output.	180 LPM	Provided*	MR
	➢ Jockey Pump head.	70 m	Provided*	MR
	➢ Standby Pump output.	2850 LPM	Provided*	MR
	➢ Standby Pump head.	70 m	Provided*	MR
	➢ Auto Starting/Manual Stopping.	Required	Provided*	MR
	➢ Pump house access.	Required	Provided*	MR
	• Terrace Level	Provided & Maintained by Mall		
	➢ Discharge of pump.	N/A	Provided*	N/A
	➢ Head of pump.	N/A	Provided*	N/A
	➢ Power supply.	N/A	Provided*	N/A
	➢ Auto starting of pump.	N/A	Provided*	N/A
14	Captive water storage for fire fighting.	Provided & Maintained by Mall		
	• Underground tank capacity.	2,00,000 ltrs	Provided*	MR
	➢ Draw-off connection.	Required	Provided*	MR
	➢ Fire Service Inlet.	Required	Provided*	MR
	➢ Access to tank.	Required	Provided*	MR
	• Overhead tank capacity.	20,000 ltrs	Provided*	MR
15	Exit Signage.	Required	Provided*	MR
16	Provision of Lifts.	Provided & Maintained by Mall		
	• Pressurization of lift shaft.	Required	Provided*	MR
	• Pressurization of lift lobby.	Required	Provided*	MR
	• Communication in lift car.	Required	Provided*	MR
	• Fireman's switch.	Required	Provided*	MR
	• Lift signage.	Required	Provided*	MR
17	Standby Power Supply	Required	Provided*	MR
18	Refuge Area			
	• Total area	N/A	N/A	N/A
	• Location	N/A	N/A	N/A
19	Fire Control Room.	Provided & Maintained by Mall		
	• Detector system panel.	Required	Provided*	MR
	• Flow switch panel.	Required	Provided*	MR
	• PA system panel.	Required	Provided*	MR
	• Battery backup.	Required	Provided*	MR
	• Building floor plan.	Required	Provided*	MR
20	Special Fire Protection System for the Protection of special Risk, if any.	N/A	N/A	N/A


n/b


The fire protection system provided in the building were randomly checked and found functional at the time of inspection.

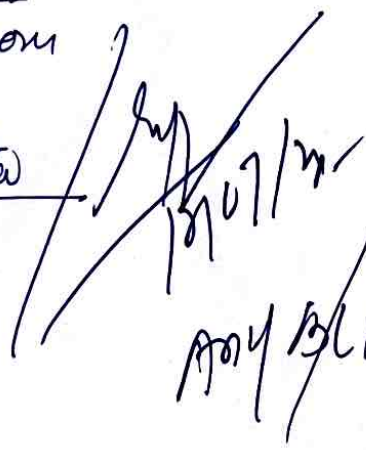
Keeping in view of the deemed compliance of the minimum standard on fire prevention and fire safety measures as required under the rules, the FSC issued vide letter no F6/DFS/MS/EH/2021/SZ/371 dated 14/12/2021, renewal under rule 37 of the Delhi Fire Service rules, 2010 is recommended.

Accordingly, DFA is put up for approval and signature please.



Signature of the Inspection Officer
Name: Sh. Manoj Kumar Sharma
Design: DO (South)


Signature of the Inspecting Officer
Name: Sh. Rajesh Kumar
Design: ADO (BCP)

CFO (HQ) 

~~Director ~~
May 13/24

As approved, F.T. letter is put up
for your signature P1


16/12/24

~~Director ~~
mu

Uploaded
20/12/24

