

C-120

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS, DELHI FIRE SERVICE, NEW DELHI - 110001

No.F6/DFS/MS/Hospital/NDZ/2024/ 708

Dated: 04.12.2024

FIRE SAFETY CERTIFICATE

Certified that the **Master Amir Chand Block (B- Block), G.B. Pant Hospital at New Delhi** comprised of **Gr. + 07 Upper floor**, was earlier granted FSC by this department vide letter No. F6/DFS/MS/Hospital/NDZ/2021/346 dated 23.07.2021. Now, the premises was re-inspected by the officers concerned of this department on 22/11/24 in the presence of Mr. Amit, JE and found that the said building has deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the premises **Master Amir Chand Block (B- Block)** is fit for occupancy class **Institutional Building Group C (IV) Sub-Division** with effect from 04.12.2024 for period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules 2010, printed below.

Issued 04.12.2024.....at New Delhi by.


(Atul Garg)
DIRECTOR
Delhi Fire Service

Copy to:-

1. The Commissioner , MCD , Civic Centre , New Delhi
2. The Medical Superintendent, G.B. Pant Hospital, New Delhi.
3. The Executive Engineer (E), Health Maint. Elect. Division (C), PWD, Lok Nayak Hospital, New Delhi.

Conditions for the validity of fire safety certificate

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times.
2. Any loss of life or property due to non functional fire safety measures shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. Any deviation w.r.t. construction, set back area, electrical installation, Lift etc. shall be verified by the concerned building sanctioning authority.
5. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
6. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
7. The means of escape such as passage, corridor lobby, alternate exit etc shall be kept unobstructed / unlocked for unhindered evacuation in case of an emergency.
8. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry".
9. Any flammable material for interior decoration is prohibited.

M/39

INSPECTION REPORT

- 1. Name & address of the building : Master Amir Chand Block (B- Block),
G.B. Pant Hospital at New Delhi.
- 2. Type of occupancy : Institutional Building
Ground + 07 Upper floors
- 3. Type of case:- : Renewal (12 point)
- 4. Details of previous FSC : F6/DFS/MS/Hospital/NDZ/2021/346 dated
23.07.2021.
- 5. Fire safety directives No. : N/A
- 6. Date of inspection:- 22/11/2024
- 7. Name of the inspecting officer : Sh. Rajinder Atwal DO/CD &
Sh. Ravinder Singh ADO/CC
- 8. Name & designation of officer
From the building side : Mr. Amit, JE
- 9. Year of construction : 1988
- 10. Applicant's letter No : e -amil rkbaeche3@gmail.com
dated 22/10/2024

S.No.	Minimum Standards on fire Prevention and fire safety U/R 33	Requirement Existing fire safety arrangements	Provided at site	Remarks MR/NMR
1.	Approach to Building			
	1) Road width	06 mtr.	16 mtr.	MR
	2) Gate width	05 mtr.	05 mtr.	MR
	3) Width of internal road	N/A	4 to 6 mtr.	N/A
2.	Number, Width Type & Arrangement of Exits			
	A. Number of staircases			
	1. Upper floors	02 No. & 01 ramp	02 No. & 01 ramp	MR
	2. Basements	N/A	N/A	N/A
	B. Width of staircase			
	1. Upper floors (one ramp)	02 mtr.	02 mtr. each	MR
	2. Basements	N/A	N/A	N/A
	C. Protection of exits			
	1. Fire check door	N/A	Provided	N/A
	2. Pressurization	N/A	N/A	N/A
	D. No. of continuous staircase to terrace	02	02	MR
	E. Width of corridor	2.4 mtr.	2.4 mtr.	MR
	F. Door size	1.0 mtr.	1.0 mtr.	MR
3.	Compartmentation			
	1) Fire check door (Escape staircase)	Required	Provided	MR
	2) Sealing of electrical shafts	Required	Provided	MR
	3) Fire rating of shaft door	N/A	N/A	N/A
	4) Water curtain	N/A	N/A	N/A
	5) Fire Dampers	N/A	N/A	N/A
4.	Smoke Management System			
	1) Basements	N/A	N/A	N/A
	2) Upper floors	12 ACPH	Provided	MR
5.	Fire Extinguishers			
	1) Total numbers	100 Nos.	105 Nos.	MR
	2) Types	ABC & CO2	ABC, CO2 &	MR
	3) ISI marking	Required	Provided	MR

N/40

6.	First-Aid Hose Reel			
	1) Total number of each floor	02	03	MR
	2) Length of hose reel hose	30 m	30 m	MR
	3) Nozzle diameter	5 mm	5 mm	MR
7.	Automatic Fire Detection & Alarming System			
	1) Type of detectors	Smoke	Provided	MR
	2) Location of main panel	Gr. Floor	Provided	MR
	3) Location of repeater panel	Zone wise	Zone wise	MR
	4) Alternate source of power	Required	Provided	MR
	5) Hooter's Location at each floor	Required	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System			
	1) Basement	N/A	N/A	N/A
	2) Upper floors	N/A	N/A	N/A
	3) Sprinkler above false ceiling	NA	NA	NA
11.	Internal Hydrants			
	1) Size of riser/down-comer	150 MM	150 MM	MR
	2) Number of hydrants per floor	02	03	MR
	3) Hose box each floor	02	03	MR
12.	Yard Hydrants			
	1) Total number of hydrants	06	06	MR
	2) Hose box	06	06	MR
13.	Pumping Arrangement		Common with G.B. Pant	Hospital
	1) Ground level			
	a) Discharge of main pump	2850 LPM	2850 LPM	MR
	b) Head of main pump	70 mtr.	70 mtr.	MR
	c) Number of main pump	02	02	MR
	d) Jockey pump output (2 Nos.)	180 LPM	180 LPM	MR
	e) Jockey pump head	70 mtr.	70 mtr.	MR
	f) Stand by pump output	2850 LPM	2850 LPM	MR
	g) Stand by pump head	70 mtr.	70 mtr.	MR
	h) Auto starting/Manual stopping	Required	Provided	MR
	2) Terrace level			
	a) Discharge of pump	N/A	N/A	N/A
	b) Head of pump	N/A	N/A	N/A
	c) Power supply	N/A	N/A	N/A
	d) Auto starting of pump	N/A	N/A	N/A


N/11

14.	Captive Water Storage for Fire Fighting			
	1) Under ground tank capacity	1,00,000 ltr.	2,00,000 ltr.	MR
	a) Draw-off connection	Required	Provided	MR
	b) Fire service inlet	Required	Provided	MR
	c) Access to tank	Required	Provided	MR
	d) Over head tank capacity	20,000 Ltrs.	20,000 Ltrs.	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	a) Pressurization of lift shaft	N/A	Provided	N/A
	b) Pressurization of lift lobby	N/A	N/A	N/A
	c) Communication in lift car	Required	Provided	MR
	d) Fireman's switch	Required	Provided	MR
	e) Lift signage	Required	Provided	MR
17.	Stand by Power Supply	Required	Provided	MR
18.	Refuge Area	N/A	N/A	N/A
	Total area location	N/A	N/A	N/A
19.	Fire Control Room	N/A	Provided	N/A
	a) Detector system panel	Required	Provided	MR
	b) PA system panel	Required	Provided	MR
	c) Battery backup	Required	Provided	MR
	d) Building floor plan	Required	Provided	MR
20.	Special Fire Protection System for Protection of special Risk, if any:			MR


The fire protection systems provided in the building were randomly tested, checked and found functional at the time of inspection.


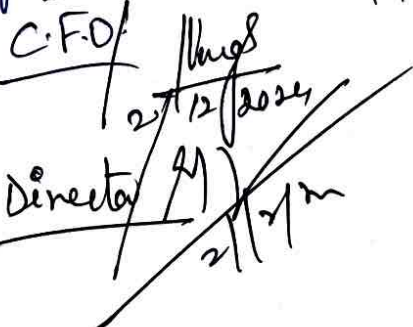
In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules (12 minimum point), if agreed, we may renew the FSC issued vide letter No. F6/DFS/MS/Hospital/NDZ/2021/346 dated 23.07.2021, Accordingly, FSC letter is prepared and put up for kind perusal, approval and signature please

Signature of the Inspecting Officer


 Name :- Sh. Rajinder Atwal
 Designation :- DO (CD)

Signature of the Inspecting Officer


 Name :- Sh. Ravinder Singh
 Designation :- ADO (CC)

~~Dy. CFS (MS)~~
 C.F.O.
 Director (M)


 27/11/24
 27/12/2024
 21/1/24
 ADO/CC