

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS, DELHI FIRE SERVICE, CONNAUGHT PLACE

C-101

No. F6/DFS/MS/BNQT/WZ/2022/ 91
To,

Dated: 10/06/2022

The Dy. Health Officer (West Zone),
NDMC, Public health department,
Karol Bagh Zone, Anand Parbat,
New Delhi -110005.
Email Id : - (dhowest zone@gmail.com).

Subject: **Regarding Renewal of NOC from fire safety point of view in respect of M/s Ananda Banquets, located at 33, Shivaji Marg, Najafgarh Road, New Delhi-110015.**

Sir,

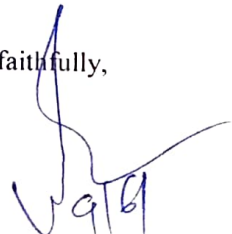
Please refer to your online application no. 2022041707295 dated 17/04/2022 on the subject cited above. In this connection, it is to inform you that the premises was inspected by the officer concerned of this department on 24/05/2022 in the presence of Sh. Ishant Harjai to check the functioning of fire safety arrangements provided in the building.

During inspection, it has been observed that the said Banquet Hall is running at Ground + 1st floor & 2nd floor, in a building comprised of Basement + Ground + 02 upper floors was issued FSC vide letter no. F6/DFS/MS/WZ/2018/2737 dated 19/12/2018 for **(Ground Floor only)** now the management is requested for issuance of F.S.C of Ground + 1st floor & 2nd floor. Fire Safety arrangements such as Fire Extinguishers, First -Aid Hose reel, Terrace pump, overhead water storage tank etc. have been provided in the building. However, the following shortcomings were observed.

1. Two staircases of width 2m & 1.40 m are provided in Basement against requirement of 1.5m, 1.25m & 1.25m.
2. Fire Check Door is removed at some places.
3. Smoke Management system is provided but not functional.
4. First Aid Hose Reel is provided but not functional.
5. Smoke & Heat Detectors Found removed.
6. MOEFA is provided but not functional.
7. Public Address System is provided but not functional.
8. Exit signages are found removed.
9. Internal Hydrant is provided but not functional.
10. Main Pump 2280 LPM, Stand by Pump 2280LPM & 180 LPM Jockey pump found removed.
11. Terrace level pump is provided but not functional.
12. Terrace Tank is using as domestic purpose.
13. Sprinkler & Detectors shall be extended in left out area.


In view of above Shortcomings the application for Issuance of Fire safety Certificate is rejected. The occupancy of the Building/ premises in absence of requisites fire safety Arrangements Shall be at the risk and liabilities of the Owner/occupier. The license issuing authority/statutory authority is requested that premises should not be allowed to run till it provide all necessary fire Safety arrangements.

Yours faithfully,


(Dharampal Bhardwaj)
Dy. Chief Fire Officer
West Zone

Copy To:-

1. The Dy. Health Officer, Karol Bagh Zone, NDMC, Anand Parbat, New Delhi.
2. The Owner/Occupier of M/s Ananda Banquets, located at 33, Shivaji Marg, Najafgarh Road, New Delhi-110015.


07/06/2022