

c18

DFA

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI

c19

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE
NEW DELHI- 110001

No. F6/DFS/MS/School/2022/SZ/ 701

Dated: 18/11/2022

To,

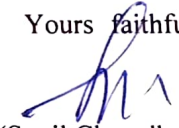
The Manager,
Sukho Khalsa Sr. Sec. School,
Jail Road, Janakpuri, New Delhi-110058.

Sub:- Regarding issue of "Fire Safety Certificate" from fire safety point of view in r/o Sukho Khalsa Sr. Sec. School, Jail Road, Janakpuri, New Delhi-110058.

Sir,

This has reference to your letter No. SK/Fire Safety/22/292 dated 13/10/2022 on the subject captioned above. In this connection, it is to inform you that the above mentioned building/premises was inspected by the officer concerned of this department on 07/11/2022 in the presence of Sh. Kuldeep Singh Thapar to verify the compliance of shortcoming already communicated by this department vide letter No. F6/DFS/MS/School/2018/SZ/1997 Dated 11/05/2018 and observed that shortcomings are still not rectified. The management will be held responsible for any untoward incident for the period if compliance is not made.

Yours faithfully


(Sunil Chawdhary)

Dy. Chief Fire Officer



Copy to:-

1. The Director of Education,
Govt. of NCT of Delhi, Old Secretariat,
New Delhi-110054.

(With a request to take further action as school does not have fire NOC)

C-2
C-14

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001**

No: F.6/DFS/MS/School/2018/SZ / 1999

Dated: 11/05/18

To,

The Principal,
Sukho Khalsa Sr. Sec. School,
Jail Road, Janakpuri, New Delhi-110058

Sub: - Regarding issuance of Fire Safety Certificate in r/o Sukho Khalsa Sr. Sec. School,
Jail Road, Janakpuri, New Delhi-110058

Sir,

This has reference to your Letter No. SK/FireSafety/18/487 dated 16.03.2018 on the subject cited above. In this connection, it is to inform you that the inspection of above said school building has been carried out by officer concerned of this department on 04.04.2018 to see the compliance of the requisite fire safety measures. Smt. Gurbachan Kaur Thapar (Principal) was present at the time of inspection.

During the course of inspection it was observed that school building comprised of two blocks namely Main Block and Auditorium Block. Main block is having basement, ground plus one upper floor and Auditorium Block is having ground floor only. The upper floor of Main Block is served by four staircases having width 160, 140, 135 & 130 cms and the basement is served by two staircases having width 160 & 120 cms. The building is approachable to the fire fighting vehicles. The electrical wiring was seen concealed and the electric supply was passing through MCB's. The following shortcomings were observed:-

1. Single door having width 103 cms is provided against required double doors having width 100 cms each in class rooms and Doors having width 240, 140 & 140 cms is provided against required two doors having width 200 cms each in auditorium.
2. Hose reel system is not provided for auditorium block.
3. The Sprinkler system is not provided in the basement.
4. Fire Pumps of 450 LPM (02 no.'s) capacity are not provided.
5. Overhead water storage tank of 15,000 ltrs capacity is not provided.

You are advised to rectify the above-mentioned shortcomings for taking further action as necessary for grant of Fire Safety Certificate.

Yours Faithfully,

W
11/5

(VIPIN KENTAL)
CHIEF FIRE OFFICER

Copy to:-

Director of Education,
Govt. of NCT of Delhi, Old Secretariat,
New Delhi-110054

Q/c Sam
10/5/18