



**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEADQUARTERS, DELHI FIRE SERVICE, NEW DELHI-110001**

No. F6/DFS/MS/Hospital/2023/1503

Dated: 18/07/2023

To,

The Executive Engineer (Bldg.),  
South Delhi Municipal Corporation,  
9<sup>th</sup> floor, Civic Centre, Minto Road,  
New Delhi-110002.

Subject: - **Regarding Issuance of Fire Safety Certificate in R/o R.G. Stone Urology & Laparoscopy Hospital, Located at B-1, Vishal Enclave, Rajouri Garden, New Delhi- 110027.**

Sir,

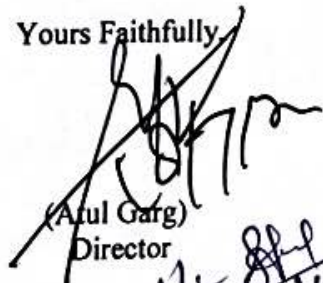
Please refer to your letter no. nil dated nil received through outdoor dairy no. 1991 dated 16/05/2023 on the subject cited above. In this connection, it is to inform you that the inspection has been carried out of R.G. Stone Urology & Laparoscopy Hospital, by the officer concerned of this department on dated 05/06/2023 in the presence of Dr. Amit.

During inspection it has been observed that the building is comprised of Basements + Ground + 03 Upper Floors Fire Safety arrangements such as Fire Extinguisher, First-Aid Hose Reel, MOEFA, Public Address System, Internal Hydrant, Yard Hydrant, Exit Signage's, Under Ground Tank, Over Head Tank, etc are provided. However, the following shortcoming is observed:-

1. Width of staircases in basement is provided 1.45m & 1x 1.70m against requirement of 2 x 1.5m.
2. Width of staircases in upper floors is provided 2m, 1.45m & 0.90mtr against requirement of 2 x 1.5mtr & 1 x 2m.
3. Fire Check Door is not provided at some places.
4. Width of corridor is provided 1.78m against requirement of 2.40m.
5. Door size of patient rooms is provided 96cm to 108cm against requirement of 1.25mtr & 2mtr.
6. Smoke Management System is not provided.
7. Smoke Detector & Sprinkler System is not provided in Ground floor & 3<sup>rd</sup> floor.
8. Standby pump capacity of 1620lpm is not provided.
9. Under Ground Water Storage Tank capacity of 20000ltr provided against requirement of 75000 ltr.
10. Exit Signage's are not provided.
11. Lift lobby is not segregated with Fire Check Door.

In view of above Shortcomings the application for renewal of Fire safety Certificate is cannot consider at this stage & rejected. The occupancy of the Building/ premises in absence of requisites fire safety measures shall be at the risk and liabilities of the owner/occupier. Statutory authority may take suitable necessary action as deemed fit.

Yours Faithfully,

  
(Atul Garg)  
Director  
26/6/2023

Copy To: -

1. The Medical Superintendent, R.G. Stone Urology & Laparoscopy Hospital, Located at B-1, Vishal Enclave, Rajouri Garden, New Delhi- 110027.
2. The Director. DGHS, New Karkardooma Court, Anand Vihar, New Delhi 110032.